

REPORT NO. NADC-77140-30

12  
B.S

AD A 046825



# EFFECT OF CORROSION RESISTANT COATINGS ON THE FATIGUE STRENGTH OF CAST MAGNESIUM ALLOYS

James J. Bethke  
Air Vehicle Technology Department  
NAVAL AIR DEVELOPMENT CENTER  
Warminster, Pennsylvania 18974

1 SEPTEMBER 1977

FINAL REPORT  
CUSTOMER PROJ. NO. EJ-4-H0042-EJ-F6

APPROVED FOR PUBLIC RELEASE; DISTRIBUTION UNLIMITED

AD No. \_\_\_\_\_  
DDC FILE COPY

Prepared for  
MATERIALS AND MANUFACTURING TECHNOLOGY DIVISION  
U. S. Army Aviation R&D Command  
(Frankford Arsenal)  
Philadelphia, Pennsylvania 19137

DDC  
RECEIVED  
NOV 28 1977  
B

## NOTICES

**REPORT NUMBERING SYSTEM** - The numbering of technical project reports issued by the Naval Air Development Center is arranged for specific identification purposes. Each number consists of the Center acronym, the calendar year in which the number was assigned, the sequence number of the report within the specific calendar year, and the official 2-digit correspondence code of the Command Office or the Functional Department responsible for the report. For example: Report No. NADC-76015-40 indicates the fifteenth Center report for the year 1976, and prepared by the Crew Systems Department. The numerical codes are as follows:

CODE	OFFICE OR DEPARTMENT
00	Commander, Naval Air Development Center
01	Technical Director, Naval Air Development Center
02	Program and Financial Management Department
07	V/STOL Program Office
09	Technology Management Office
10	Naval Air Facility, Warminster
20	Aero Electronic Technology Department
30	Air Vehicle Technology Department
40	Crew Systems Department
50	Systems Department
60	Naval Navigation Laboratory
81	Technical Support Department
85	Computer Department

**PRODUCT ENDORSEMENT** - The discussion or instructions concerning commercial products herein do not constitute an endorsement by the Government nor do they convey or imply the license or right to use such products.

APPROVED BY:



DATE:

14 Sept 1977

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

## REPORT DOCUMENTATION PAGE

READ INSTRUCTIONS  
BEFORE COMPLETING FORM

1. REPORT NUMBER

NADC-77149-39

2. GOVT ACCESSION NO.

3. RECIPIENT'S CATALOG NUMBER

4. TITLE (and Subtitle)

EFFECT OF CORROSION RESISTANT COATINGS ON THE  
FATIGUE STRENGTH OF CAST MAGNESIUM ALLOYS.

5. TYPE OF REPORT &amp; PERIOD COVERED

Final Report.

7. AUTHOR(s)

James J. Bethke

8. CONTRACT OR GRANT NUMBER(s)

9. PERFORMING ORGANIZATION NAME AND ADDRESS

Air Vehicle Technology Department  
Naval Air Development Center  
Warminster, PA 1897410. PROGRAM ELEMENT, PROJECT, TASK  
AREA & WORK UNIT NUMBERSCustomer Proj. No. EJ-4-  
H0042-EJ-F6

11. CONTROLLING OFFICE NAME AND ADDRESS

Materials & Manufacturing Technology Division  
ARRADCOM (Frankford Arsenal)  
Philadelphia, PA 19137

12. REPORT DATE

1 September 1977

13. NUMBER OF PAGES

86

14. MONITORING AGENCY NAME &amp; ADDRESS (if different from Controlling Office)

15. SECURITY CLASS. (of this report)

UNCLASSIFIED

15a. DECLASSIFICATION/DOWNGRADING  
SCHEDULE

16. DISTRIBUTION STATEMENT (of this Report)

APPROVED FOR PUBLIC RELEASE; DISTRIBUTION UNLIMITED.

17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)

18. SUPPLEMENTARY NOTES

19. KEY WORDS (Continue on reverse side if necessary and identify by block number)

Magnesium Castings  
AZ91, ZE41, and EZ33 Alloys  
Fatigue Strength  
Anodic CoatingsChromate Conversion Coatings  
Acid Pickling  
Shot Peening

20. ABSTRACT (Continue on reverse side if necessary and identify by block number)

A study was made for the Army Aviation Materiel Readiness Command to evaluate the effects of various surface treatments and corrosion resistant coating systems on the fatigue properties of three sand cast magnesium alloys (AZ91-T6, ZE41-T5, and EZ33-T5) of current or potential use in helicopter component housings. This was part of a larger program undertaken by the Frankford Arsenal to provide significant reduction of costs and down-time associated with the corrosion degradation of these housings. (Cont'd)

DD FORM 1473

EDITION OF 1 NOV 65 IS OBSOLETE

S/N 0102-LF-014-6601

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

407 207

LB

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

20. (Continued)

Coatings evaluated were DOW 1 and DOW 7 chromate conversion coatings and the HAE and DOW 17 anodic coatings, both light and heavy applications. Pre-treatments such as acid pickling, shot peening, and polystyrene impregnation were also evaluated as well as several different organic topcoats.

R. R. Moore rotating beam ( $R = -1$ ) and sheet flexure ( $R = .1$ ) fatigue tests were run with machined and as-cast surfaces, respectively. The test results showed that:

1. The chromate conversion and anodic coatings are not necessarily detrimental to the fatigue properties of the three magnesium alloys when applied to unpickled surfaces. In fact, for two alloys, AZ91 and ZE41, an increase in fatigue strength was observed. Thus, acid pickling is seen to be a major detriment.

2. Shot peening eliminates the deleterious effects of pickling and coatings for all three alloys.

3. The HAE heavy anodic coating performed somewhat better than the others in regard to its effect on substrate fatigue strength, although no coating performed significantly best. The HAE heavy coating did outperform the DOW 17 heavy anodic and DOW 7 chromate conversion coatings with respect to minimizing the effects of corrosive environment (both salt fog and high humidity) on subsequent fatigue properties.

4. The ZE41 alloy casting material appeared best in that it showed the most favorable interaction with the various coatings and treatments with respect to subsequent fatigue performance.

CLASSIFICATION	
1	
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	
81	
82	
83	
84	
85	
86	
87	
88	
89	
90	
91	
92	
93	
94	
95	
96	
97	
98	
99	
100	
101	
102	
103	
104	
105	
106	
107	
108	
109	
110	
111	
112	
113	
114	
115	
116	
117	
118	
119	
120	
121	
122	
123	
124	
125	
126	
127	
128	
129	
130	
131	
132	
133	
134	
135	
136	
137	
138	
139	
140	
141	
142	
143	
144	
145	
146	
147	
148	
149	
150	
151	
152	
153	
154	
155	
156	
157	
158	
159	
160	
161	
162	
163	
164	
165	
166	
167	
168	
169	
170	
171	
172	
173	
174	
175	
176	
177	
178	
179	
180	
181	
182	
183	
184	
185	
186	
187	
188	
189	
190	
191	
192	
193	
194	
195	
196	
197	
198	
199	
200	
201	
202	
203	
204	
205	
206	
207	
208	
209	
210	
211	
212	
213	
214	
215	
216	
217	
218	
219	
220	
221	
222	
223	
224	
225	
226	
227	
228	
229	
230	
231	
232	
233	
234	
235	
236	
237	
238	
239	
240	
241	
242	
243	
244	
245	
246	
247	
248	
249	
250	
251	
252	
253	
254	
255	
256	
257	
258	
259	
260	
261	
262	
263	
264	
265	
266	
267	
268	
269	
270	
271	
272	
273	
274	
275	
276	
277	
278	
279	
280	
281	
282	
283	
284	
285	
286	
287	
288	
289	
290	
291	
292	
293	
294	
295	
296	
297	
298	
299	
300	
301	
302	
303	
304	
305	
306	
307	
308	
309	
310	
311	
312	
313	
314	
315	
316	
317	
318	
319	
320	
321	
322	
323	
324	
325	
326	
327	
328	
329	
330	
331	
332	
333	
334	
335	
336	
337	
338	
339	
340	
341	
342	
343	
344	
345	
346	
347	
348	
349	
350	
351	
352	
353	
354	
355	
356	
357	
358	
359	
360	
361	
362	
363	
364	
365	
366	
367	
368	
369	
370	
371	
372	
373	
374	
375	
376	
377	
378	
379	
380	
381	
382	
383	
384	
385	
386	
387	
388	
389	
390	
391	
392	
393	
394	
395	
396	
397	
398	
399	
400	
401	
402	
403	
404	
405	
406	
407	
408	
409	
410	
411	
412	
413	
414	
415	
416	
417	
418	
419	
420	
421	
422	
423	
424	
425	
426	
427	
428	
429	
430	
431	
432	
433	
434	
435	
436	
437	
438	
439	
440	
441	
442	
443	
444	
445	
446	
447	
448	
449	
450	
451	
452	
453	
454	
455	
456	
457	
458	
459	
460	
461	
462	
463	
464	
465	
466	
467	
468	
469	
470	
471	
472	
473	
474	
475	
476	
477	
478	
479	
480	
481	
482	
483	
484	
485	
486	
487	
488	
489	
490	
491	
492	
493	
494	
495	
496	
497	
498	
499	
500	
501	
502	
503	
504	
505	
506	
507	
508	
509	
510	
511	
512	
513	
514	
515	
516	
517	
518	
519	
520	
521	
522	
523	
524	
525	
526	
527	
528	
529	
530	
531	
532	
533	
534	
535	
536	
537	
538	
539	
540	
541	
542	
543	
544	
545	
546	
547	
548	
549	
550	
551	
552	
553	
554	
555	
556	
557	
558	
559	
560	
561	
562	
563	
564	
565	
566	
567	
568	
569	
570	
571	
572	
573	
574	
575	
576	
577	
578	
579	
580	
581	
582	
583	
584	
585	
586	
587	
588	
589	
590	
591	
592	
593	
594	
595	
596	
597	
598	
599	
600	
601	
602	
603	
604	
605	
606	
607	
608	
609	
610	
611	
612	
613	
614	
615	
616	
617	
618	
619	
620	
621	
622	
623	
624	
625	
626	
627	
628	
629	
630	
631	
632	
633	
634	
635	
636	
637	
638	
639	
640	
641	
642	
643	
644	
645	
646	
647	
648	
649	
650	
651	
652	
653	
654	
655	
656	
657	
658	
659	
660	
661	
662	
663	
664	
665	
666	
667	
668	
669	
670	
671	
672	
673	
674	
675	
676	
677	
678	
679	
680	
681	
682	
683	
684	
685	
686	
687	
688	
689	
690	
691	
692	
693	
694	
695	
696	
697	
698	
699	
700	
701	
702	
703	
704	
705	
706	
707	
708	
709	
710	
711	
712	
713	
714	
715	
716	
717	
718	
719	
720	
721	
722	
723	
724	
725	
726	
727	
728	
729	
730	
731	
732	
733	
734	
735	
736	
737	
738	
739	
740	
741	
742	
743	
744	
745	
746	
747	
748	
749	
750	
751	
752	
753	
754	
755	
756	
757	
758	
759	
760	
761	
762	
763	
764	
765	
766	
767	
768	
769	
770	
771	
772	
773	
774	
775	
776	
777	
778	
779	
780	
781	
782	
783	
784	
785	
786	
787	
788	

## S U M M A R Y

## INTRODUCTION

A study was made, for the Army Aviation Materiel Readiness Command, St. Louis, to evaluate the effects of various surface treatments and corrosion resistant coating systems on fatigue properties of three and cast magnesium alloys - AZ91C-T6, ZE41A-T5, and EZ33A-T5 - of current or potential use in helicopter component housings. This was part of a larger program undertaken by ARRADCOM (Frankford Arsenal) to provide significant reduction in costs and downtime associated with the corrosion degradation of these housings.

Currently, the housings are AZ91C-T6 alloy castings, protected with DOW 7 chromate conversion coating and an acrylic lacquer organic topcoat. Castings of ZE41A-T5 and EZ33A-T5 alloys, although of somewhat lower strength, are of interest because of improved resistance to corrosion and good weld repairability, respectively, compared to AZ91C-T6 castings. Coatings evaluated were DOW 1 and DOW 7 chromate conversion coatings and the HAE and DOW 17 anodic coatings - both light and heavy applications. Pretreatments such as acid pickling, shot peening, and polystyrene impregnation were also evaluated as well as several different organic topcoats.

R. R. Moore rotating beam ( $R = -1$ ) and sheet flexure ( $R = .1$ ) fatigue tests were run with machined and as-cast surfaces, respectively; and fatigue life and strength were measured. Also, some tests were run after specimens were exposed to salt fog or humid environment.

## SUMMARY OF RESULTS

## 1. R. R. Moore Screening Tests

a. Acid pickling and shot peening were of major influence on the fatigue strength of all three magnesium alloy cast materials: pickling reducing the fatigue strength by 15 to 20%; peening increasing the fatigue strength by 25 to 35%. The negative effect of pickling was eliminated by prior shot peening: with peened and pickled fatigue strengths 10 to 35% greater than those for the controls, depending upon the alloy.

b. Chromate conversion and anodic coatings provided a minor or second order influence on the magnesium substrate fatigue properties. None of the coatings proved significantly best - although the HAE heavy anodic coating performed consistently well. Anodic coatings on bare surfaces (no pickling or peening) actually showed improved fatigue strength for the AZ91 and ZE41 alloys.

c. Coated ZE41 material showed a 5 to 15% increase in fatigue strengths compared to the pickled only and peened and pickled surfaces; coated AZ91 material showed a 10% increase to 40% decrease; and coated EZ33 showed a 0 to 30% decrease.

## 2. Sheet Flexure Tests Of As-Cast Surfaces

a. Alkaline cleaned and coated specimens provided up to 25% greater fatigue strength than the untreated specimens. Also, the alkaline cleaning alone appeared to provide some beneficial effect.

b. Compared to the DOW 7 and DOW 17 heavy coatings, the HAE heavy coated specimens provided up to 20% greater fatigue strength in the unexposed tests and also after salt fog and high humidity exposure.

c. ZE41 alloy showed slightly better basic fatigue strength than the AZ91 alloy and better response to the alkaline cleaning and coatings.

#### CONCLUSIONS

1. Acid pickling has a significant detrimental effect on the fatigue strength of cast AZ91, ZE41, and EZ33 magnesium alloys.
2. Shot peening has a significant beneficial effect on magnesium fatigue strength and eliminates or reduces any degradation due to acid pickling or coatings.
3. Chromate conversion and anodic coatings applied without prior acid pickling, are not necessarily detrimental to the fatigue properties of the three magnesium alloy cast materials - and can be beneficial.
4. The HAE heavy coating appears best with respect to influence on substrate fatigue and in minimizing the effects of corrosion damage on subsequent fatigue performance.
5. The cast ZE41 alloy provided the most favorable interaction with the various coatings and treatments with respect to subsequent fatigue performance.
6. In all three alloys, the anodic coated magnesium fatigue strength was comparable to, or better than, that for the DOW 7 system currently used.

#### RECOMMENDATIONS

1. Where fatigue strength is a performance criteria, acid pickling should not be utilized as a pretreatment for chromate conversion or anodic coating application. Anodic coating processes should be controlled to minimize substrate surface effects. Shot peening should be utilized, especially when acid pickling or very heavy anodic coatings are required.

2. The ZE41 alloy with HAE coating applied to unpickled surfaces should be used for optimum fatigue characteristics, with and without corrosive environment. For even greater fatigue strength, shot peening should also be utilized.

3. To optimize the fatigue performance of the anodic coated magnesium housings in-service, it is further recommended:

a. to evaluate shot peening of the magnesium cast material to determine the practical range of peening parameters (shot size/material and intensity), depth of compressive stresses obtained, and extent of surface damage;

b. to evaluate the effects of specific coating process parameters on coating porosity, integrity, and thickness and on the substrate magnesium surface roughness.

c. to evaluate full scale components and component material especially with respect to determination of the effects of casting weld repairs.

## TABLE OF CONTENTS

	Page
SUMMARY .....	1
Introduction .....	1
Summary of Results .....	1
Conclurions .....	2
Recommendations .....	2
LIST OF TABLES .....	4
LIST OF FIGURES .....	5
INTRODUCTION .....	7
MATERIAL .....	8
EXPERIMENTAL PROCEDURE .....	9
Screening Tests .....	9
1. Test Conditions .....	9
2. R. R. Moore Fatigue Test Procedure .....	13
Tests of As-Cast Surfaces .....	18
1. Test Conditions .....	18
2. Sheet Flexure Fatigue Test Procedure .....	21
RESULTS OF TESTS .....	28
R. R. Moore Screening Tests .....	28
Sheet Flexure Tests of As-Cast Surfaces .....	54
DISCUSSION .....	73
Pretreatments .....	73
Coatings .....	83
Alloys .....	85
ACKNOWLEDGEMENTS .....	86
REFERENCES .....	86

## LIST OF TABLES

Table No.	Title	Page
I	Chemical Composition of the Magnesium Castings .....	8
II	Tensile Properties of the Magnesium Castings .....	8
III	R. R. Moore Rotating Beam Fatigue Screening Test Conditions .....	10
IV	Description of Surface Treatments and Coatings .....	11
V	R. R. Moore Specimen Fabrication Procedure .....	12
VI	Dimension Changes Due to PAE Anodic Coatings .....	19
VII	Test Conditions for the Sheet Flexure Fatigue Tests of As-Cast Surfaces .....	20
VIII	Sheet Flexure Fatigue Specimen Fabrication Procedure .....	24
IX	Summary of R. R. Moore Fatigue Test Results .....	50
X	Summary of Sheet Flexure Fatigue Test Results .....	68
XI	Influence of Surface Preparations and Coatings on Fatigue Strength of Magnesium Rotating Beam Specimens .....	82
XII	Influence of Anodic Coatings and Corrosive Exposure on the Fatigue Strength of Magnesium Sheet Flexure Specimens With As-Cast Surfaces .....	84



## LIST OF FIGURES

Figure No.	Title	Page
1	R. R. Moore Rotating Beam Fatigue Test Specimen .....	14
2	Magnesium Cast Plate Sectioning for R. R. Moore Specimens; and Identification Scheme .....	15
3	R. R. Moore Rotating Beam Fatigue Test Facility .....	16
4	Close-Up of R. R. Moore Rotating Beam Fatigue Test Machine .....	17
5(a)	1/8-In. (3.2mm) Thick Sheet Flexure Fatigue Test Specimen ...	22
(b)	1/4-In. (6.4mm) Thick Sheet Flexure Fatigue Test Specimen ...	23
6	Sheet Flexure Fatigue Test Facility .....	25
7	Close-Up of 40 Lb. (178 N) Capacity Sheet Flexure Fatigue Test Machine Showing Test in Progress .....	26
8	Close-Up of 150 Lb. (668 N) Capacity Sheet Flexure Fatigue Test Machine .....	27
9-29	R. R. Moore Fatigue Test S-N Curves .....	29-49
30	Typical R. R. Moore Rotating Beam Fatigue Test Specimens, large and Small Diameter; and Representative Failures. Specimens at Left are With the HAE Heavy Anodic Coating (M8). Failed Specimens are Coated With the DOW 17 Light Anodic Coating (M11) .....	51
31	Representative Fractures of High (Bottom Specimen: 622,000 Cycles) and Low (Top Specimen: 25,000 Cycles) Cyclic Life; Same DOW 17 Light Coated Specimens as Shown in Figure 30 ....	52
32-44	Sheet Flexure Fatigue Test S-N Curves .....	55-67
45	Typical 1/8-In. (3.2mm) Thick Sheet Flexure Fatigue Test Specimen and Representative Failure. Specimens are ZE41 Alloy, HAE Heavy Anodic Coated (C5) .....	69
46	Typical 1/4-In. (6.4mm) Thick Sheet Flexure Fatigue Test Specimen and Representative Failure. Specimens are A791 Alloy, HAE Heavy Coated (C13) .....	70
47	Representative Fractures of 1/8-In. (3.2mm) Thick Sheet Flexure Fatigue Test Specimens With and Without Fracture Initiation at Surface Casting Flaws; All Three Specimens Failed After About 200,000 Cycles .....	71
48	Representative Fractures of 1/4-In. (6.4mm) Thick Sheet Flexure Fatigue Test Specimens With and Without Fracture Initiation at Surface Casting Flaws .....	72

## LIST OF FIGURES (Continued)

Figure No.	Title	Page
49	Exposed (Right) and Unexposed (Left) Specimens With HAE (C11), DOW 7 (C9), and DOW 17 (C10) Coatings (Top to Bottom) Showing Very Little Surface Corrosion After 7 Days in High Humidity Environment .....	74
50	Exposed and Unexposed (Upper Left Only) Specimens With DOW 7 Coating (C6) Showing Light to Heavy Range of Surface Corrosion Typical After 7 Days in 5% Salt Fog Environment .....	75
51	Exposed and Unexposed (Upper Left Only) Specimens With DOW 17 Heavy Anodic Coating (C7) Showing Light to Heavy Range of Surface Corrosion Typical After 7 Days in 5% Salt Fog Environment .....	76
52	Exposed and Unexposed (Upper Left Only) Specimens With HAE Heavy Anodic Coating (C8) Showing Light to Moderate Range of Surface Corrosion Typical After 7 Days in 5% Salt Fog Environment .....	77
53	Fracture Surfaces of the High Humidity Exposure Specimens of Figure 49, With HAE, DOW 17, and DOW 7 Coatings (Top to Bottom) .....	78
54	Fracture Surfaces of the Salt Fog Exposure Specimens of Figure 50, With DOW 7 Coating .....	79
55	Fracture Surfaces of the Salt Fog Exposure Specimens of Figure 51, With DOW 17 Coating .....	80
56	Fracture Surfaces of the Salt Fog Exposure Specimens of Figure 52, With HAE Coating .....	81

## I N T R O D U C T I O N

This study was initiated for the purpose of determining the effects of various surface treatments and corrosion resistant coating systems on the fatigue properties of three cast magnesium alloys, AZ91C-T6, ZE41C-T5, and EZ33A-T5, of current or potential use in military helicopter component housings. It was part of a larger program coordinated by the Materials and Manufacturing Technology Division for the Army Material Readiness Command to improve the service life and maintenance requirements of the magnesium housings by updating and optimizing the housing material/environmental protective coating system used.

Recent helicopter designs have relied heavily on the use of magnesium castings for such components as transmission, rotor, and combiner housings. This is true for aircraft currently in use such as the CH-47 and CH-54 as well as new designs such as the Heavy Lift Helicopter (HLH) and the Utility Tactical Transport Aviation System (UTTAS). A major problem associated with the use of cast magnesium alloy housings has been their general poor resistance to environmental degradation with the protective coating system now used.

Currently, housings are sand cast from AZ91 alloy, solution heat treated, and thermally aged. The protective coating system employed is a DOW 7 chromate conversion coating over which is applied a chromate primer acrylic lacquer topcoat system. Providing corrosion resistance through the use of improved alloys and surface protection systems would mean significant savings due to decreased maintenance, repair, and replacement of the housings and decreased aircraft downtime.

Although, to date, no housings have failed due to fatigue or have required replacement due to fatigue cracking, neither has design analysis been made to determine housing dynamic loadings in service. Concurrently, there is little data in the literature on the fatigue properties of coated magnesium and what there is indicates that magnesium fatigue strength is significantly reduced by anodic coatings, references (1) and (2). Thus, it became necessary to ascertain the effects of surface treatments and coatings on the fatigue properties of the three candidate magnesium alloys to provide assurance that housing reliability with respect to dynamic loading would not be jeopardized with any of the new alloy/coating systems under consideration. Also, information was needed on the basic fatigue properties of the new magnesium casting alloy materials ZE41 and EZ33. The ZE41 alloy was developed to provide improved strength and corrosion resistance and the EZ33 alloy was developed for better casting weld repairability.

Two types of fatigue test were performed in this evaluation. Initially, high frequency R.R. Moore rotating beam fatigue tests were performed on machined specimens to provide a comprehensive screening of the effects of the various coating systems and conditioning treatments on the fatigue strength of the three magnesium alloys. These included chromate conversion and anodic coatings and various organic topcoats as well as pre-treatments such as shot peening and acid pickling. The two or three best coating systems (with required pre-treatments), as determined from these screening tests, as well as from the corrosion tests of the Frankford Arsenal, were then further evaluated by sheet flexure fatigue tests of as-cast surfaces. In addition, the effects of exposure to 5% salt fog or high humidity prior to fatigue testing was evaluated. For all tests stress-cyclic life curves and fatigue strength were determined.

## M A T E R I A L S

Materials used for the fatigue program were from the same lots of castings ordered from Hitchcock Industries, Inc. by Frankford Arsenal and used in the corrosion studies. Plates of sand-cast magnesium alloys AZ91C-T6, ZE41A-T5, and EZ33A-T5, measuring 1/4-in. and 5/8-in. (6.4 and 16 mm) thick, were provided. The chemical compositions are given in table I. The heat treatment and mechanical properties are given in table II.

Table I

## Chemical Composition of the Magnesium Castings\*

<u>Alloy/Element</u>	<u>Al</u>	<u>Zn</u>	<u>Ce</u>	<u>Zr</u>	<u>Mg</u>
AZ91	8.75	0.81	-	-	Bal.
ZE41	-	3.71	1.44	0.89	Bal.
EZ33	-	2.57	2.94	0.68	Bal.

\* Data from Frankford Arsenal

Table II

## Tensile Properties of the Magnesium Castings\*

<u>Alloy</u>	<u>Heat Treatment</u>	<u>UTS, ksi (MPa)</u>	<u>.2% Offset Yield, ksi (MPa)</u>	<u>% Elongation in 2-in. (50.8 mm)</u>	<u>% RA</u>
AZ91	T6 - Solution heat-treated & artificially aged	39.4 (272)	23.2 (160)	4.0	5.1
ZE41	T5 - artificially aged	32.6 (225)	21.6 (149)	5.1	5.5
EZ33	T5 - artificially aged	21.3 (146)	14.9 (103)	2.5	2.2

\* Data from Frankford Arsenal

## EXPERIMENTAL PROCEDURE

## Screening Tests

## 1. Test Conditions

In the screening test phase of the program the intent was to study the effect of the many candidate corrosion resistant coating systems and preconditioning treatments on the fatigue strength of the three magnesium alloys. The coatings were chosen by the Army Materiel Readiness Command on the basis of improving corrosion protection over the currently used DOW 7 chromate conversion coating. The standard acid pickling pretreatment was also evaluated as well as practices not currently employed such as polystyrene impregnation and shot peening. Impregnation was included since the castings were to be receptacles for lubricants and possible through pores would require sealing.

Shot peening is a standard practice used to protect structural metals from the deleterious fatigue effects of electrodeposited metals or plasma sprayed coatings, references (3) and (4). The residual compressive surface stresses resulting from shot peening are generally sufficient to reduce or eliminate the detrimental effects of the coatings. However, the specific shot peening technique to be used for these tests was not immediately obvious because peening of magnesium is not usually a required procedure. Little information was available. Previous work reported in the literature, reference (5), and some experience by Metal Improvement Co. indicated large sized, hard balls impinged at low velocity yielded the optimum results with respect to providing maximum residual compressive surface stresses with least microstructural damage. Thus, large sized, .125 in. (3.2mm) diameter stainless steel balls (stainless steel to preclude highly corrosive surface contamination) were selected. With respect to peening intensity, a minimum of 5 to 10 mils (0.127 - 0.254 mm) depth of compressive stress was considered necessary to provide adequate protection even after such inherently metal consuming treatments as pickling, chromating, or anodizing had been performed. To assure that this requirement could be met, the Frankford Arsenal made a preliminary study in which Almen No. 2 gage intensities of .005A and .010A were evaluated by metallographic, SEM, and x-ray diffraction techniques to determine depth of peening effect. While metallography and SEM failed to provide meaningful information, x-ray diffraction showed there to be little difference between the two peening intensities and a depth of compressive stress of .007 - .017 inches (0.177 - 0.431 mm) was achieved depending upon alloy. Thus the 5A Almen intensity was chosen for use in this study.

Several organic topcoat systems were also evaluated, selected on the basis of providing greater corrosion resistance and/or coating flexibility.

Polishing of the machined test specimen surfaces was performed at NADC while any required shot peening was performed by Metal Improvement Co. at their Carlstadt, N.J. facility. All other treatments and coatings were provided by the Frankford Arsenal. Table III summarizes the various conditions tested in this phase of the program. Table IV describes the processes used in applying the various surface treatments and coatings.

Table III  
R.R. Moore Rotating Beam Fatigue Screening Test Conditions

Test Condition(M)	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
Polished	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Peened		✓		✓								✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
Alkaline Cleaned			✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Pickled			✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
Impregnated					✓							✓													
DOW 1 (EZ33 & ZE41)						✓							✓												
DOW 20 (AZ91)						✓							✓												
DOW 7							✓							✓											
HAE Light								✓								✓									✓
HAE Heavy								✓							✓				✓	✓	✓	✓	✓	✓	✓
DOW 17 Light										✓							✓								
DOW 17 Heavy									✓								✓								
Epoxy Primer & Lacquer																			✓						
Epoxy Primer & Topcoat																				✓					
Epoxy Seal & Topcoat																									
Epoxy Primer & Polyurethane																					✓				
Chloro-Rubber & Polyurethane																							✓		

Table IV

## Description of Surface Treatments and Coatings

Condition	Description
Polished	#400 wet or dry polishing paper of machined surfaces in longitudinal direction only
Shot Peened	0.125 in. (3.2 mm) dia. alloy steel burnishing balls to SA Almen intensity and 200% coverage
Alkaline cleaned	Immersed in sodium orthosilicate solution (60 g/l + 3 g Nacconal 40F at 30° C)
Pickled	Nitric acid (concentration = 8%) + sulfuric acid (concentration = 2%) at 28° C for 10 sec. Approx. 1 mil (.025 mm) surface magnesium material removed.
Impregnated	Polystyrene monomer - under vacuum 10 mins.; followed by application of 90 psi (6.35 kg/cm <sup>2</sup> ) for 30 mins., Oakite 61B cleaning, cold water rinse, alkaline cleaning in Oakite 94, rinse, and 300° F (149° C) 3 hour cure.
Chromate Conversion Coatings (Conform to MIL-M-3171)	Type I (DOW 1): 0.01 - 0.1 mil (0.00025 - 0.0025 mm) thickness Type I (DOW 20): 0.01 - 0.1 mil (0.00025 - 0.0025 mm) thickness Type III (DOW 7): 0.01 - 0.1 mil (0.00025 - 0.0025 mm) thickness
Anodic Coatings (Conform to MIL-M-45202 with post-treatments)	Type IIA3 (HAE Heavy): 0.8 - 1.2 mil (0.02 - 0.03 mm) thick with approximately 0.5 mil (0.012 mm) magnesium material removed for every 1 mil (0.025 mm) of coating thickness Type IA2 (HAE Light): 0.2 - 0.4 mil (0.0051 - 0.010 mm) thick with approximately 0.5 mil (0.012 mm) magnesium material removed for every 1 mil (0.025 mm) of coating thickness Type IID (DOW 17 Heavy): 0.8 - 1.2 mil (0.02 - 0.03 mm) thick with approximately 0.5 mil (0.012 mm) magnesium material removed for every 1 mil (0.025 mm) of coating thickness Type IC (DOW 17 Light): 0.2 - 0.4 mil (0.0051 - 0.010 mm) thick with approximately 0.5 mil (0.012 mm) magnesium material removed for every 1 mil (0.025 mm) of coating thickness

Table IV (Continued)

Condition	Description
Organic Coatings	
A	Epoxy primer (MIL-P-23377C) + aluminum pigmented acrylic lacquer (total thickness = 5.0 mils (0.127 mm) per side)
B	Epoxy primer (MIL-P-52192B) + alkyd topcoat (total thickness = 5.5 mils (0.140 mm) per side)
C	Epoxy seal (proprietary) + chromate primer (MIL-P-8335) + alkyd topcoat (total thickness = 5.2 mils (0.132 mm) per side)
D	Epoxy primer (MIL-P-23377C) + polysulfide primer + polyurethane (MIL-P-83286B) (total thickness = 5.4 mils (0.137 mm) per side)
E	Chloro-rubber (proprietary) + chromate primer + polyurethane (MIL-P-83286B) (total thickness = 5.3 mils (0.134 mm) per side)

Table V

## R.R. Moore Rotating Beam Fatigue Test Specimen Fabrication Procedure

1. Cut blanks from cast plate.
2. Cut blank to exact length and turn to 1/2-in. (12.7 mm) diameter on center.
3. Re-center with controlled depth; drill and tap both ends.
4. Rough turn center section to 0.040-in. (1.0 mm) oversize.
5. Finish turn with cuts in the order of 0.014-in. (0.35 mm) and 0.006-in. (0.15 mm), respectively.
6. Machine tapers.
7. Polish with #400 wet or dry polishing paper.



## 2. R.R. Moore Fatigue Test Procedure

The standard R.R. Moore rotating beam fatigue test was chosen for this phase of the program. It is ideally suited for screening testing because of its high speed and good reproducibility of test method. Cyclic frequency is about 10,000 rpm so that runouts of  $2 \times 10^7$  cycles can be achieved in a little more than a day. The R.R. Moore rotating beam fatigue test specimen is shown in figure 1. Table V describes the fabrication details. Test specimens, 220 AZ91, 170 ZE41, and 170 EZ33, were machined from cast plates 3-5/8 in. wide x 12-in. long x 5/8-in. thick (92 x 302 x 15.8 mm). The plates were sectioned into specimen blanks and identified according to the scheme shown in figure 2. All specimens were machined at NADC.

The rotating beam fatigue test equipment used is shown in figures 3 and 4. Test stresses in the specimen are accurately achieved using dead weight loading which produces a constant moment along the length of the test specimen. The test load to be applied is determined from the test stress desired and the minimum specimen test section diameter (minimum cross sectional area). The greatest stress occurs at the surface of the minimum diameter and during each test cycle each point on the specimen surface sees a complete sinusoidal stress cycle ranging from the maximum cyclic test stress in tension to the maximum cyclic test stress in compression (load ratio,  $R$ , = -1 = minimum cyclic stress/maximum cyclic stress). Stresses within the specimen diminish to zero at the specimen neutral axis.

The R.R. Moore specimens tested were of two sizes with respect to test section minimum diameter and radius. Initially, 560 specimens were fabricated according to the specifications shown in figure 1, except that the minimum test section diameter was 0.387-in. (9.8 mm) with a 10-in. (254 mm) radius. This size was based on considerations of material strength, machine loading capacity, and the need for some reduced section to preclude grip failures.

Due to the low strength level of the magnesium alloys, test machine capacity provided no real limitation on design so that a maximal diameter was chosen to minimize stress concentration effects and to provide a maximum cross sectional area for best representation possible of the bulk material. However, during the first tests on the as-machined control set many specimens failed near the .480-in. (12.2 mm) taper diameter in the grip rather than at the minimum test section diameter. These failures occurred primarily in the low stress - high cyclic life regime and were attributed to fretting fatigue.

Some minor fretting damage at the grip taper is normal for this test due to the action of dynamic strains in the contact points at the grip taper, however, the fretting between the magnesium and steel surfaces is much more severe than normally experienced in tests of other materials. This problem necessitated redesign of the specimen for a smaller test section diameter that would provide consistently valid high cycle failures. Analysis of the data indicated a close design relationship between fretting damage susceptibility, test load level, and test machine minimum loading limitations. This led to the conclusion that only a very small range of values around 0.300-in. diameter would yield satisfactory testing of magnesium rotating beam specimens. The redesigned specimen shown in figure 1 was decided upon having a minimum test section diameter of 0.305-in. (7.7 mm) with a 5-1/4-in. (133 mm) radius. Typical finished specimens are shown in figure 30.

**Figure 1 - R. R. Moore Rotating Beam Fatigue Test Specimen**

All specimens were numbered; each specimen number determined by the alloy number, plate number, and location in the plate from which it was taken. Specimens taken from each plate were numbered 1 to 16 depending upon their location with respect to the plate numbered end: The #1 specimen being from the numbered end.

Example:

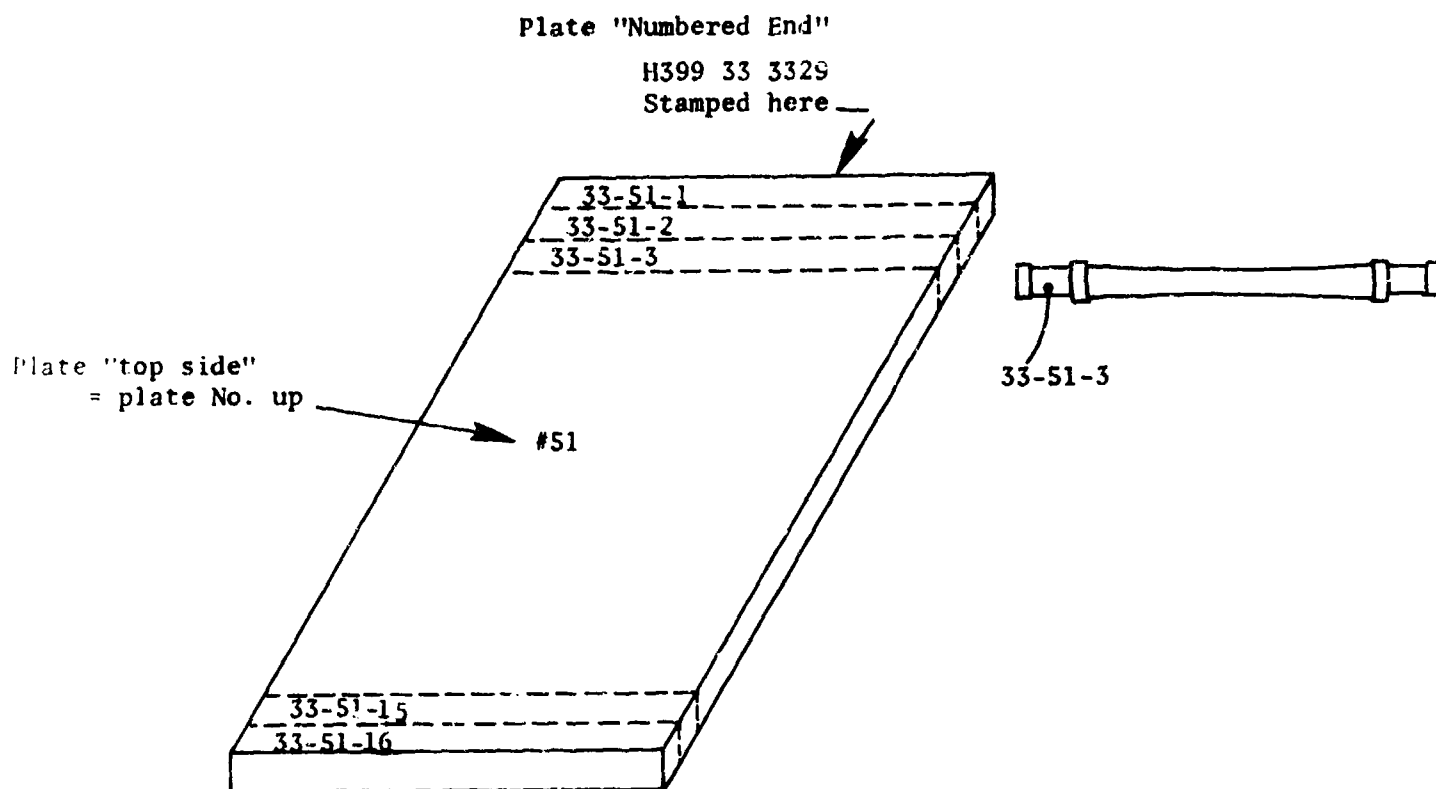


Figure 2. Magnesium Cast Plate Sectioning for R. R. Moore Specimens; and Identification Scheme

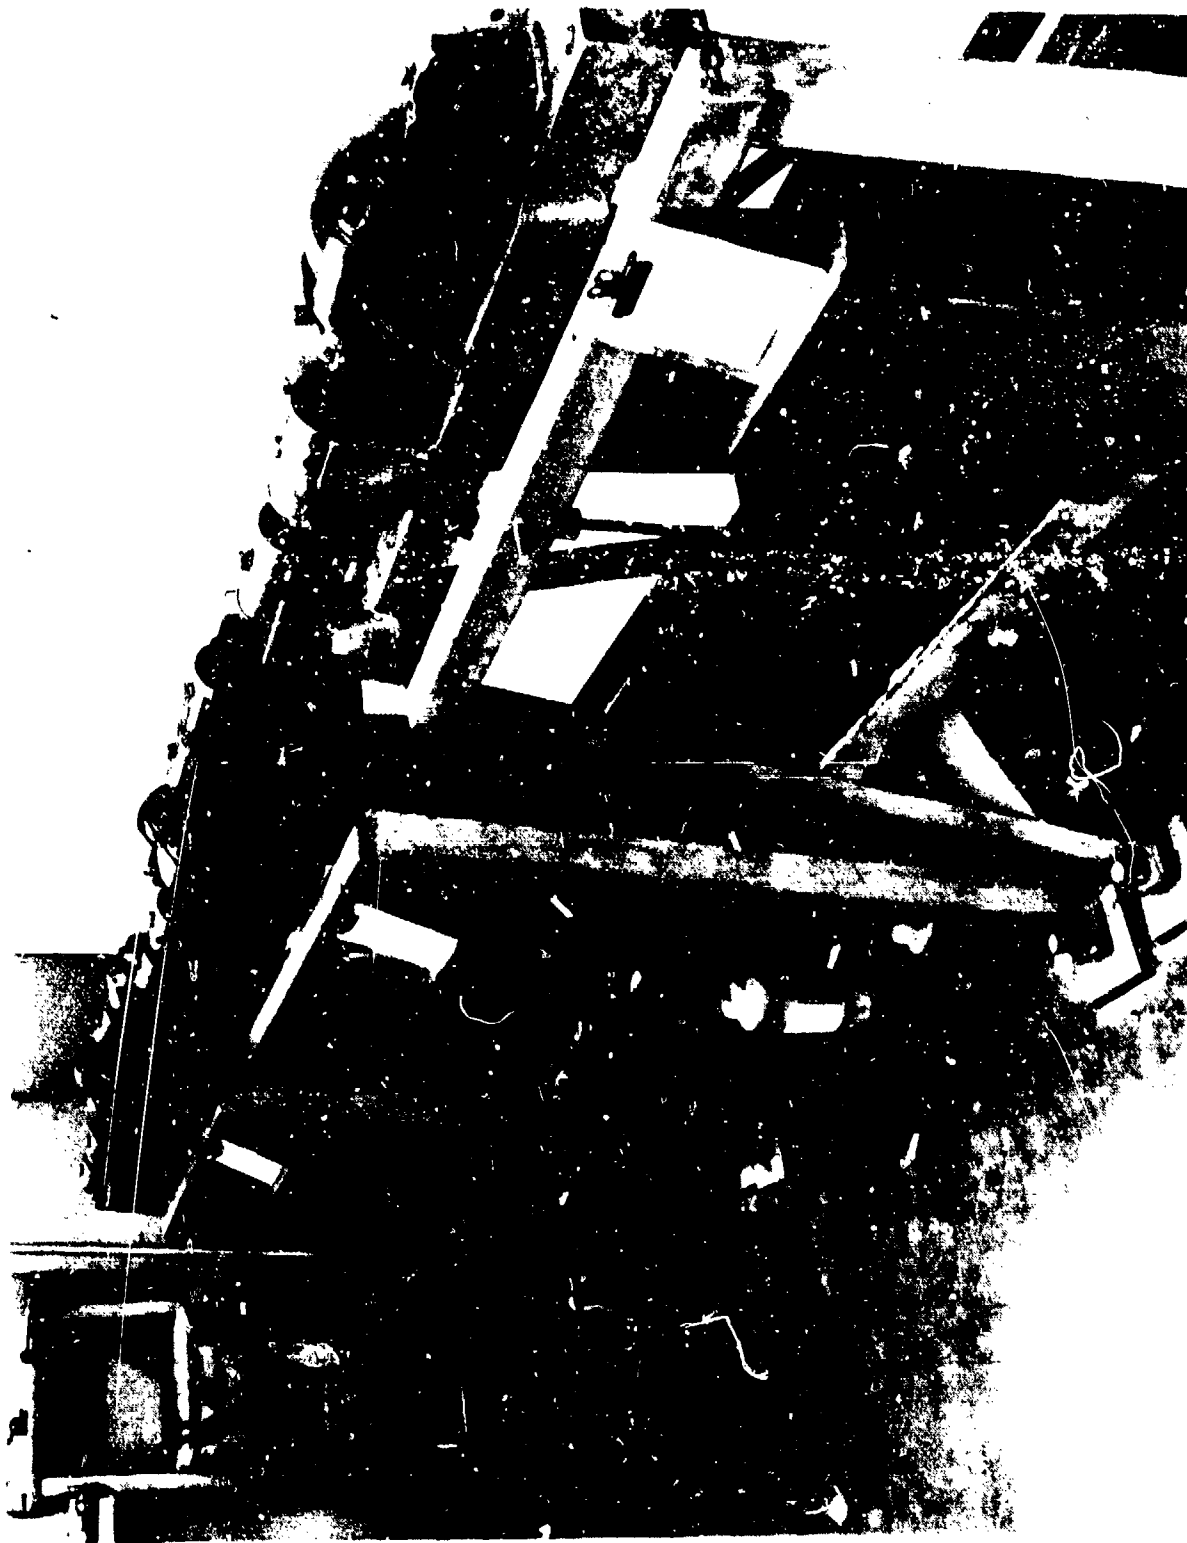


Figure 3 - R. R. Moore Rotating Beam Fatigue Test Facility

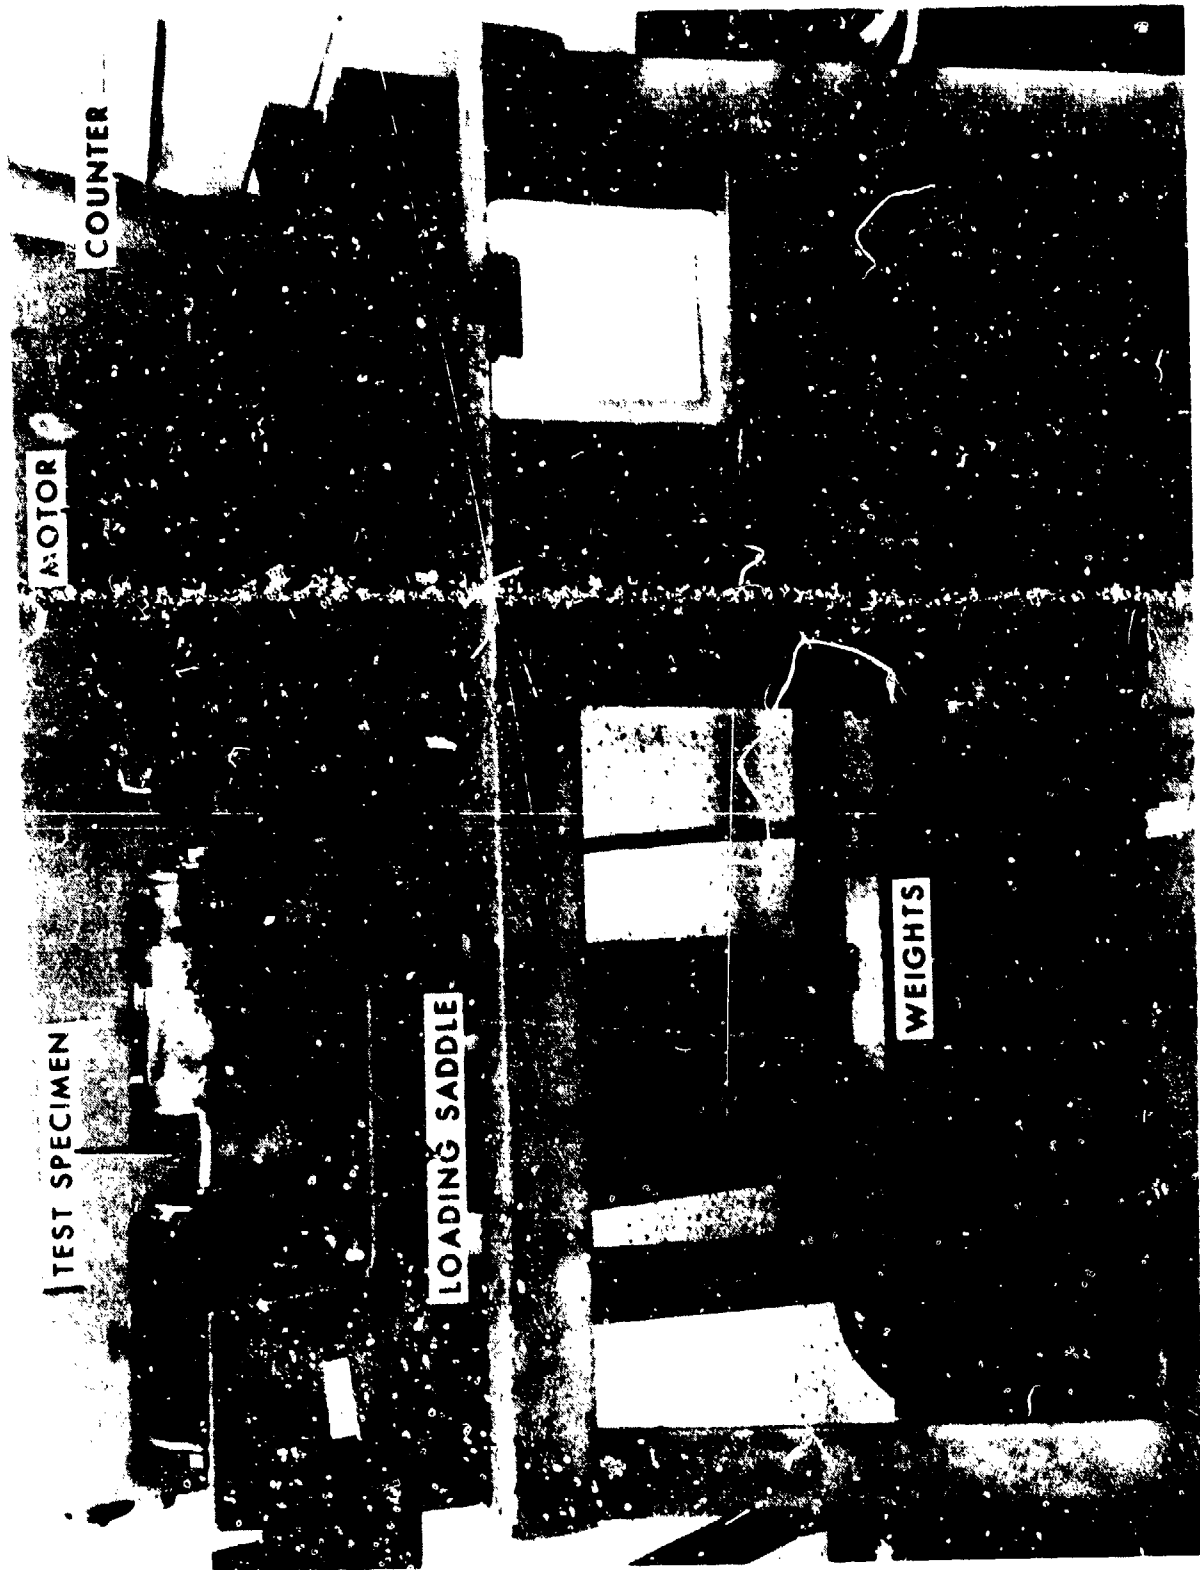


Figure 4 - Close-Up of R. R. Moore Rotating Beam Fatigue Test Machine

A total of 286 specimens were reduced in diameter from 0.387-in. (9.8 mm) to 0.305-in. (7.7 mm) for the purpose of testing in the low stress - high cycle area of the stress - life curve where susceptibility to fretting fatigue taper failure is greatest. The remainder of the specimens were left at 0.387-in. (9.8 mm) test section diameter for testing in the high stress - low cycle regime. From Peterson, reference (6), the difference in theoretical stress concentration factor between the two specimen designs was considered negligible since it was only in the order of .1 - .2%.

Later in the testing program 60 extra R.R. Moore specimens (20 from each alloy) were machined to the new design requirements (0.305-in. (7.7 mm) diameter) for test conditions M24 and M25 (HAE light and heavy coatings without prior shot peening or pickling).

A computer program was utilized to produce a random selection of specimens for final disposition into the various test groups (M1 through M23 in table III). All specimens were subsequently processed (peened, pretreated, coated, etc.) in two lots according to whether or not they were 0.387-in. (9.8 mm) or 0.305-in. (7.7 mm) in diameter. The four 0.387-in. (9.8 mm) diameter high stress - low cycle specimens from each group were processed first followed by the five or six 0.305-in. (7.7 mm) diameter low stress - high cycle specimens from each group.

For all test conditions, stress - cyclic life (S-N) curves were generated - primarily to provide comparison of the effects of the various surface treatments on the fatigue strength of the substrate magnesium alloy material. Nine specimens were utilized to generate each S-N curve. Tests were terminated if no failure occurred after  $2 \times 10^7$  cycles. Test stresses were based on specimen dimensions in the as-polished condition prior to any coating application or pretreatment processing.

For the last 60 specimens dimensional changes accompanying processing of each test condition were monitored. These are shown in table VI for the three alloys with HAE light and heavy coatings.

#### Tests of As-Cast Surfaces

##### 1. Test Conditions

In this phase of the program the intent was to evaluate the best coating system possibilities as applied to as-cast surfaces of the magnesium alloys. Since ultimate utilization would be on cast helicopter housings this was a more realistic test of the coatings. Closer simulation of the actual end use environment was provided in several of the tests by exposure of specimens to high humidity or salt fog prior to fatigue testing.

The corrosion preventive systems to be used in this phase were selected based on the results of the R.R. Moore fatigue screening tests as well as the results of the Frankford Arsenal corrosion tests, reference (7). Table VII summarizes the conditions tested in this phase of the program. The coatings were applied utilizing the same processes used in the R.R. Moore tests. Specimens in test conditions 6, 7, and 8 (table VII) were exposed to 7 day/5% salt fog environment conforming to ASTM-B-117 before fatigue testing. Likewise, specimens

Table VI

## Dimensional Changes Due to HAE Anodic Coatings

- from test conditions M24 and M25 with coatings applied without prior acid pickling
- from 0.305-in. (7.7 mm) diameter test specimens
- median values

Coating	AZ91 <sup>(1)</sup>		ZE41 <sup>(1)</sup>		EZ33 <sup>(1)</sup>	
	Δ dia. mils (mm)	Coating Thick. mils (mm)	Δ dia. mils (mm)	Coating Thick. mils (mm)	Δ dia. mils (mm)	Coating Thick. mils (mm)
HAE Heavy	+0.8 (0.020)	0.8 (0.020)	+1.5 (0.038)	1.5 (0.038)	+1.5 (0.038)	1.5 (0.038)
HAE Light	+0.5 (0.013)	0.5 (0.013)	+0.3 (0.008)	0.3 (0.008)	+0.2 (0.005)	0.2 (0.005)

(1) Assuming 0.5 mil (0.012 mm) magnesium material removed for every 1 mil (0.025 mm) of coating thickness.

Table VII

Test Conditions for the Sheet Flexure  
Fatigue Tests of As-Cast Surfaces

Test Condition (C)	1	2	3	4	5	6	7	8	9	10	11	12	13
As Cast	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Alkaline Cleaned		✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
DOW 7			✓			✓			✓				
DOW 17 Heavy				✓			✓			✓			✓
HAE Heavy					✓			✓			✓	✓	
Salt Fog						✓	✓	✓					
High Humidity									✓	✓	✓		
1/8-in. Thick	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
1/4-in. Thick												✓	✓



in test conditions 9, 10, and 11 were exposed to 7 day/high humidity (distilled water fog) environment before fatigue testing. All environmental exposures were performed at the Frankford Arsenal.

## 2. Sheet Flexure Fatigue Test Procedure


The standard sheet flexure fatigue test was used in this phase. This test utilizes flat specimens in a repeated bending cyclic loading mode and was, therefore, very suitable for tests of as-cast surfaces. Frequency of the test machine is 1730 cpm and thus a runout of  $10^7$  cycles required four days of continuous operation. In order to control testing time and expense, only the AZ91 and ZE41 alloys were used in this phase. AZ91 because it is the current alloy used in the helicopter housings to which the new alloys must be compared and ZE41 because it showed the best fatigue and corrosion resistant performance in the previous tests. In the exposure tests, only the AZ91 alloy was used in order to further control the magnitude of the program and also because the ZE41 alloy had shown to be least susceptible to corrosion degradation in the Frankford Arsenal corrosion test program.

Two specimen sizes were tested - 1/8-in. (3.2 mm) and 1/4-in. (6.4 mm) thick - as shown in figures 5a and 5b. Most tests were run with the 1/8-in. (3.2 mm) thick specimens because a greater number of test machines were available but some 1/4-in. (6.4 mm) thick tests were desired because this thickness is more representative of the actual housings. All specimens were prepared at NADC from 1/4-in. (6.4 mm) thick cast plates supplied by the Frankford Arsenal. The 1/8-in. (3.2 mm) thick specimens required approximately 1/8-in. (3.2 mm) material removal which was accomplished by grinding from one side of the plate only. Care was exercised to protect the final as-cast test surface from receiving any processing or fabrication abuse. Fabrication of the 1/8-in. (3.2 mm) and 1/4-in. (6.4 mm) thick specimens was according to the procedures listed in table VIII. Typical finished specimens are shown in figures 45 and 46. As with the R. R. Moore tests, the final disposition of specimens into the various test groups (C1 through C13 in Table VII) was made on a random selection basis.

The small, 1/8-in. (3.2 mm) thick, specimens were run in 40 lb. (178 kN) capacity sheet flexure fatigue test machines while the larger, 1/4-in. (6.4 mm) thick, specimens were run in a 150 lb. (668 kN) capacity sheet flexure fatigue test machine. This equipment is shown in figures 6, 7, and 8. The specimens are designed so that the center straight sided tapered portion represents an area of constant stress - that is, the moment arm and cross sectional area increase proportionately as the distance from the point of load application so that stress remains constant. Constant deflection is maintained by the test machine rotating eccentric for the duration of the test.

S-N curves were generated for all test conditions, about nine specimens per curve. The cyclic frequency was 1730 cpm and tests were terminated if no failure occurred after  $10^7$  cycles. Test stresses were based on dimensions of the as-cast specimens prior to applying any surface conditioning or coatings. A load ratio of  $R = .1$  was used to ensure that, for the 1/8-in. (3.2 mm) thick specimens, failure initiated at the as cast surface rather than at the machined bottom surface.


31400000	1340	MOBILE/US30	INT
50181A30			

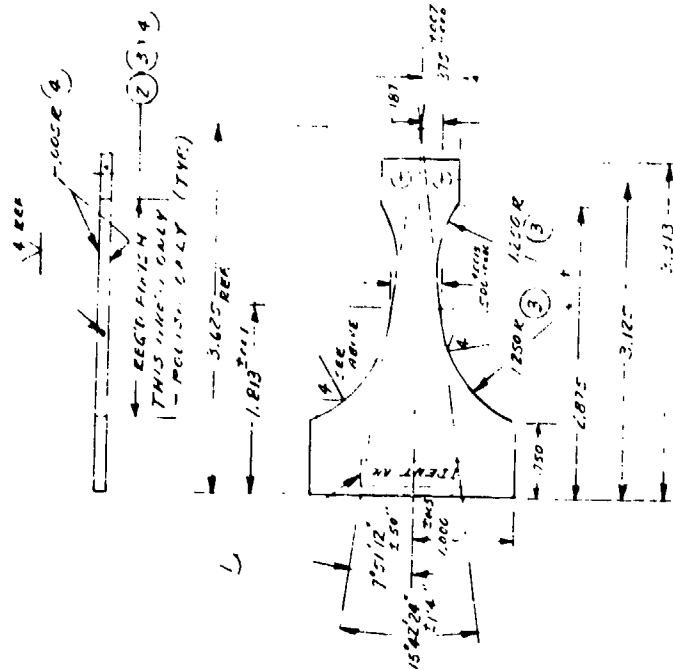

- (1) SPECIMEN SHALL BE IDENTIFIED IN  
HUMAN SPECIMEN, ACCORDING TO SCHEME  
PREPARED BY TEST ENGINEER.
- (2) ALL SIDES LONGITUDINALLY WITH SUC-  
CESSIVELY LIGHTER CUTS (LAST 2 CUTS  
0.003 OR LESS) WHEN APPROACHING DIM'S  
SHOWN, TO PRECLUDE UNDESIRABLE  
CELL WORKING & CLERKENING OF ANGLE.  
THIN ARE TO BE ELEATED WITH  
TANGENT LINES IN THE CENTRAL  
AREA, NO DISCONTINUITY PERMITTED.
- (3) GIVE A SHARP EDGES AS IN 1, 2, 3, 4, 5, 6, 7  
WITH FINISH SHOWN, TOLISM IN  
LONGITUDINAL DIRECTION ONLY. NO  
NICKS, MARKS OR SCRATCHES TO  
BE ALLOWED.

UNLESS OTHERWISE SPECIFIED: DIMENSIONS ARE IN INCHES FRACTIONS ARE PLACES DECIMALS ALL DIMENSIONS TO BE TO THIS DRAWING MATERIAL	CONTRACT NO.		NAVAL AIR DEVELOPMENT CENTER DARTMOUTH, PA 19724	
QUANTITY	20000	DESCRIPTION	SHEET	
DATE	10-15-64	QUANTITY	FLEXURE FATIGUE SPECIMEN	
APPROVED		DATE	80206	816-0975
APPROVED		SCALE	1/1	BY
APPROVED		SCALE	1/1	BY

Figure 5(a) - 1/8-In. (3.2mm) Thick Sheet Flexure Fatigue Test Specimen

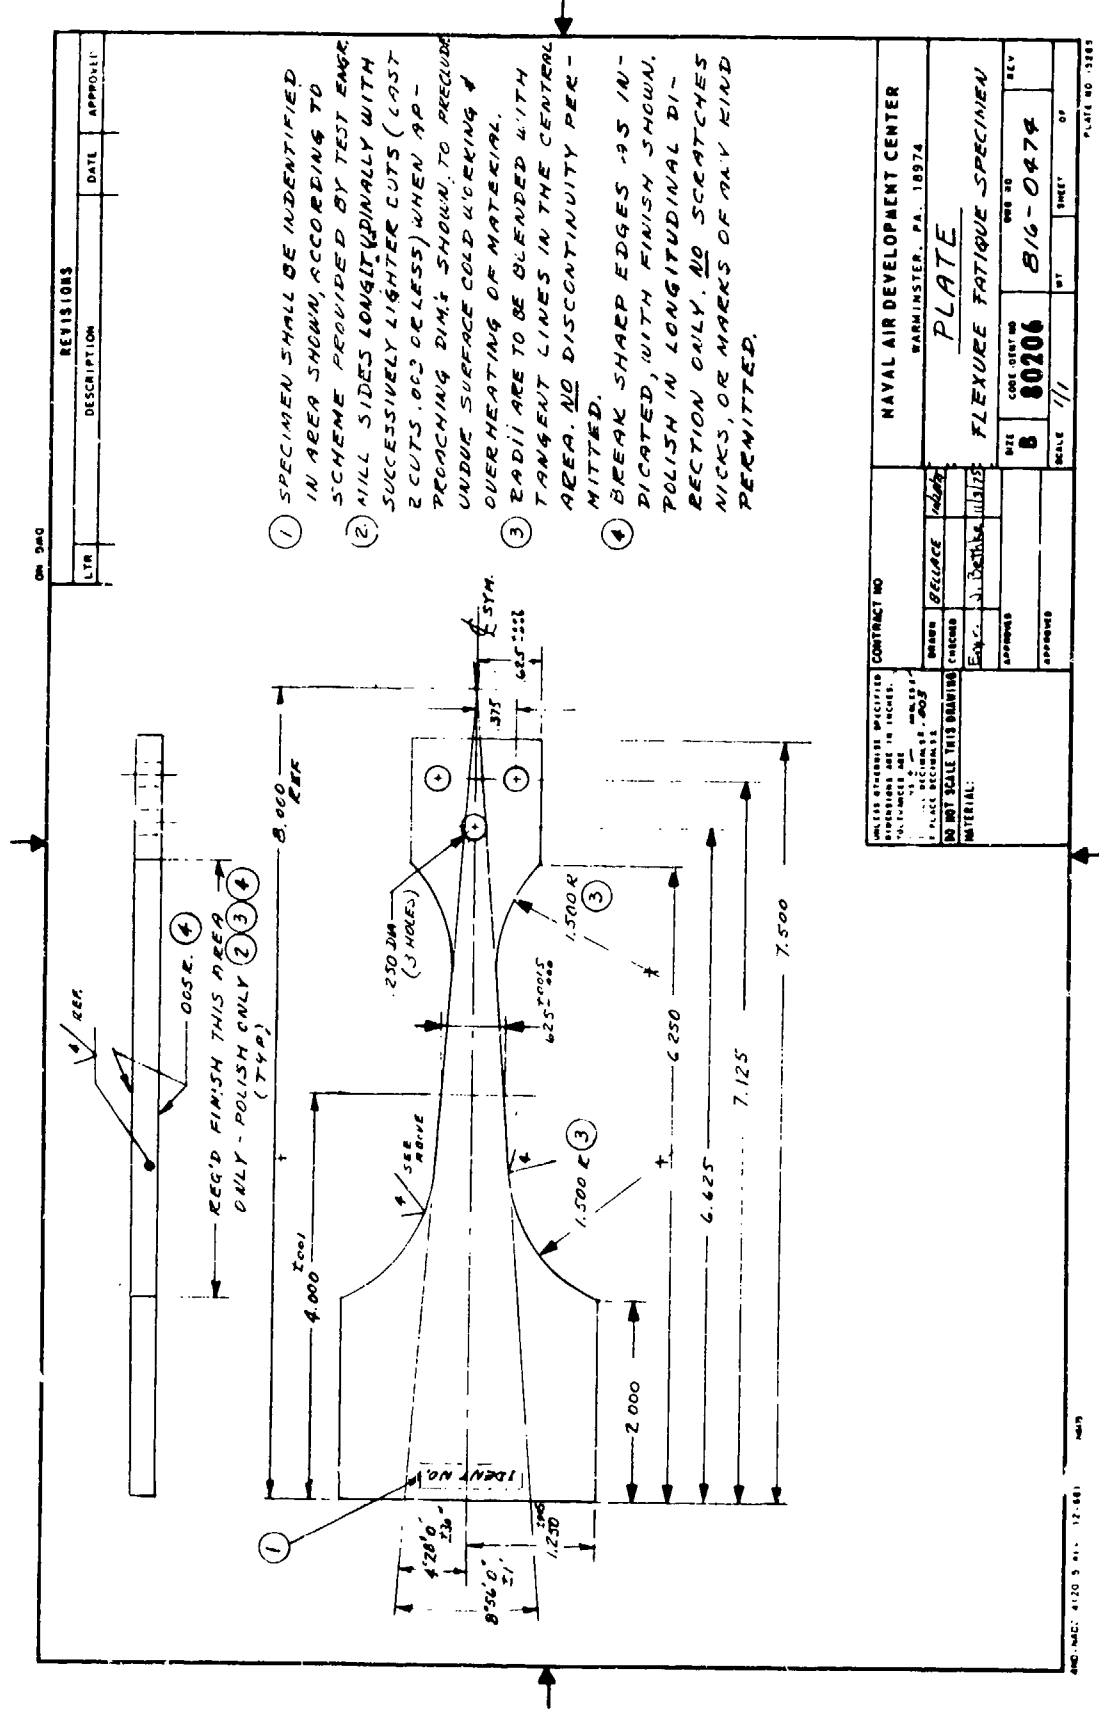

**Figure 5(b) - 1/4-In. (6.4mm) Thick Sheet Flexure Fatigue Test Specimen**

Table VIII

Sheet Flexure Fatigue Specimen Fabrication Procedure

1/8-in. (3.2 mm) Thick Specimens

1. Surface grind 4-1/4 in. x 7-1/4 in. x 1/4 in. thick (108 mm x 184 mm x 6.4 mm thick) cast plate to 1/8-in. (3.2 mm) final thickness. All material to be removed from bottom surface.
2. Lay out plate for four test specimens and identify.
3. Cut plate into four specimen blanks.
4. Cut contour using engraving machine and 4X pattern:
  - a) rough cut specimen from blank to 0.004-in. (0.1 mm) oversize; stepping down through thickness in 0.005 to 0.010-in. (0.125 - 0.250 mm) increments.
  - b) finish cut to final dimensions in two passes.
5. Drill and deburr end holes.
6. Break edges and polish sides in longitudinal direction using #500 emery paper.

1/4-in. (6.4 mm) Thick Specimens

1. Same as for 1/8-in. (3.2 mm) thick specimens except:
  - a) no surface grinding of the 5-1/4-in. x 8-in. x 1/4-in. thick (133 mm x 203 mm x 6.4 mm thick) cast plate is required,
  - b) lay out plate for two specimens,
  - c) use 2X pattern.

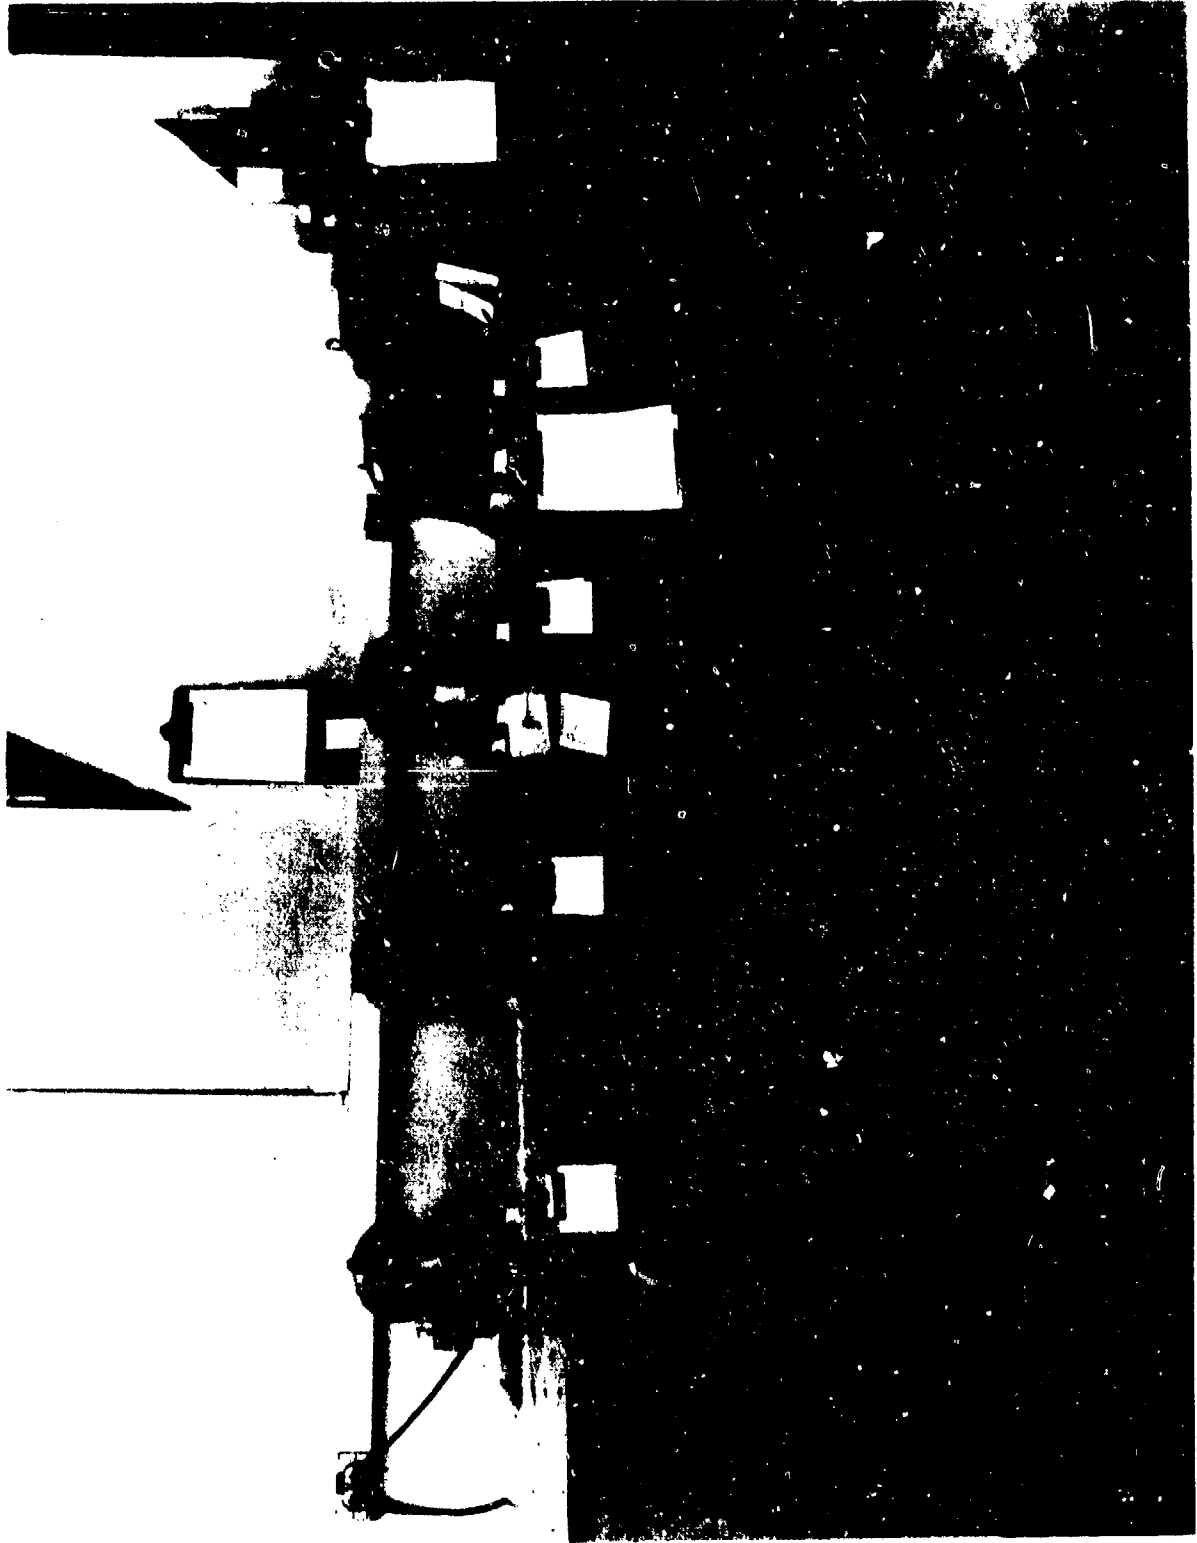


Figure 6 - Sheet Flexure Fatigue Test Facility

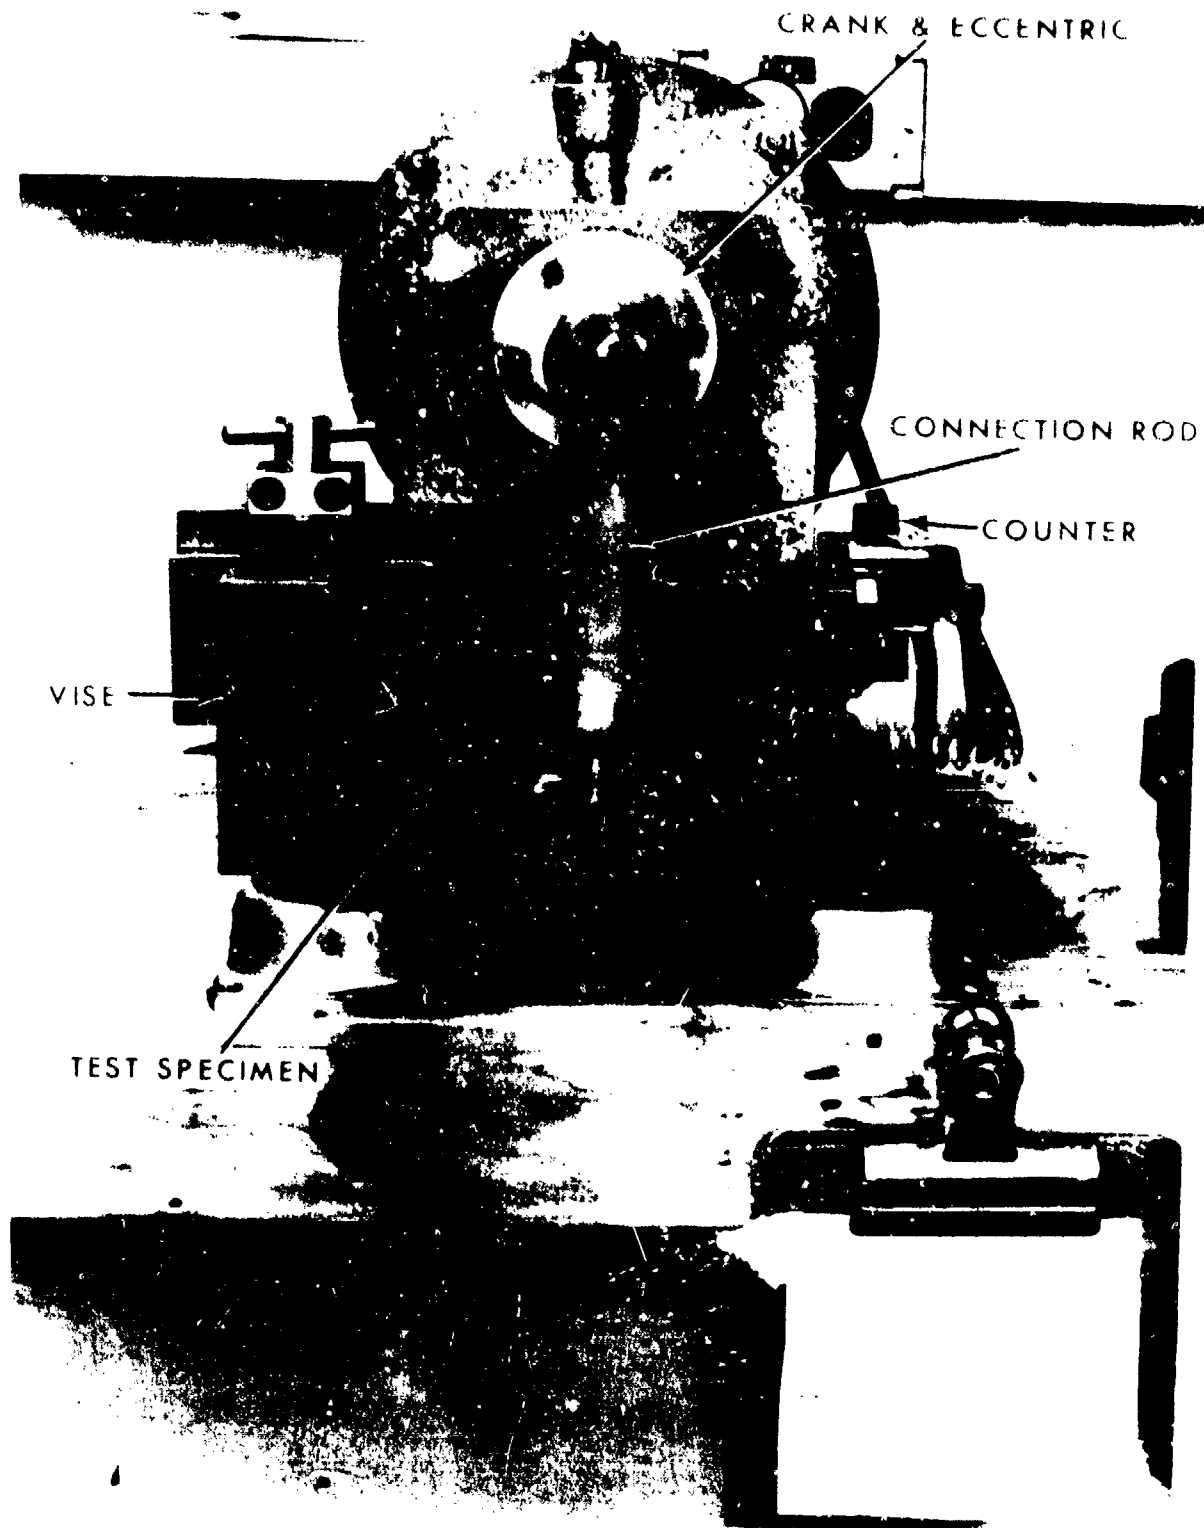


Figure 7 - Close-Up of 40 Lb. (178 N) Capacity Sheet Flexure Test Machine Showing Test in Progress

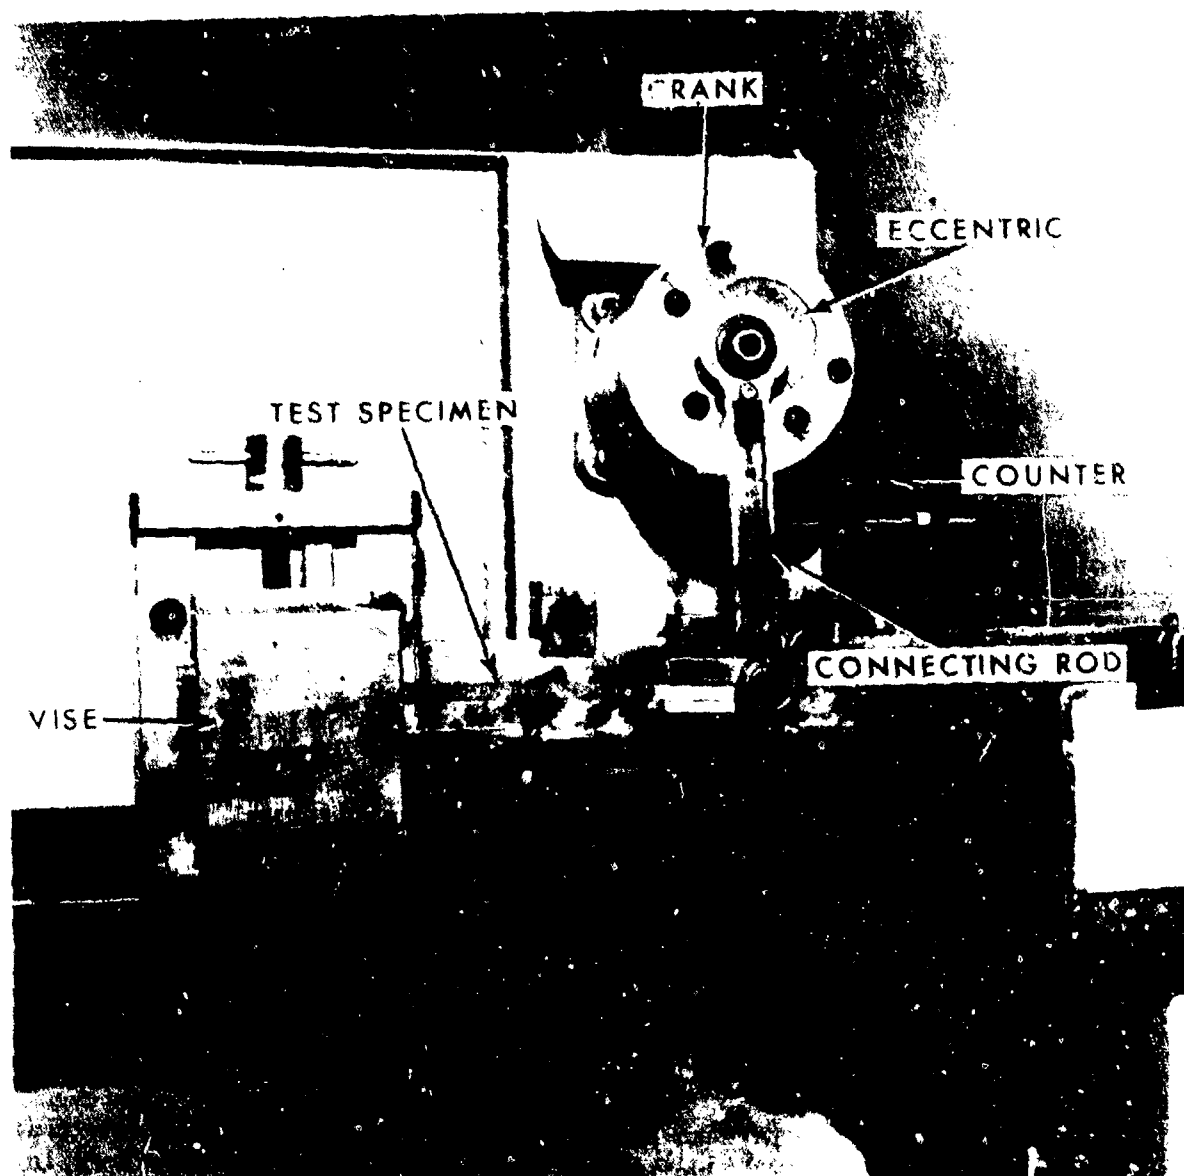


Figure 8 - Close-Up of 150 Lb. (668 N) Capacity Sheet Flexure Fatigue Test Machine

## RESULTS OF TESTS

## R.R. Moore Screening Tests

Results of the R.R. Moore specimen tests are presented in figures 9 - 29 and are summarized in table IX. Typical failures for the large and small sized R.R. Moore specimens and representative fracture surfaces for low and high cyclic life are shown in figures 30 and 31, respectively. Each S-N figure shows all the valid data points obtained for one test condition (test conditions as per table III) for the alloys tested at that condition. Faired (sketched) stress - life (S-N) curves were drawn through the data points for each alloy and the fatigue strength at  $2 \times 10^7$  cycles estimated for each.

For the ZE41 and EZ33 alloys, and in general the AZ91 alloy, the complete S-N curve is defined by two straight lines intersecting at the fatigue limit stress of the alloy for the particular test condition. Three test conditions of AZ91 alloy (M1, M24, and M25 - the only test conditions in which specimens were neither peened nor pickled) do not fit this description but rather are better described by a smooth parabolic curve. Failure does not occur below the fatigue limit stress. In actuality, this horizontal straight line portion of the S-N curve is not a line but an area of finite stress width representing a scatter band resulting from the statistical nature of the fatigue phenomena (reflecting the intrinsic variability of fatigue life data as well as any material, processing, and testing variables that have not been controlled or balanced in the testing procedures). Information about the statistical width of this band was not determined for these tests because of the great number of specimens that would be required to do so. The slopes of the upper straight line portion of the S-N curves generally fell into two groups for each alloy according to whether or not specimens were shot peened. These are as follows:

Condition	Slope, $\frac{\text{ksi}}{\log \text{cyclic life}}$ ( $\frac{\text{MPa}}{\log \text{cyclic life}}$ )		
	AZ91	ZE41	EZ33
Peened	$4.8 \pm .6$ ( $33.1 \pm 4.5$ )	$6.2 \pm .8$ ( $42.7 \pm 5.5$ )	$4.0 \pm .4$ ( $27.6 \pm 2.8$ )
Unpeened	$6.6 \pm .8$ ( $45.5 \pm 5.5$ )	$8.2 \pm 1.0$ ( $56.5 \pm 6.9$ )	$5.2 \pm .4$ ( $55.8 \pm 2.8$ )

This is consistent with expectations since treatments which affect the substrate surface affect the crack nucleation stage of fatigue and therefore are most influential in the low stress - high cyclic life tests; hence the observed effect of peening to decrease the stress - cyclic life slope.

The need for using specimens of two different diameters was described earlier. While the effect of size in fatigue is real, the difference between the two specimen sizes utilized in this program was considered to be small enough so as to be



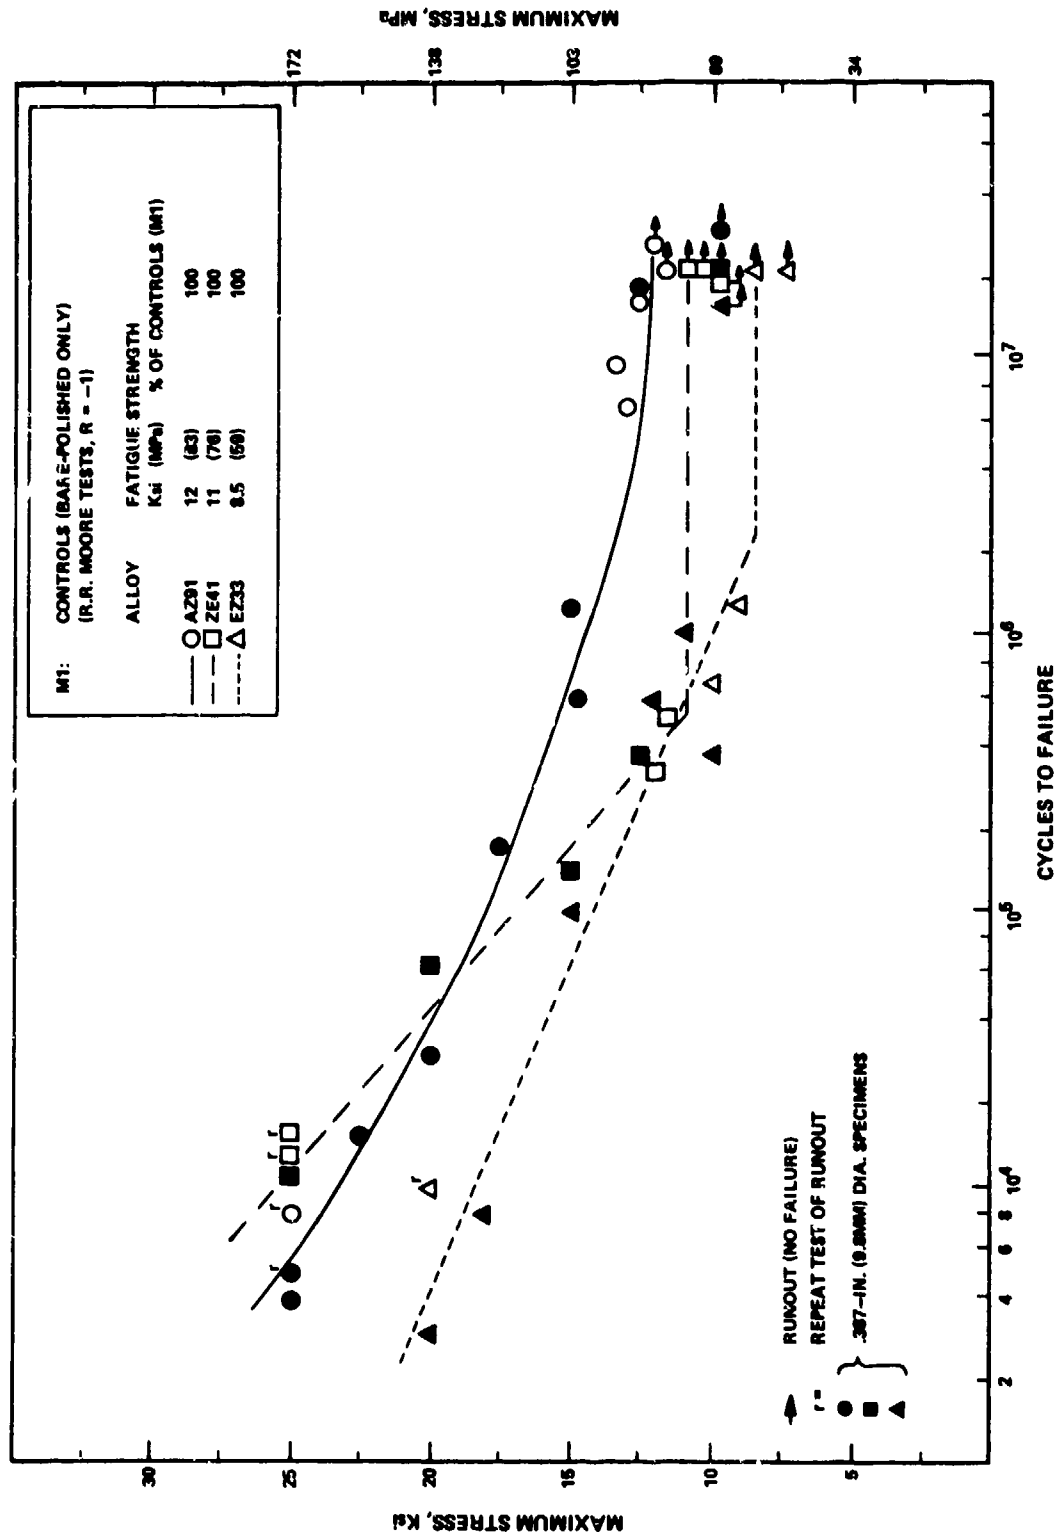


Figure 9 - R. R. Moore Fatigue Test S-N Curves

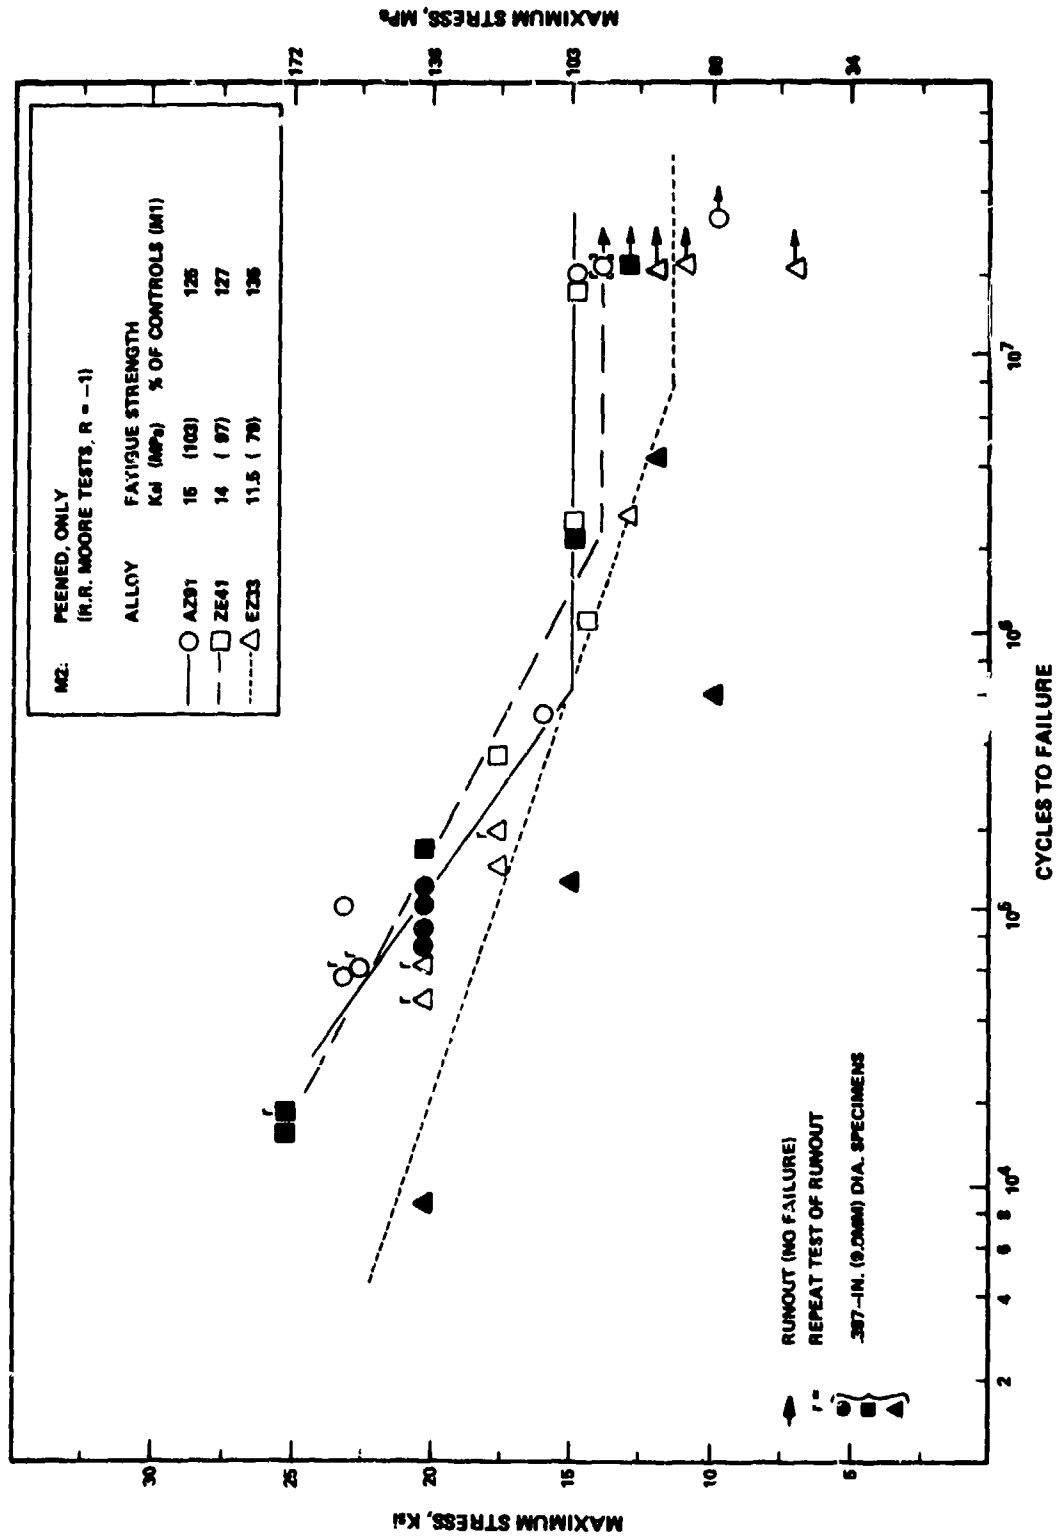


Figure 10 - R. R. Moore Fatigue Test S-N Curves

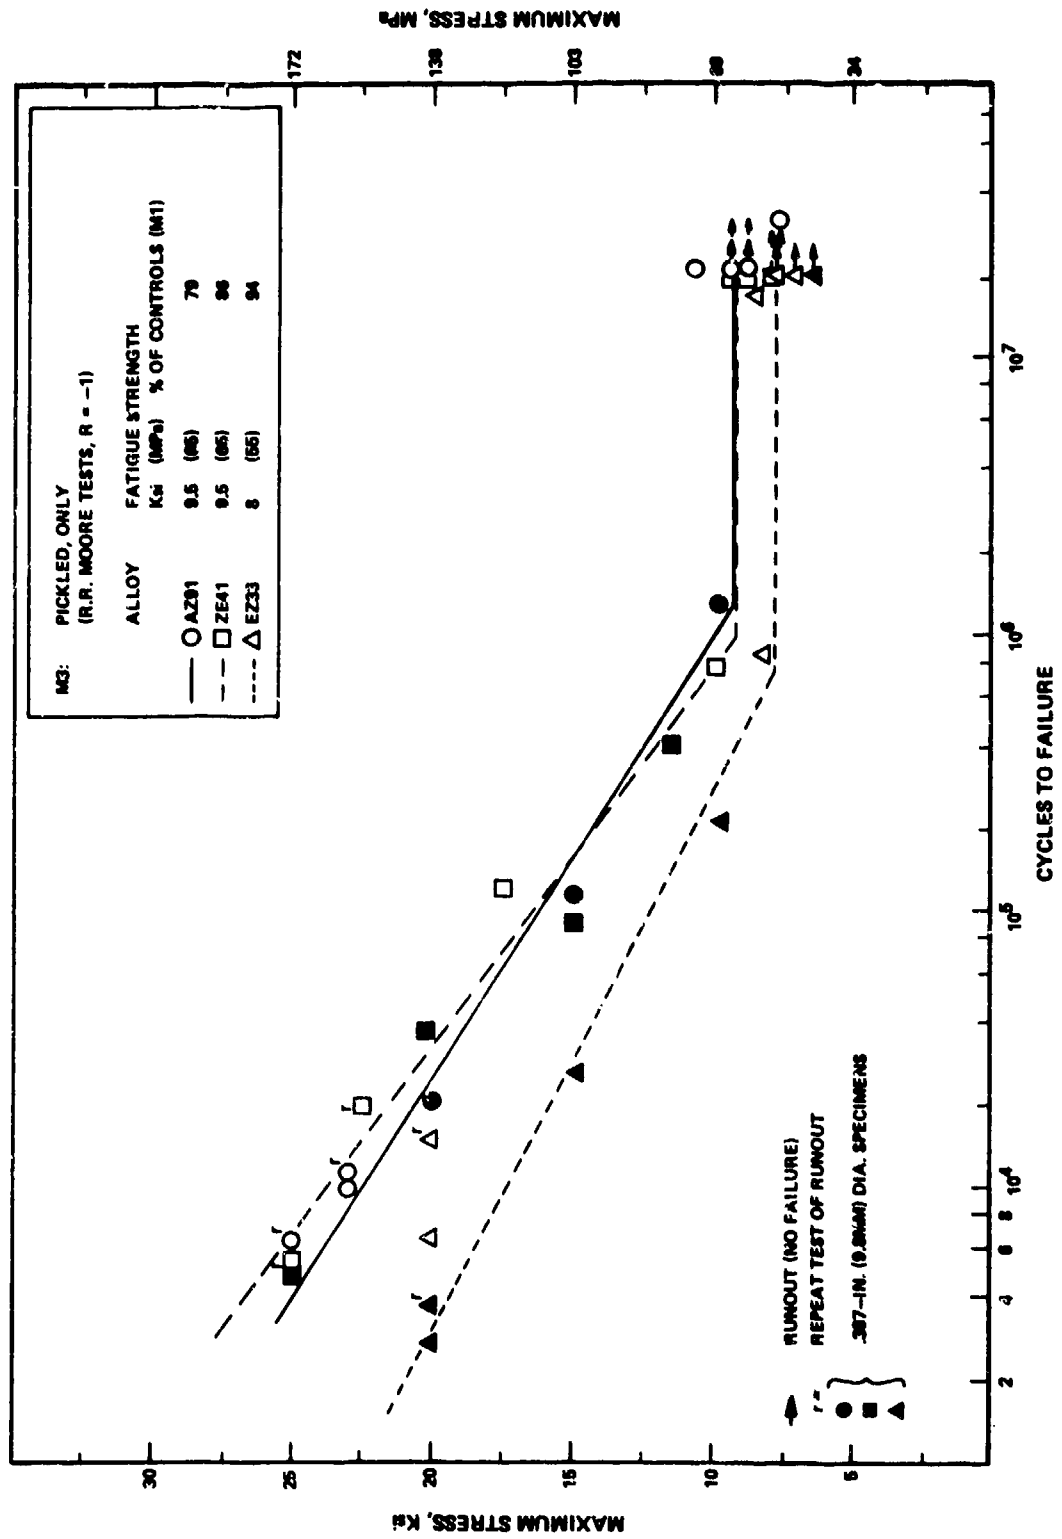


Figure 11 - R. R. Moore Fatigue Test S-N Curves

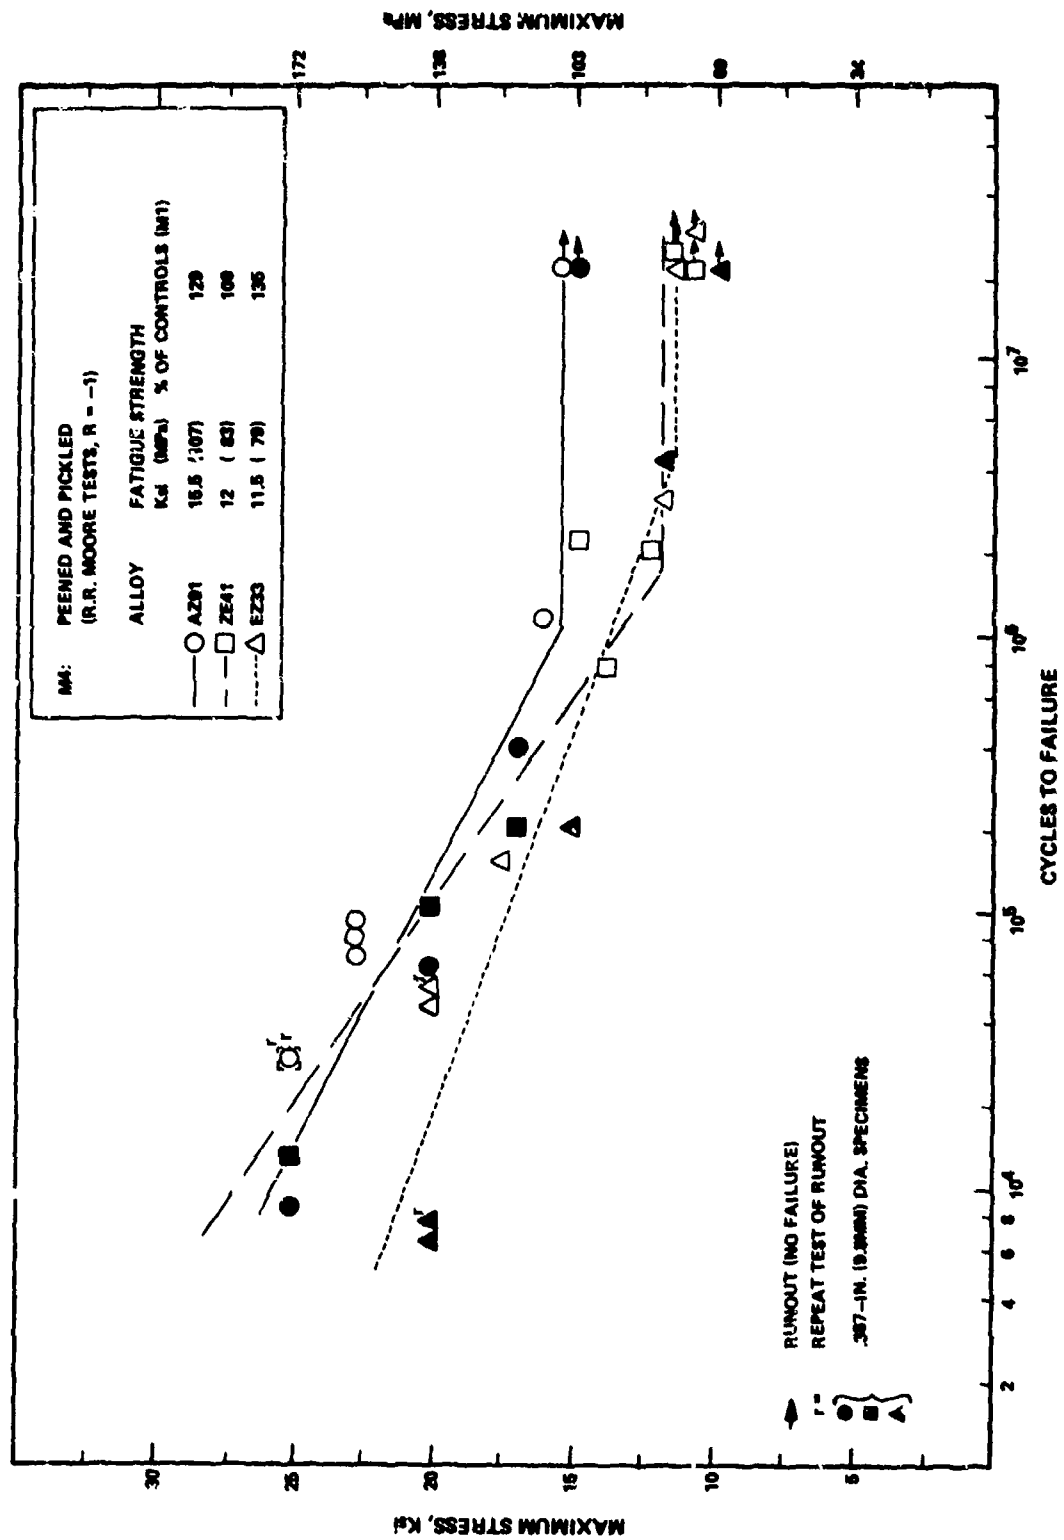


Figure 12 - R. R. Moore Fatigue Test S-N Curves

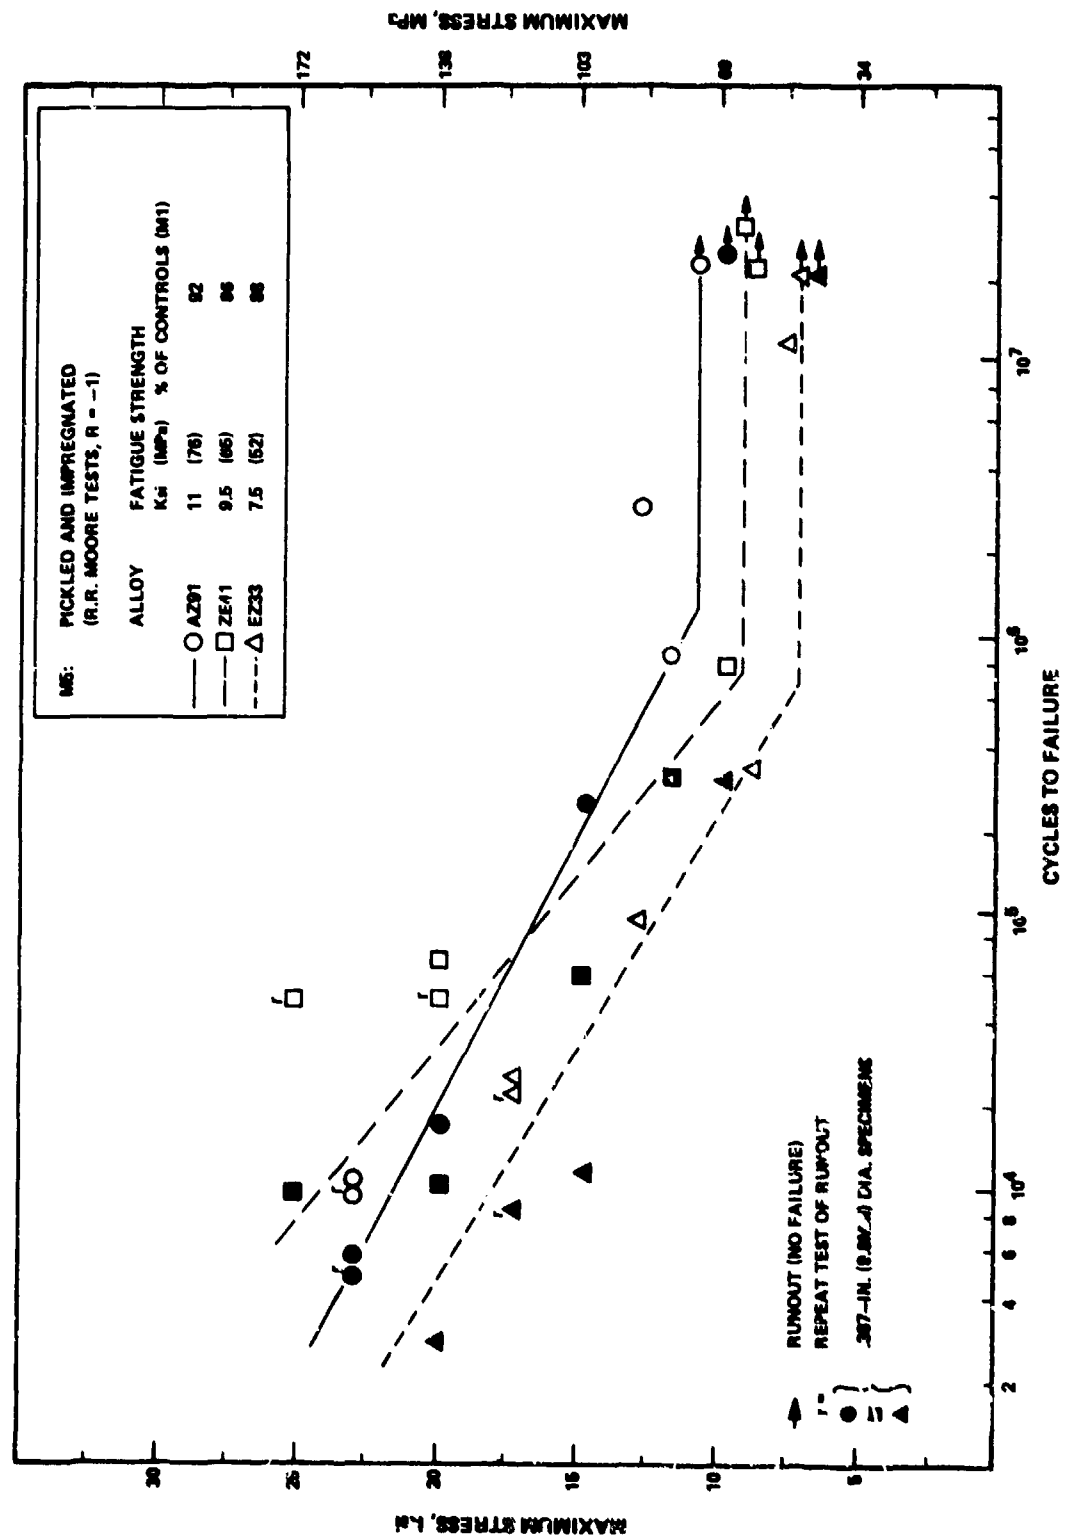


Figure 13 - R. R. Moore Fatigue Test S-N Curves

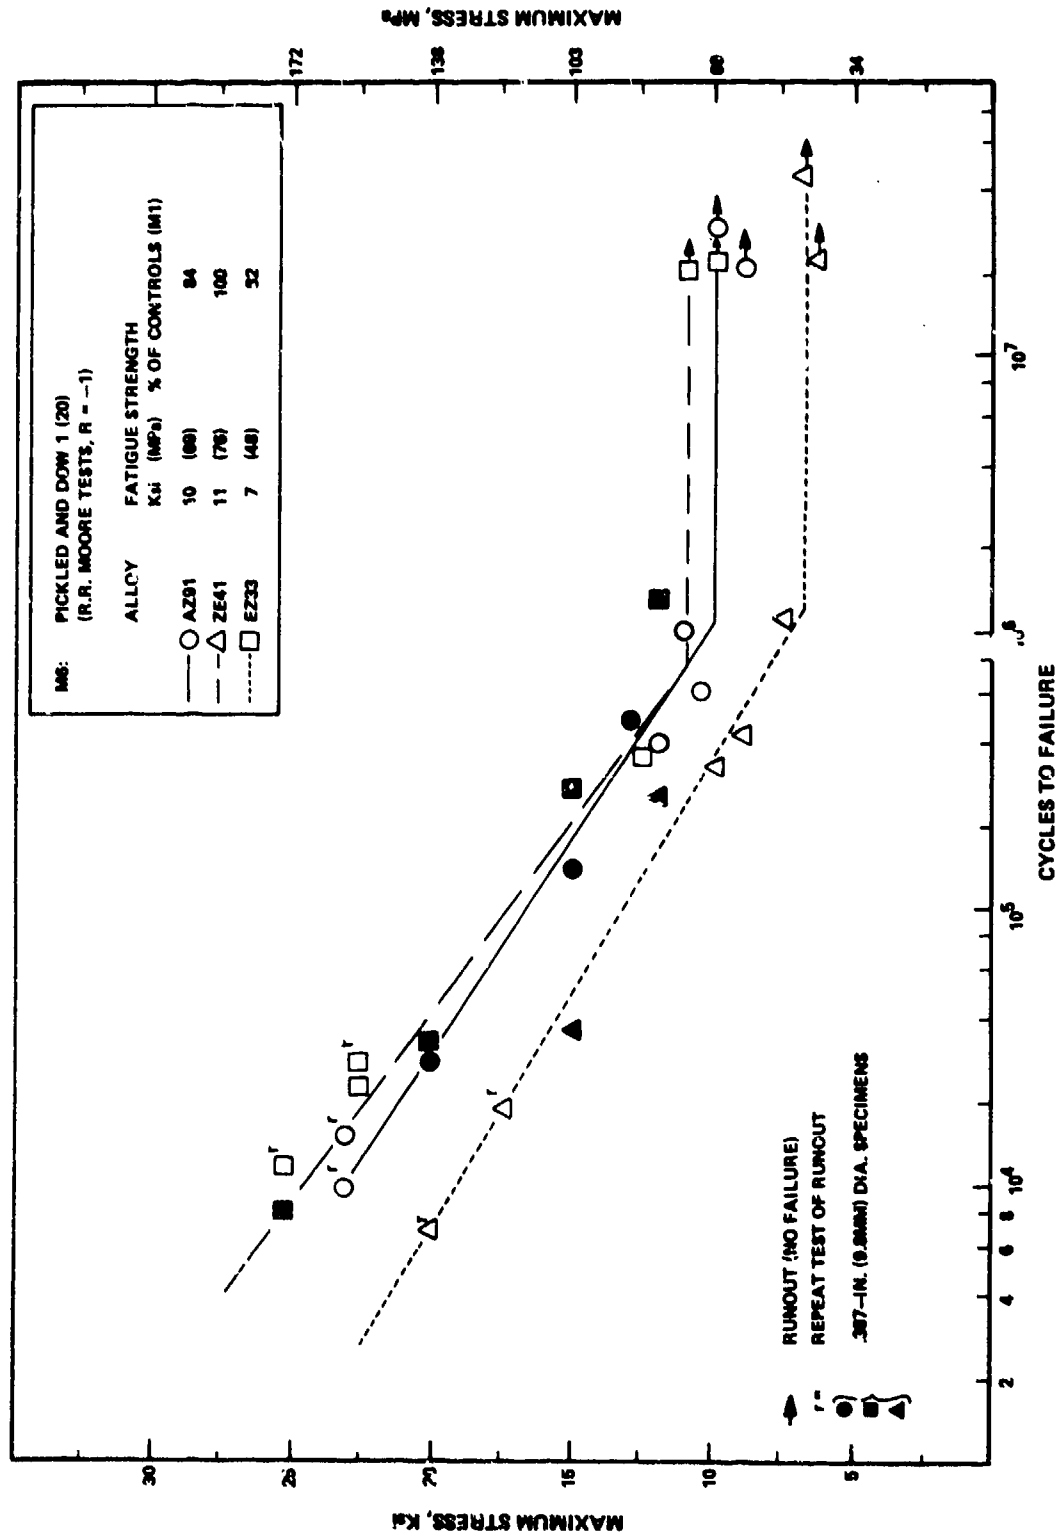


Figure 14 - R. R. Moore Fatigue Test S-N Curves

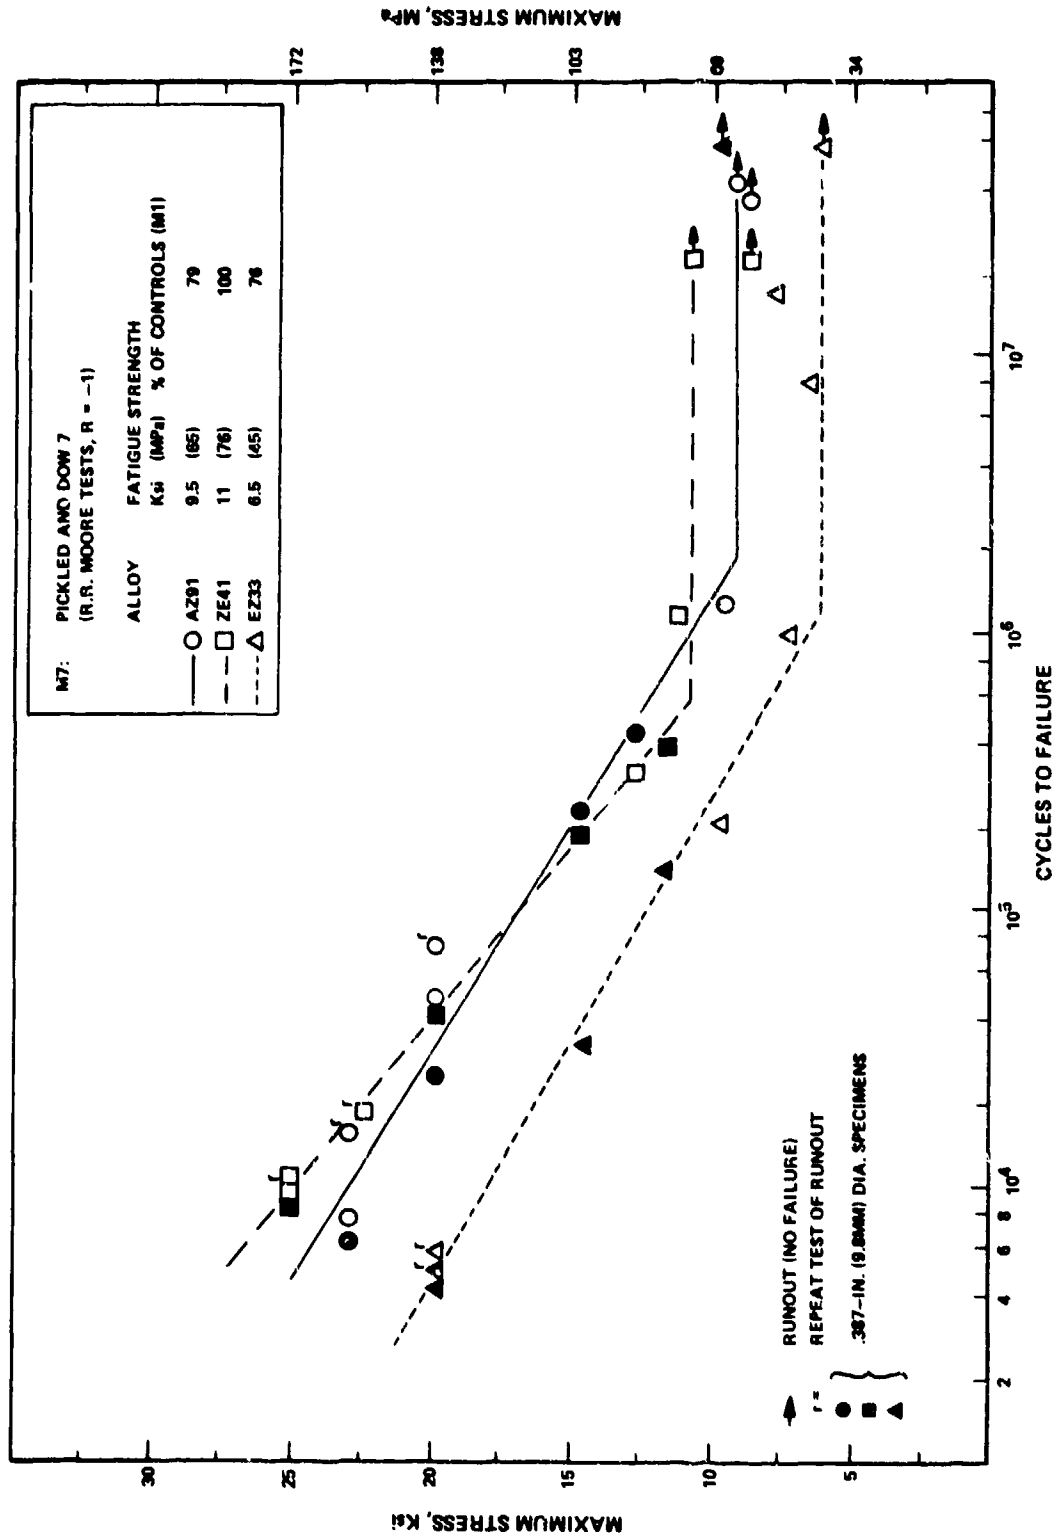


Figure 15 - R. R. Moore Fatigue Test S-N Curves

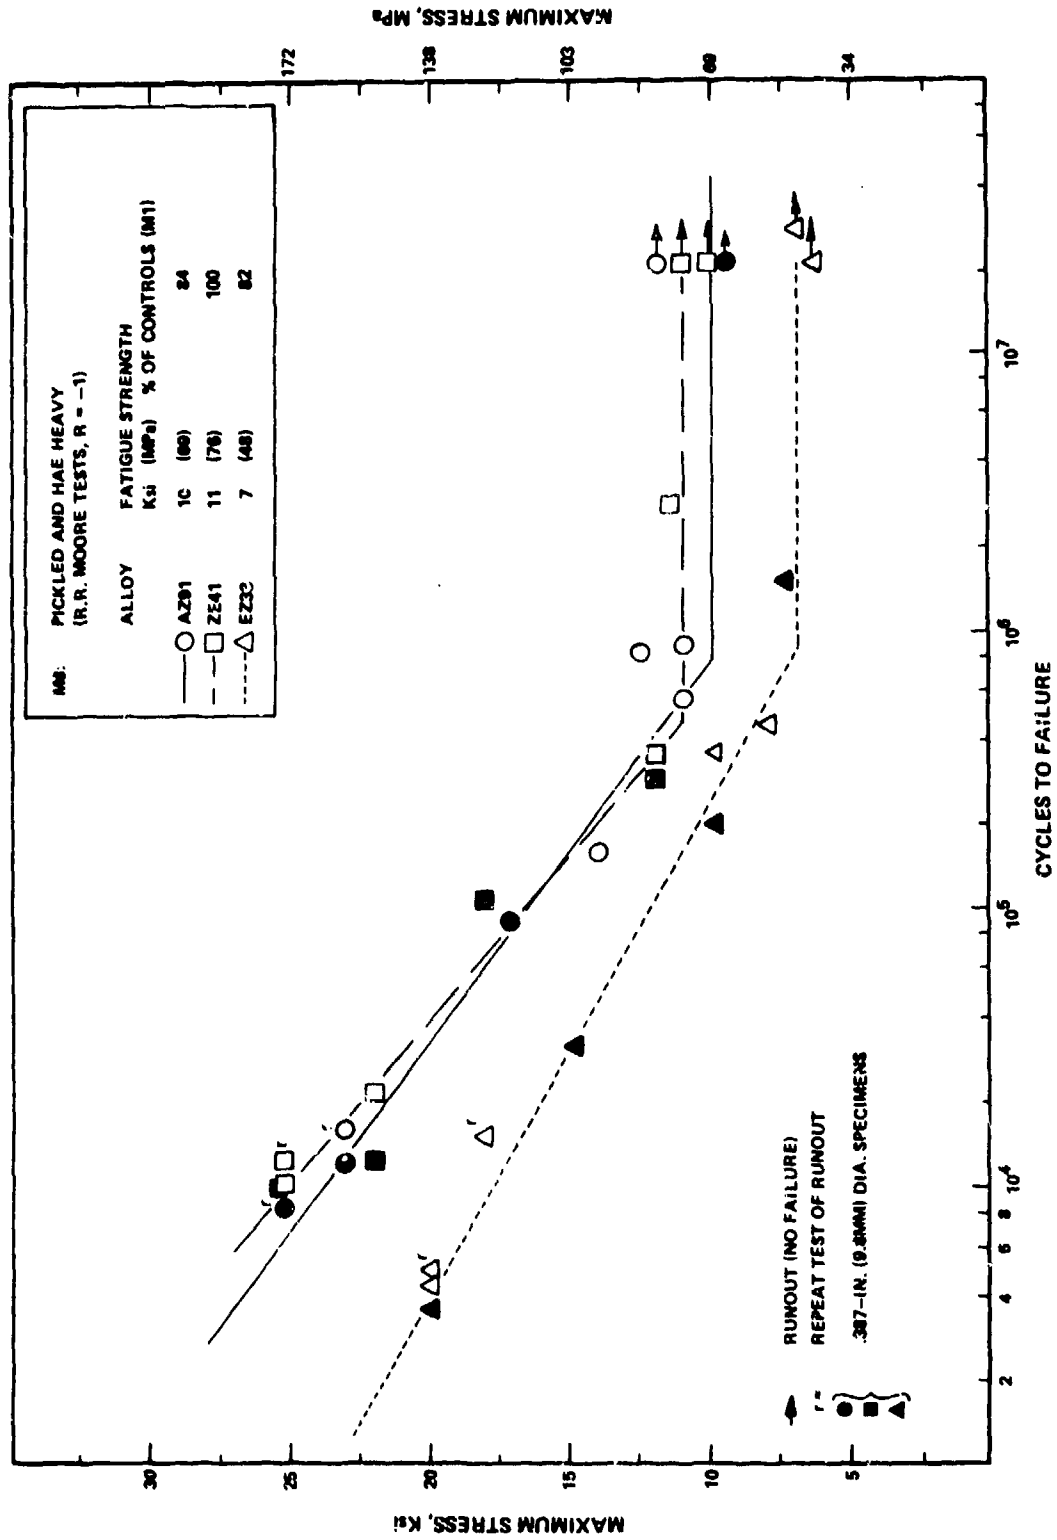


Figure 16 - R. R. Moore Fatigue Test S-N Curves



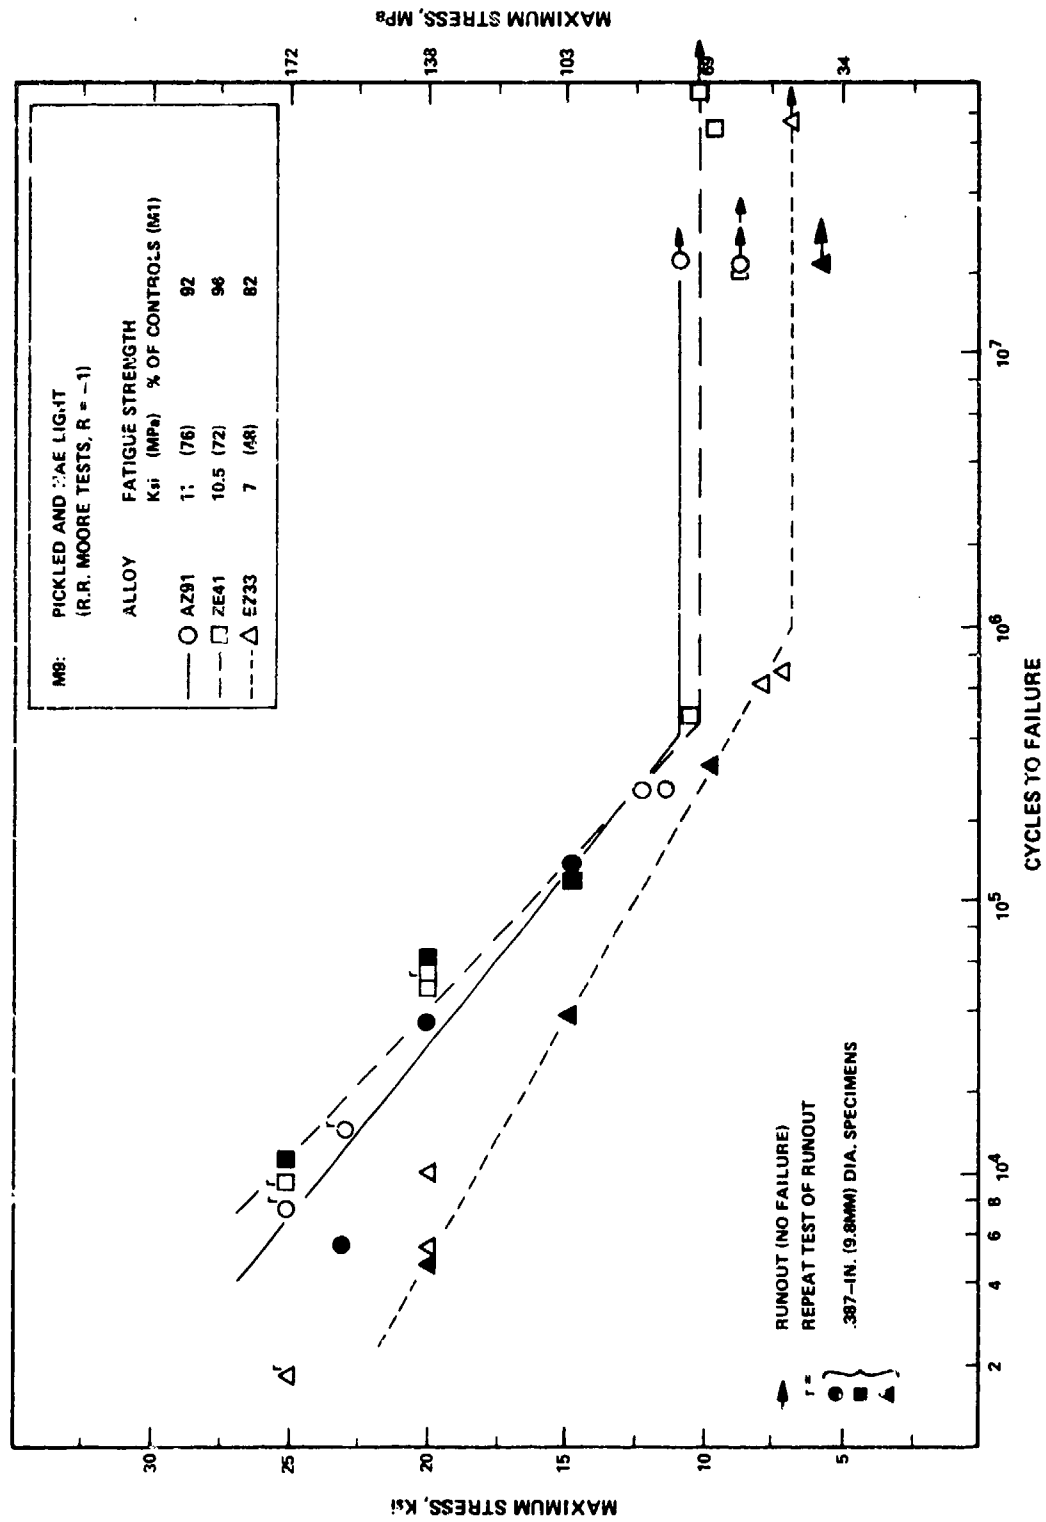


Figure 17 - R. R. Moore Fatigue Test S-N Curves

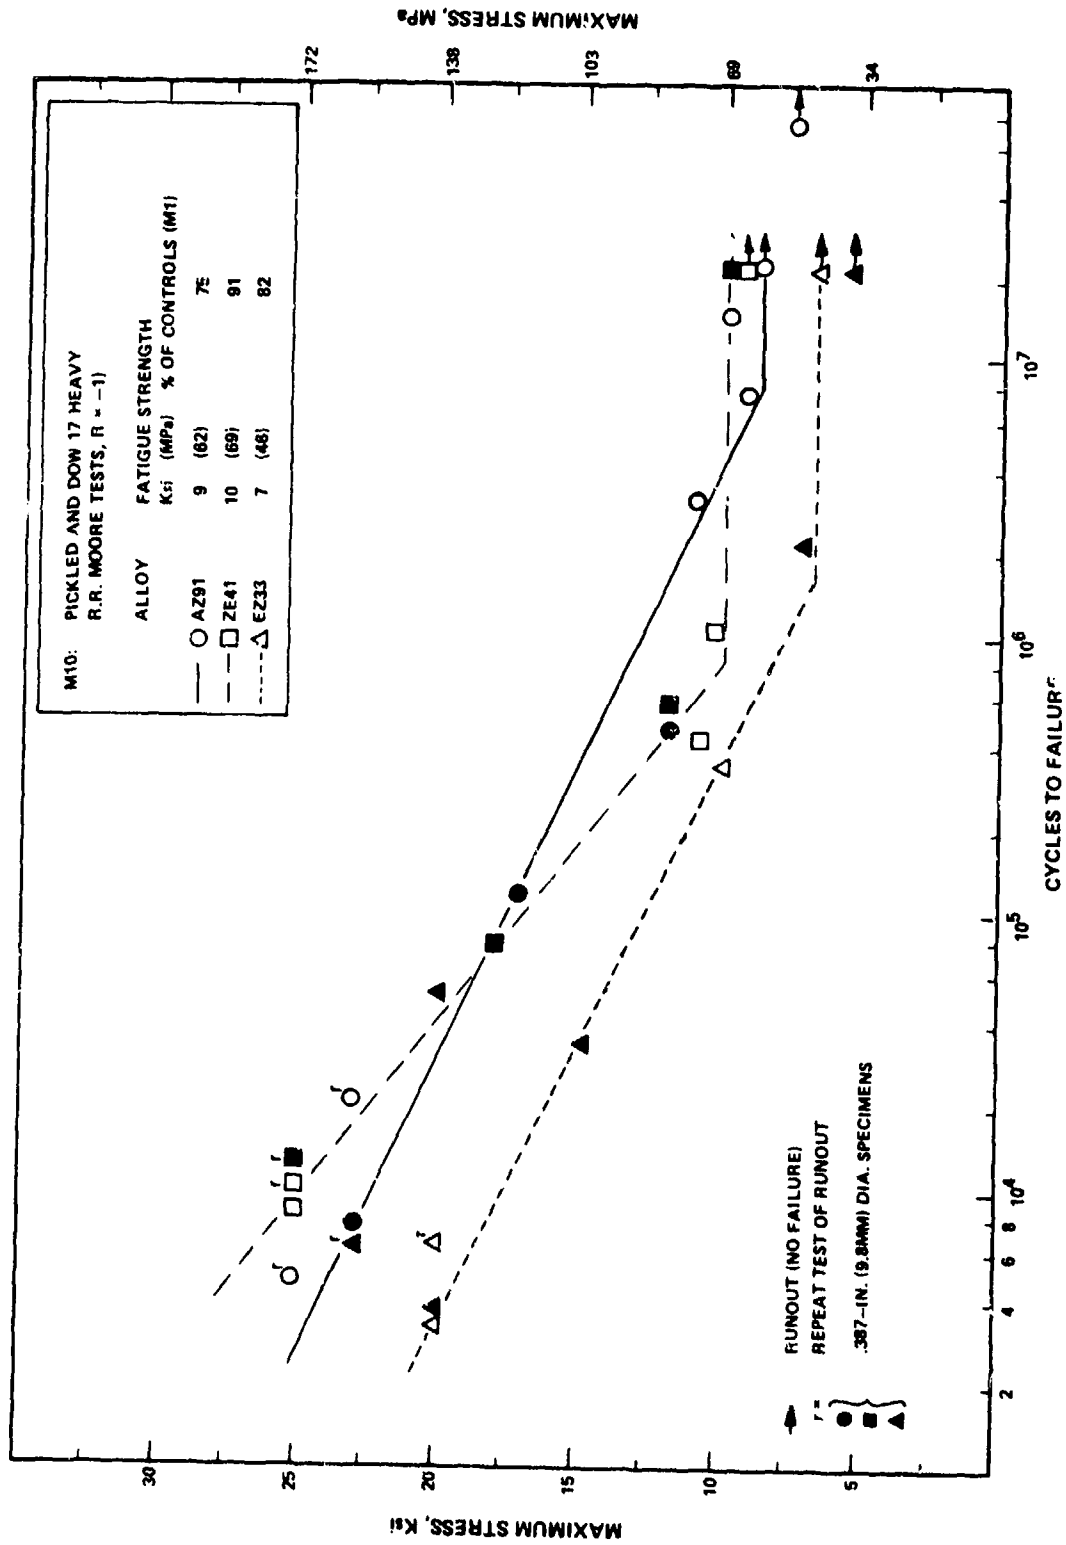


Figure 18 - R. R. Moore Fatigue Test S-N Curves

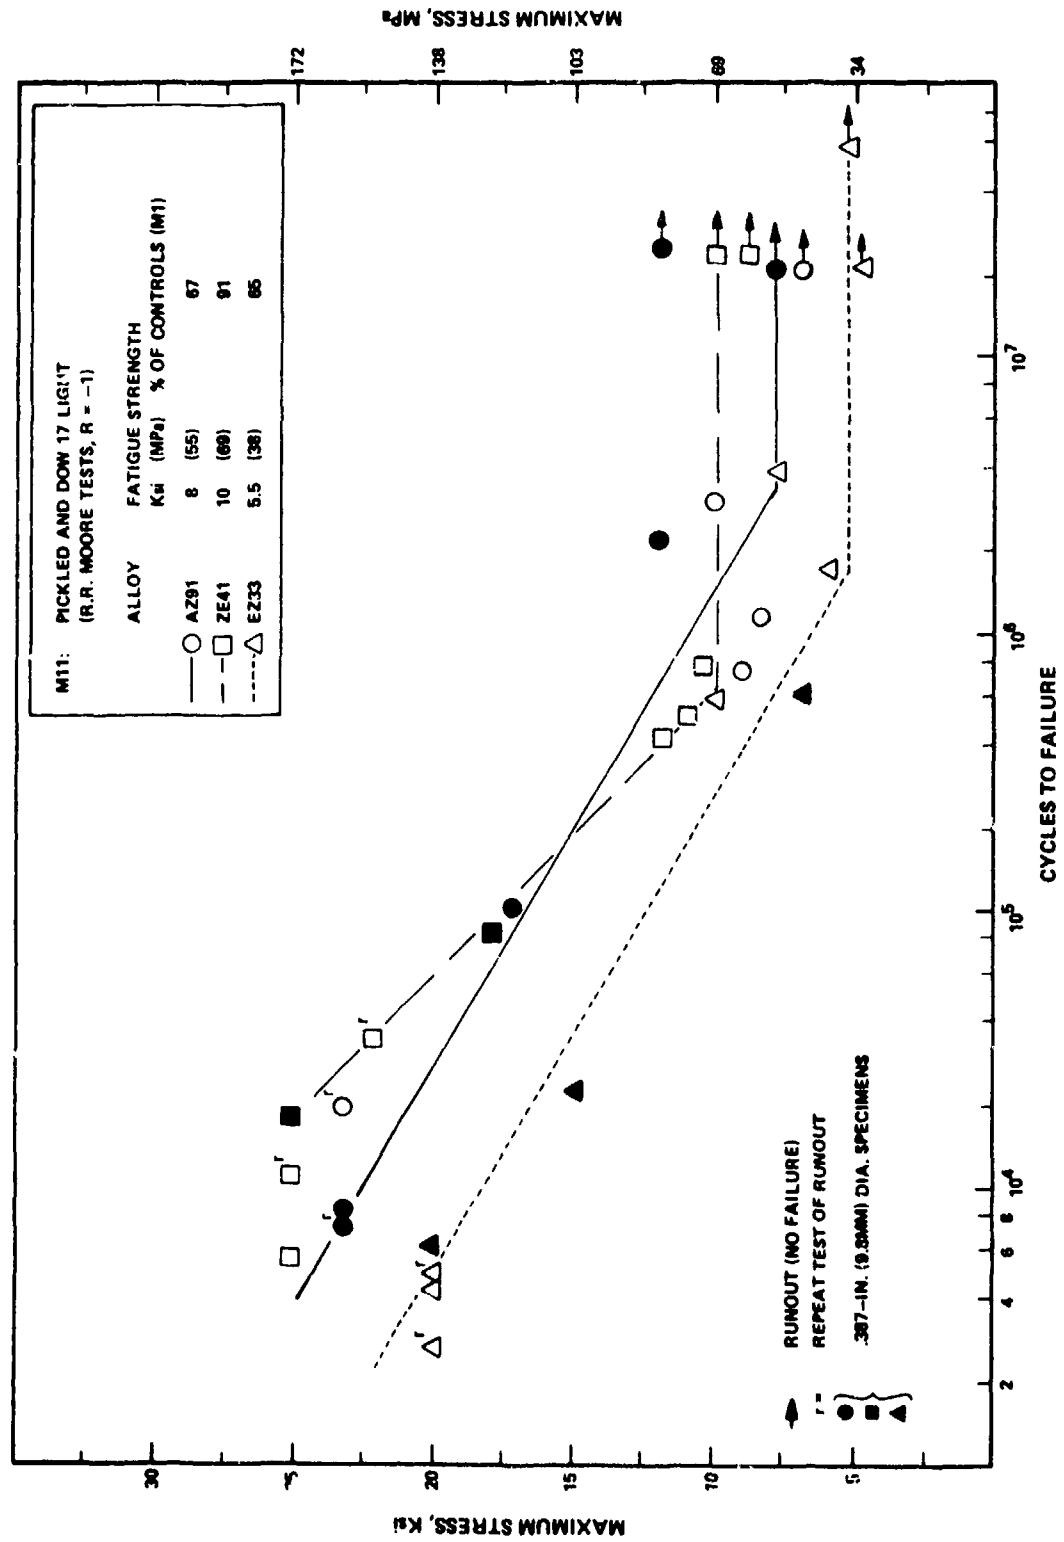


Figure 19 - R. R. Moore Fatigue Test S-N Curves

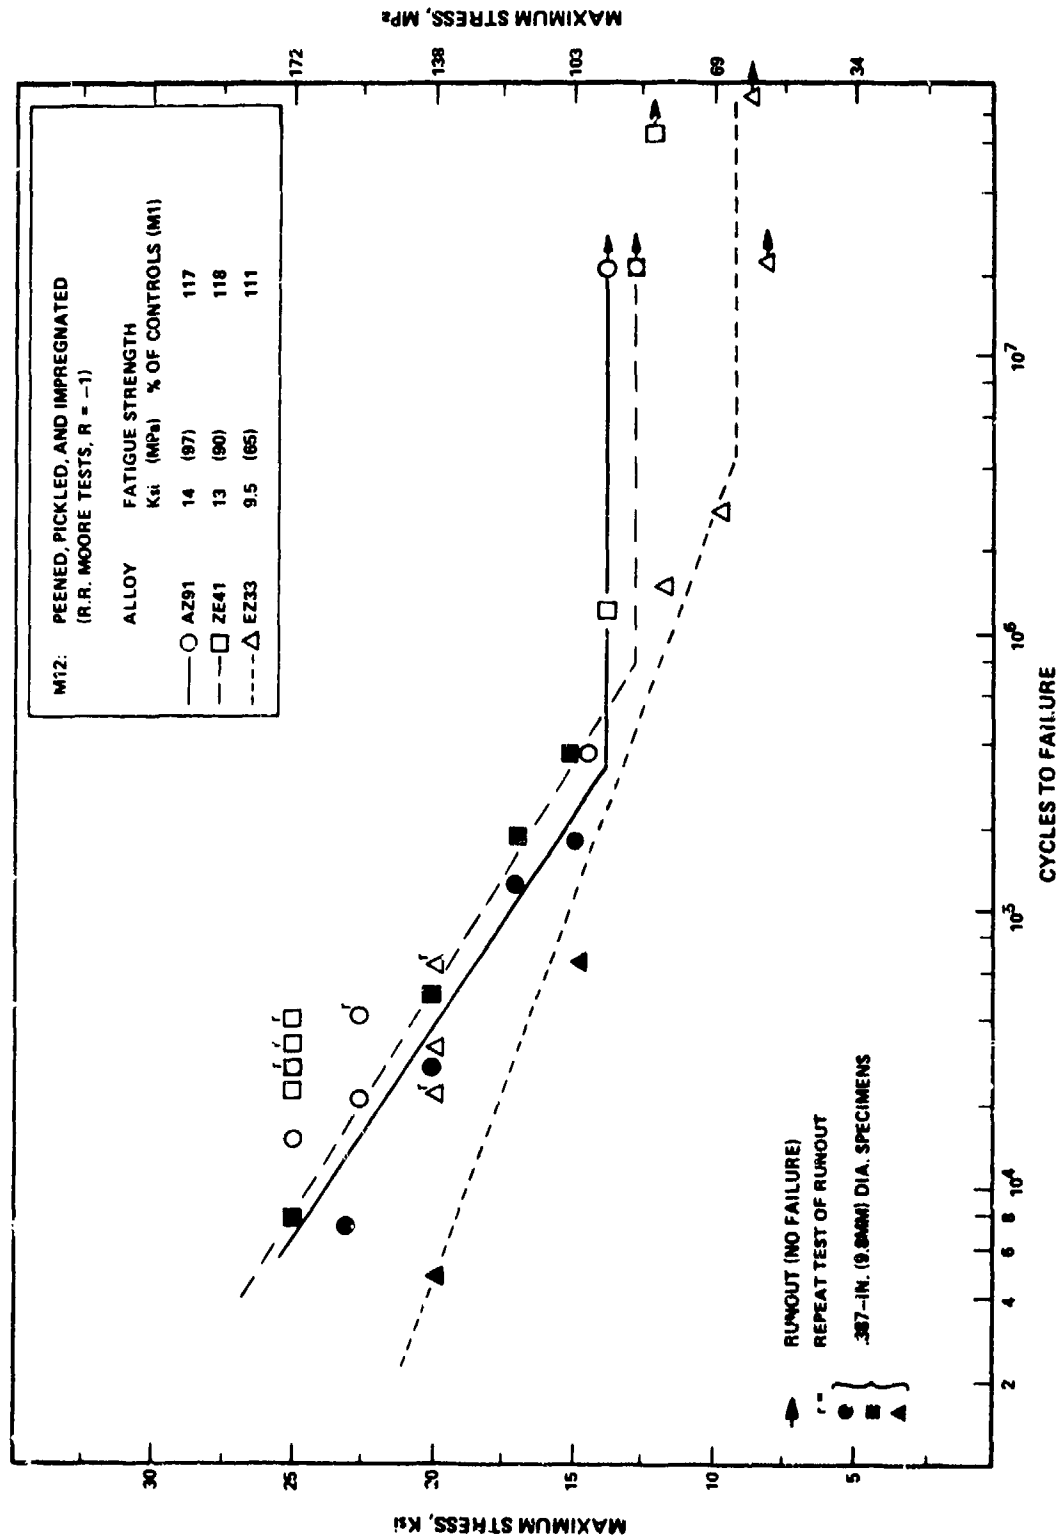


Figure 20 - R. R. Moore Fatigue Test S-N Curves

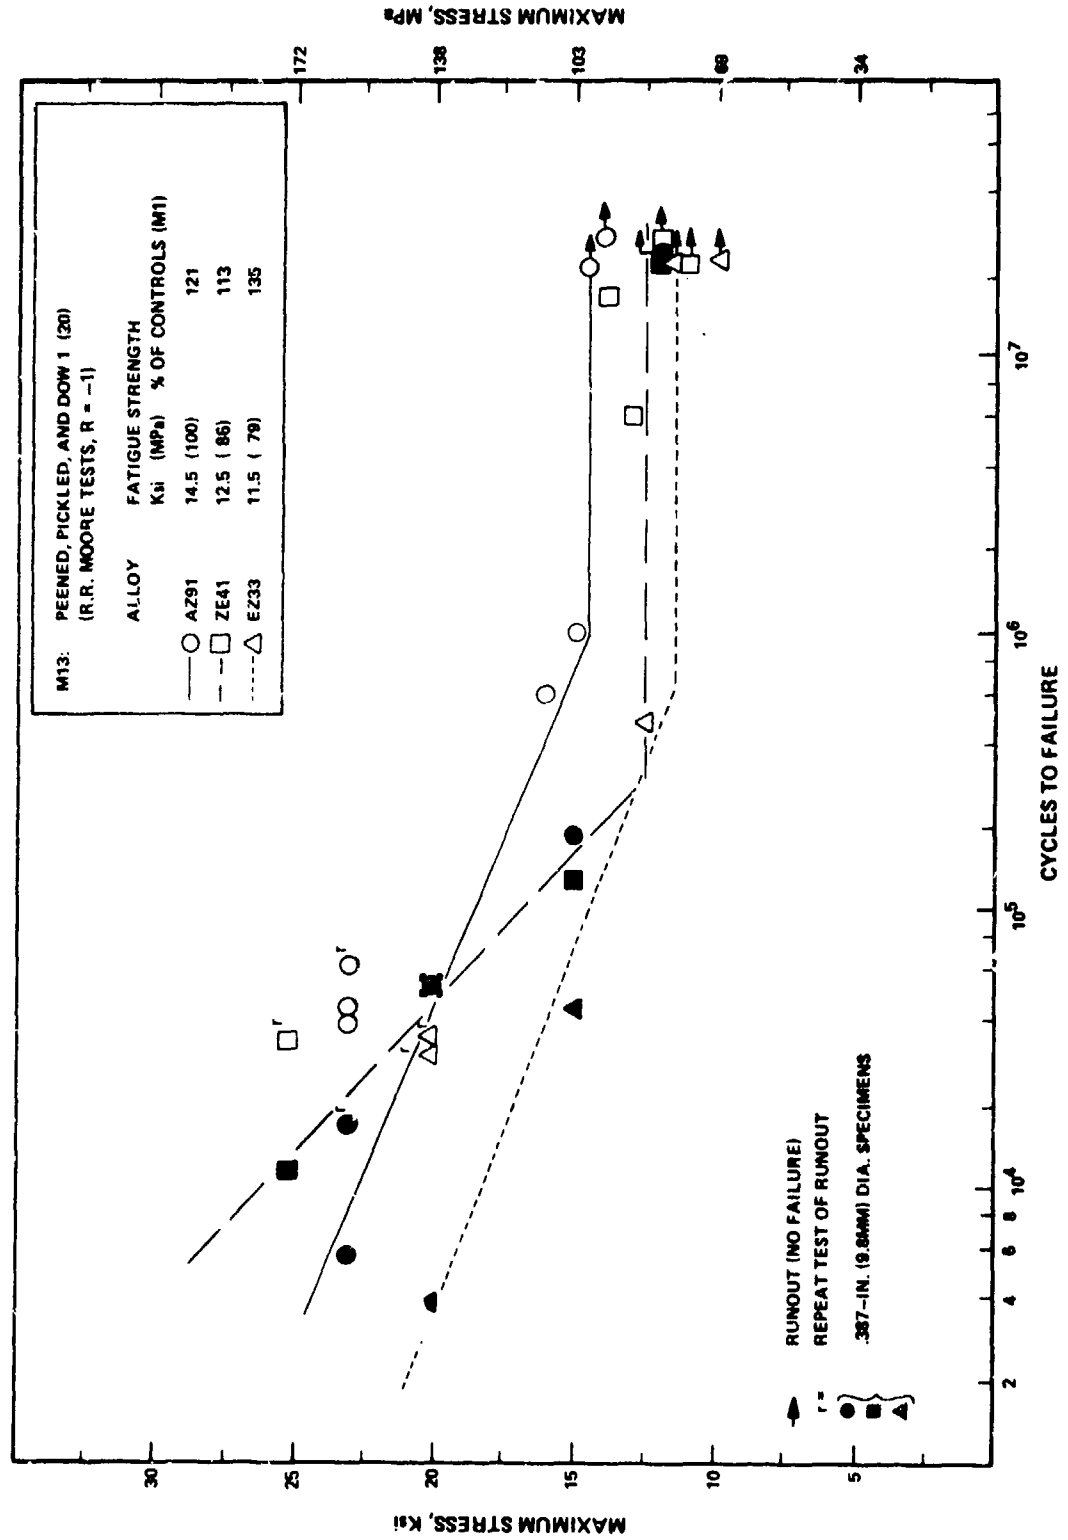


Figure 21 - R. R. Moore Fatigue Test S-N Curves

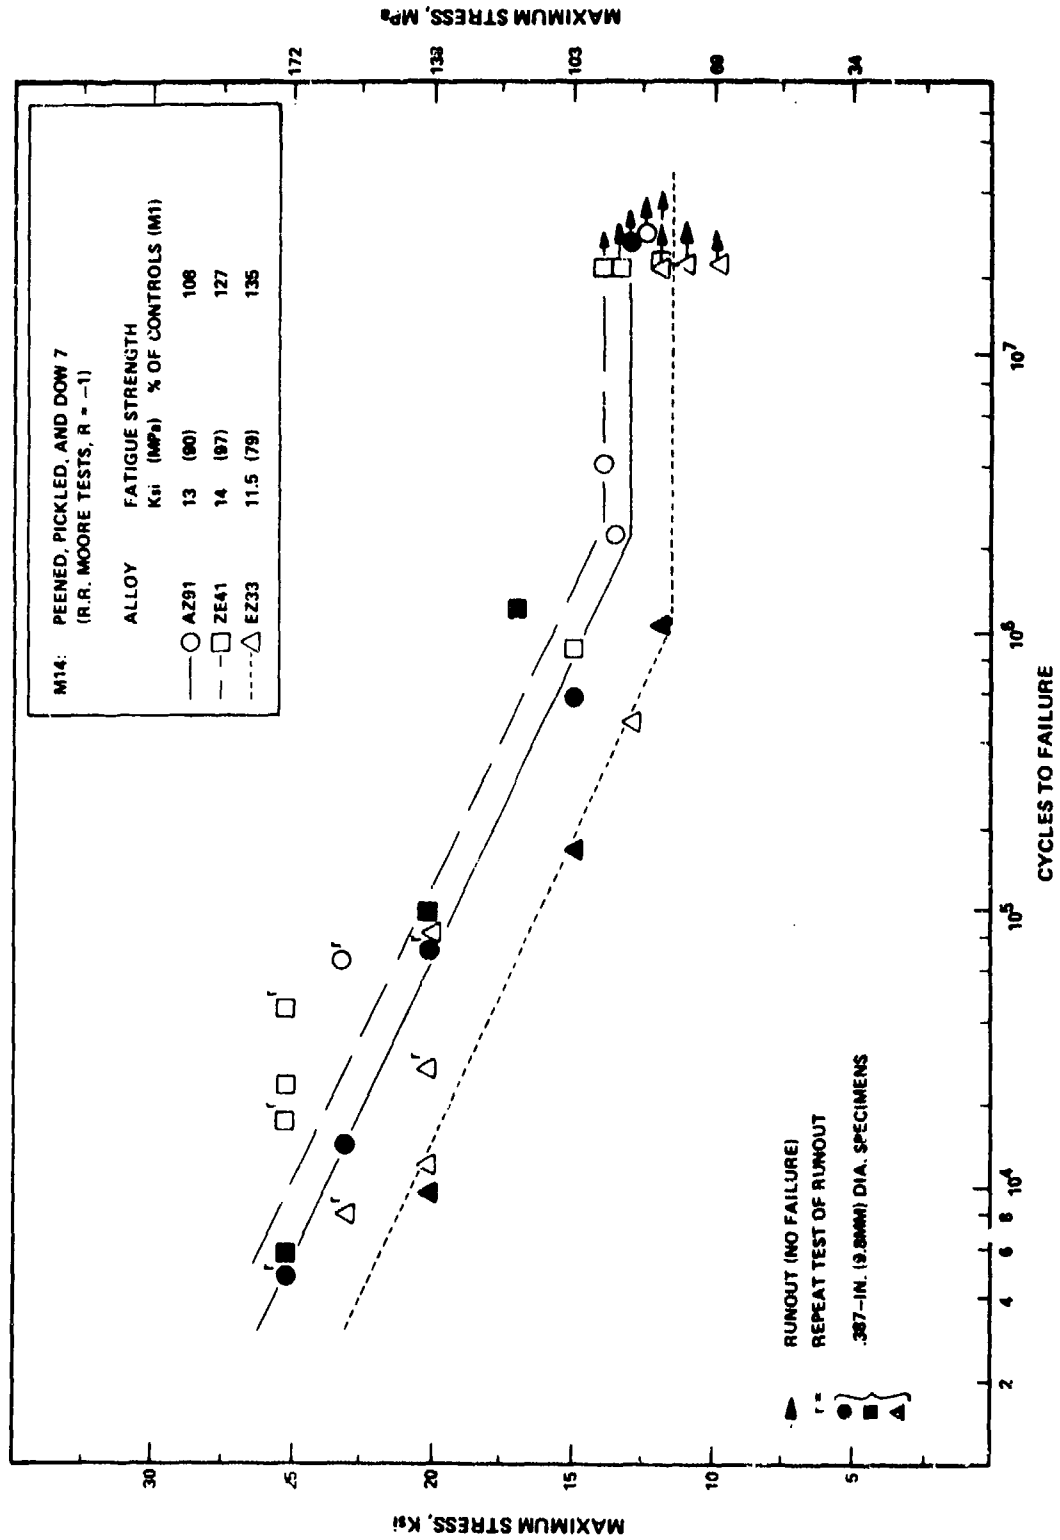


Figure 22 - R. R. Moore Fatigue Test S-N Curves

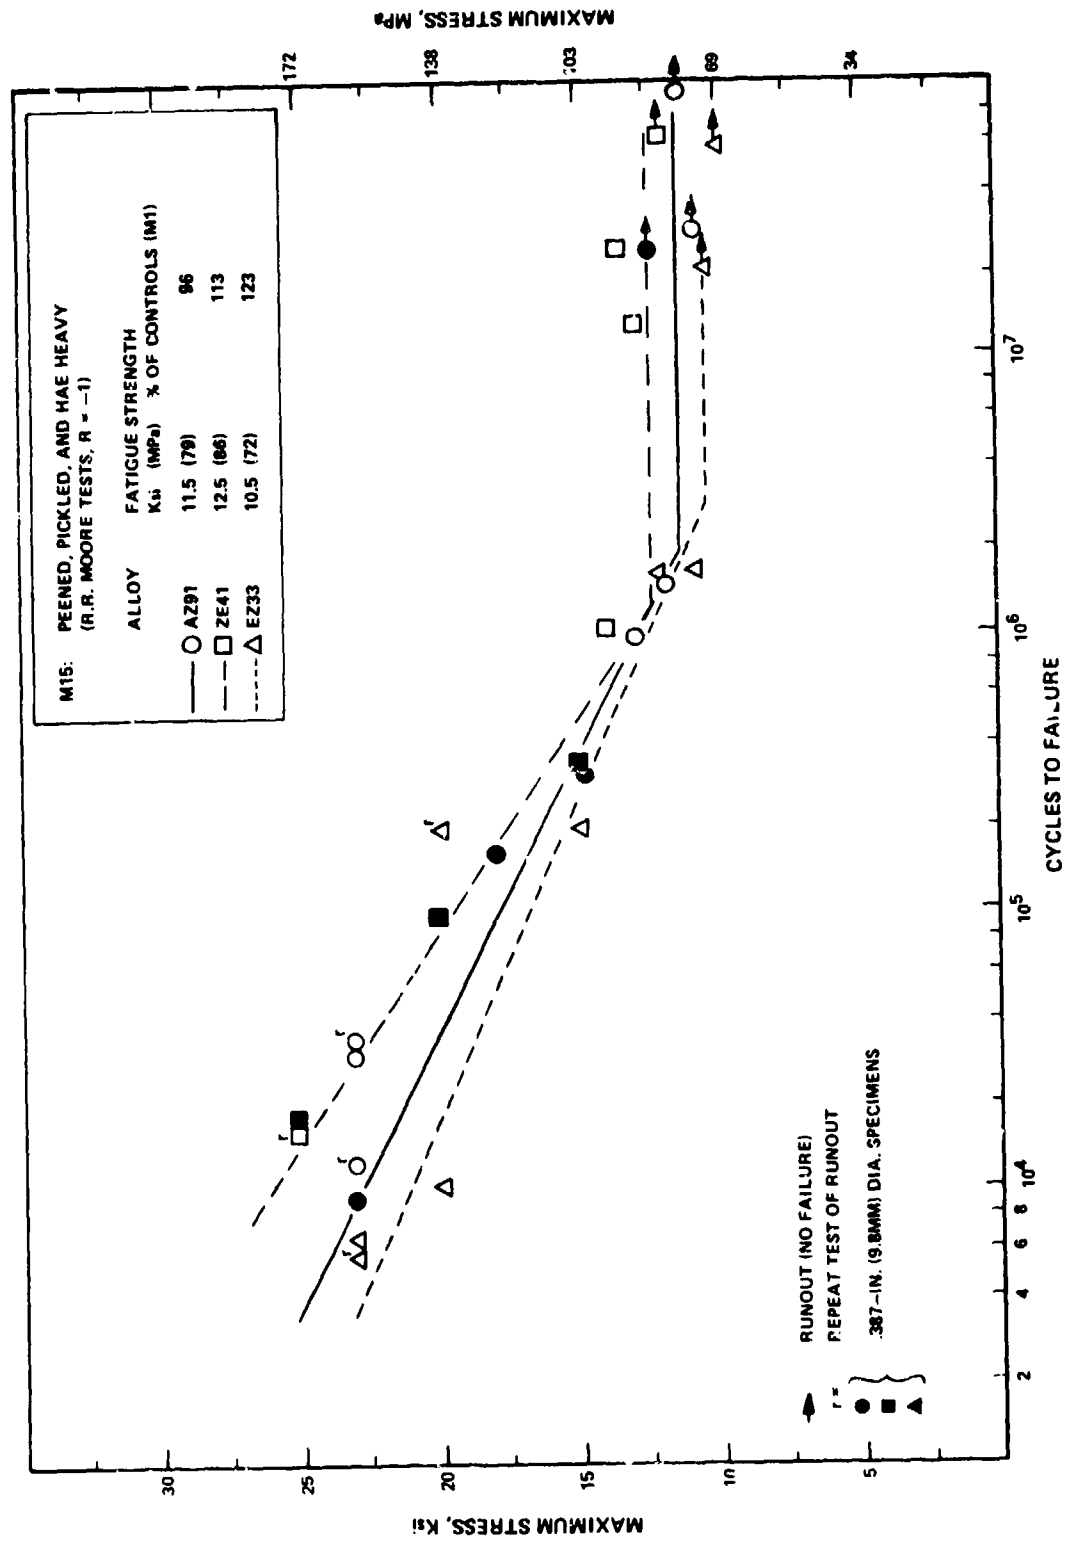


Figure 23 - R. R. Moore Fatigue Test S-N Curves

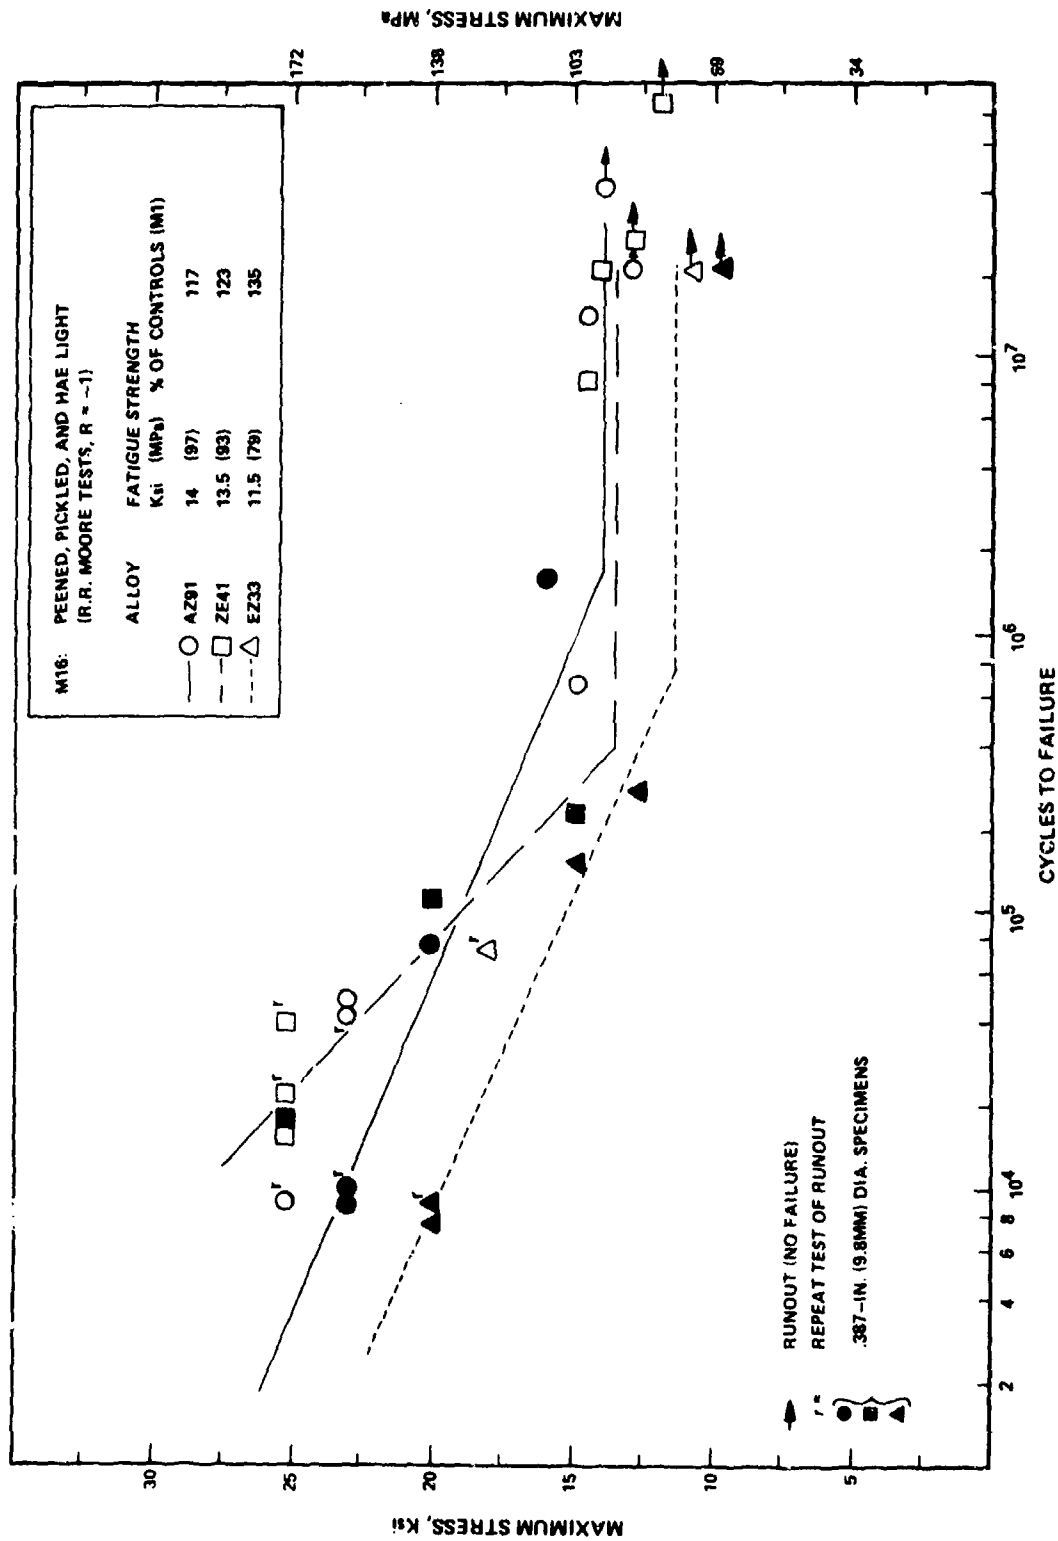


Figure 24 - R. R. Moore Fatigue Test S-N Curves



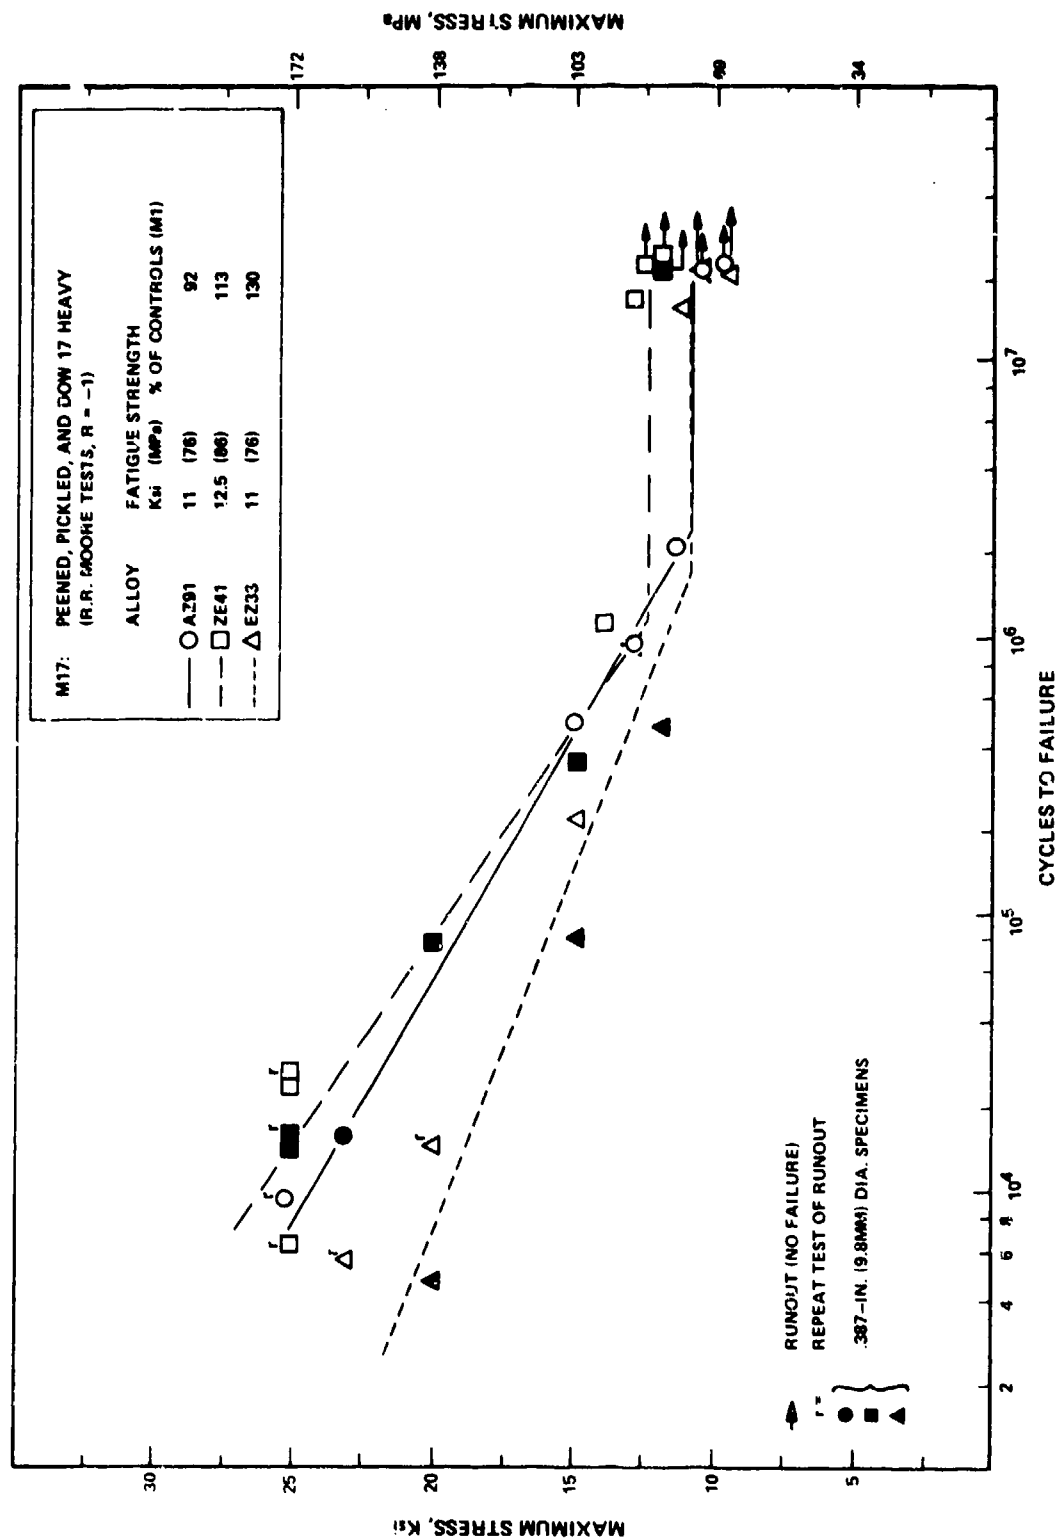


Figure 25 - R. R. Moore Fatigue Test S-N Curves

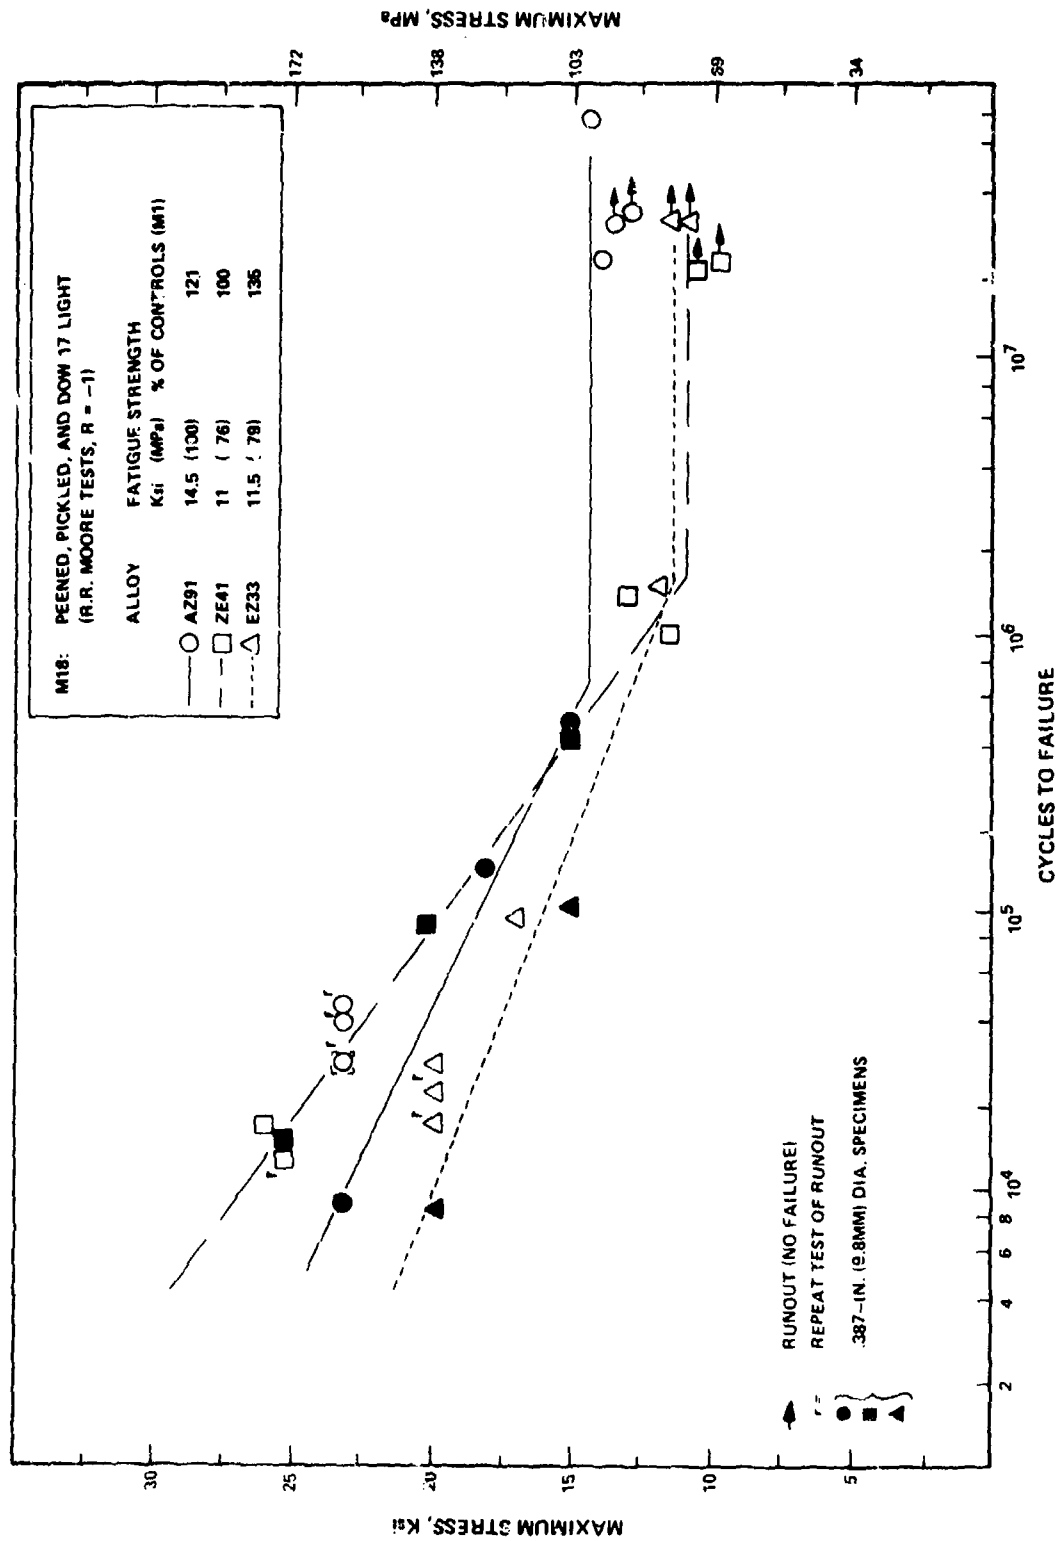


Figure 26 - R. R. Moore Fatigue Test S-N Curves

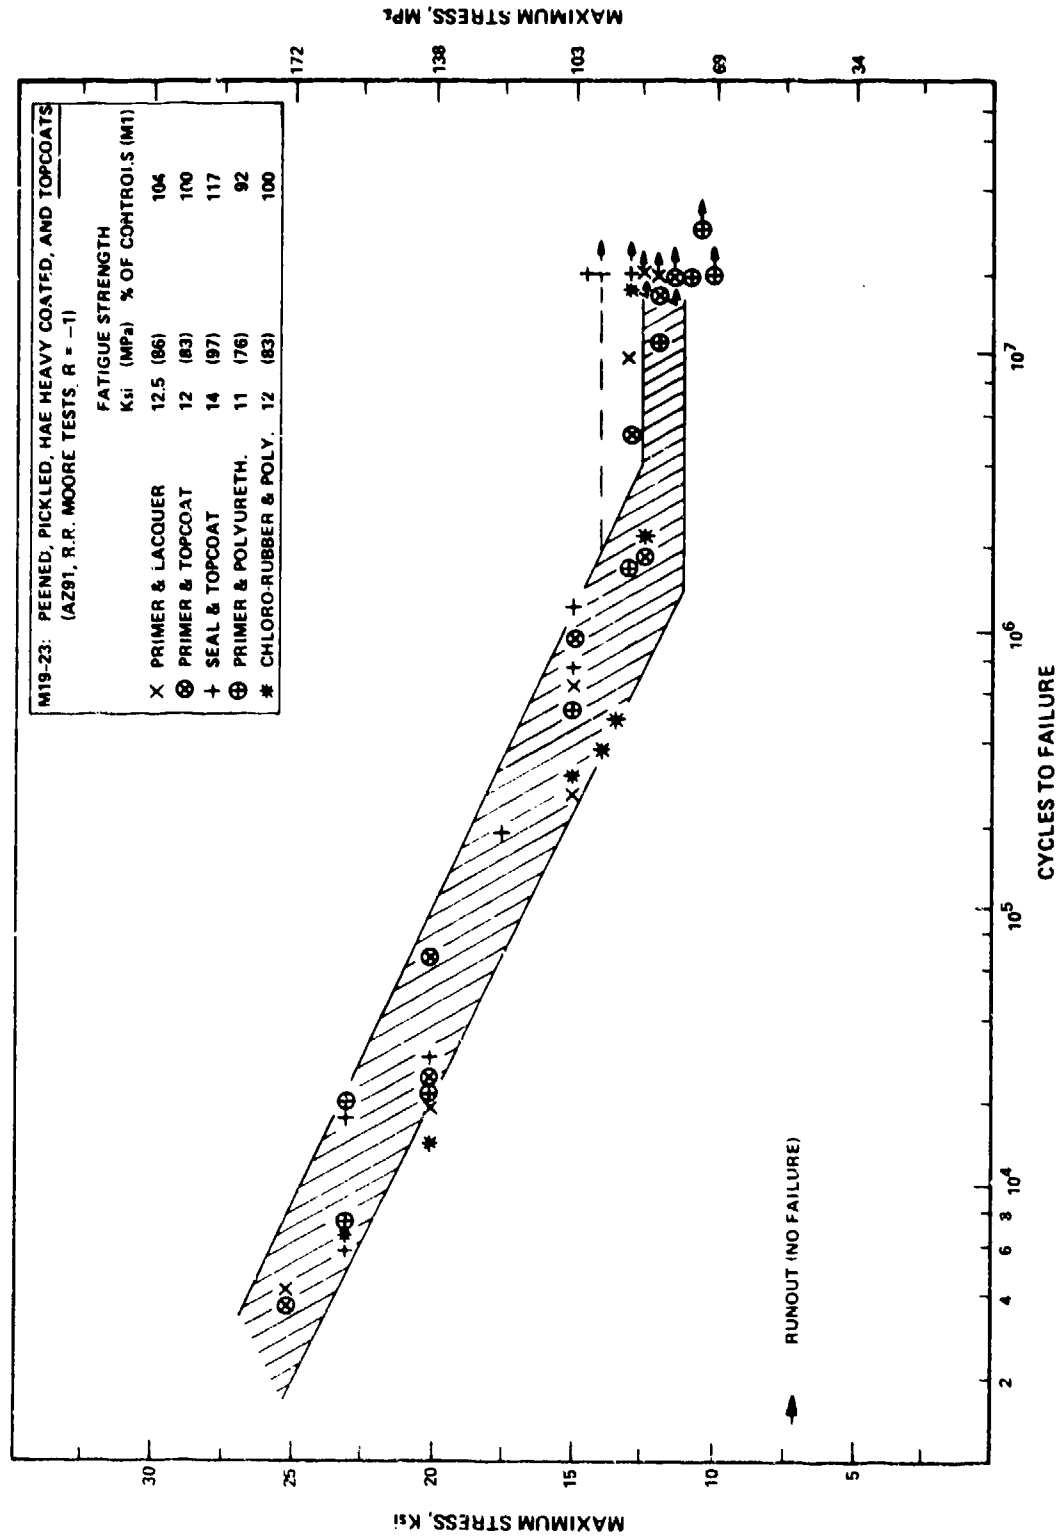


Figure 27 - R. R. Moore Fatigue Test S-N Curves

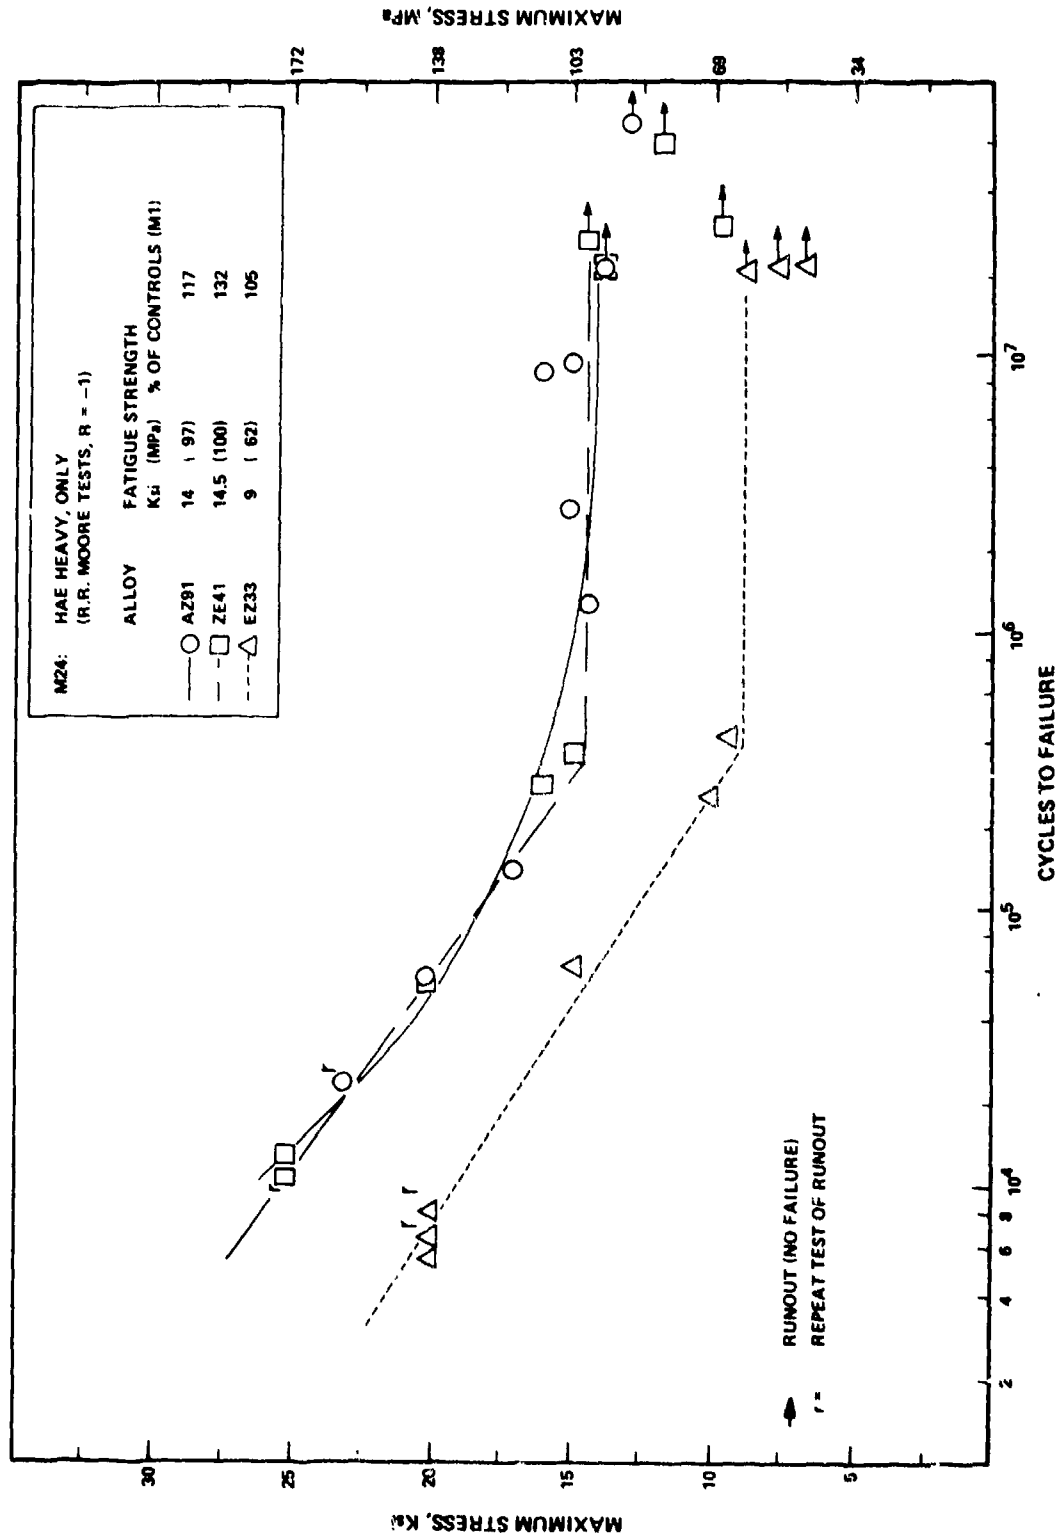


Figure 28 - R. R. Moore Fatigue Test S-N Curves

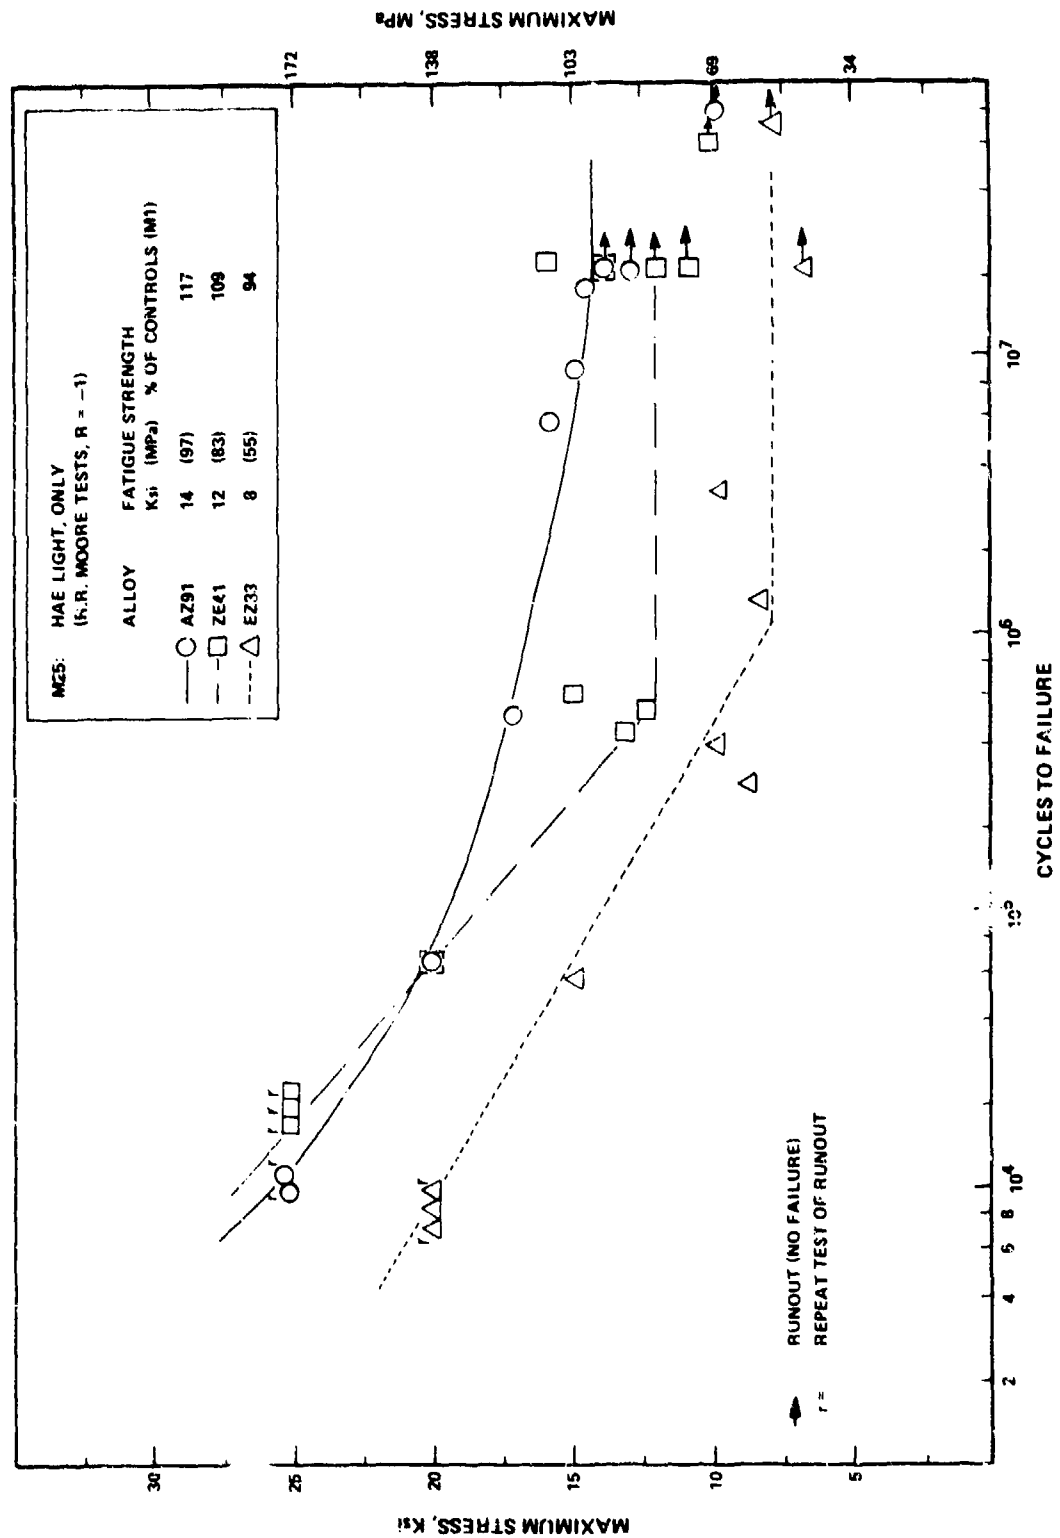


Figure 29 - P. R. Moore Fatigue Test S-N Curves


Table IX

[illegible]




Figure 30 - Typical R. R. Moore Rotating Beam Fatigue Test Specimens, Large and Small Diameter; and Representative Failures. Specimens at Left are With the HAE Heavy Anodic Coating (M8). Failed Specimens are Coated With the DOW 17 Light Anodic Coating (M11).

NADC-77140-30

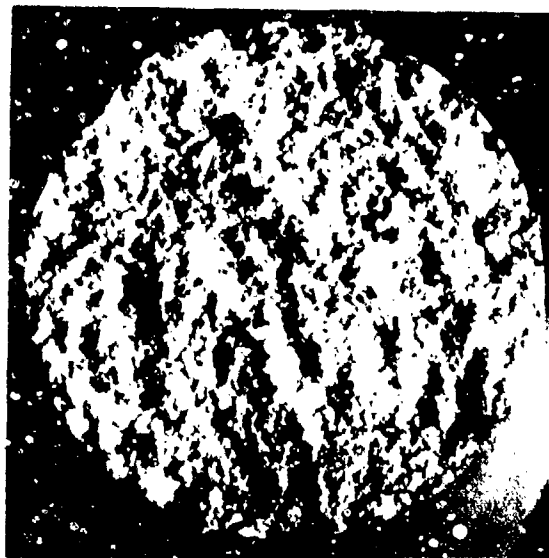

33-51-13

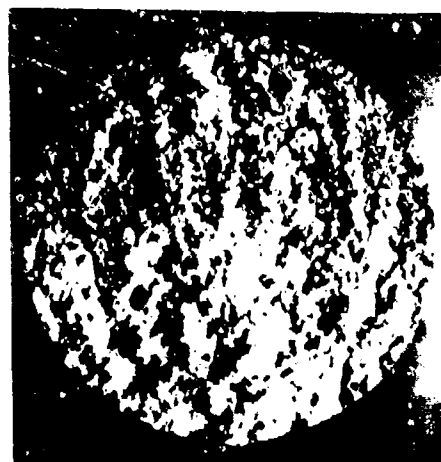

33-50-14

Figure 31 - Representative Fractures of High (Bottom Specimen: 622,000 Cycles) and Low (Top Specimen: 25,000 Cycles) Cyclic Life; Same DOW 17 Light Coated Specimens as Shown in Figure 30.



of no significant influence on the test results. A critical evaluation of the test data supports this assumption in general. Although some effect may seem apparent, the data, itself, is conflicting and is confused by the inability to differentiate between effects due to size and effects caused by the fact that the specimens were processed in two separate groups (that is, manufactured, treated, and coated at different times).

Of the conditioning treatments evaluated, both pickling and shot peening proved to have significant effect on the fatigue strength of all three alloys: yielding 5 to 20% decrease with pickling (M3) and 25 to 35% increase with peening (M2) depending upon the alloy. Also, pickling after peening (M4) had little effect on the peened fatigue strength. The effect of the polystyrene impregnation after pickling differed for the peened (M12) and unpeened (M5) conditions. For the pickled and impregnated specimens there appears to be little effect, generally. Applied over surfaces peened prior to pickling, however, impregnation appears to reduce slightly the fatigue strength - at least for the AZ91 and EZ33 alloys. This reduction could be attributed to the 300°F (149°C) cure temperature required by impregnation causing stress relief of the peened surfaces. In fact, MIL-S-13165B (Shot Peening of Metal Parts, 31 Dec 1966) and MIL-P-81985(AS) (Peening of Metals, 18 Oct 1974) both restrict post peening operation temperatures of magnesium parts to under 200°F (93°C).

The unpeened chromate coating data, except for the ZE41 alloy, showed reduced fatigue strength from the bare controls, M1 (20 to 25% reduction). On unpeened ZE41 alloy surfaces, however, these coatings showed no deleterious effect. Peened and chromate coated data showed significant reduction, compared to the peened only condition, only for AZ91 with the DOW 7 coating, which reduced fatigue strength by 17%, and ZE41 alloy with the DOW 1 coating which showed a 14% reduction in fatigue strength. Interestingly, in general the ZE41 chromate coating data showed comparable strength to the controls and 5 to 20% increased fatigue strength compared to the pickled only and peened and pickled surfaces. In general, the test results indicated very little difference between the chromate conversion coatings, DOW 1/ DOW 20 (M6 and M13) and DOW 7 (M7 and M14).

For all the anodic coating tests, (M8 - 11, 15 - 18) the data showed reduced fatigue strength from the bare (M1) and peened (M2) controls (0 to 35% reduction). However, when compared to the pickled only or peened and pickled surfaces (M3 and M4, respectively) degradation due to the coatings did not necessarily occur. Thus, for the ZE41 alloy an improvement in fatigue strength of up to 15% was observed with the anodic coatings applied to both peened and unpeened, pickled surfaces. For the EZ33 alloy there was very little influence on peened and pickled surfaces but on pickled only surfaces a 10 to 30% reduction in fatigue strength occurred due to these coatings. On peened and pickled surfaces of AZ91 the anodic coatings were deleterious with significant reduction (35 to 40%) seen with the thick anodic coatings. On pickled only AZ91 material the HAE coating showed slight benefits (5 to 10%) and the DOW 17 coating showed slight degradation (5 to 10%). None of the anodic coatings proved consistently best, although for the unpeened condition the HAE coatings yielded better results. Also, except for the AZ91 peened surfaces, there was no significant difference between the thick and thin coatings. AZ91 peened surfaces with thin anodic coatings were 25 to 30% better than with thick coatings whereas a difference of only 5 to 10% occurred with the ZE41 and EZ33 alloys. This, in spite of the fact that the difference in coating thickness between the heavy and

light applications was apparently much less for the AZ91 than for the other two alloys (see Table VI). In the unpeened conditions very little difference between heavy and light coatings occurred and in several cases the heavy coating showed better results.

Conditions M24 and M25 provided direct evaluation of the effects of the HAE anodic coatings applied directly to untreated substrate magnesium surfaces - thus avoiding the complications due to peening or pickling. A marked increase in fatigue strength of 10 to 30% resulted for the ZE41 and AZ91 alloys compared to the bare controls (M1) while the fatigue strength of E233 remained approximately unchanged with these coatings.

Except for the epoxy seal system (M21) the organic coatings (M19 - M23) had no discernible effect on the already peened, pickled, and HAE heavy coated surfaces (M15) of AZ91 alloy. The epoxy seal topcoat system indicated a beneficial effect. Several of the organic coated specimens showed degradation in the coating after testing at high stress levels. Degradation occurred only at the higher test strains - 3000  $\mu$  or greater. The M19 topcoat showed a coarsening effect which was severe at 25 ksi (172 MPa) but an integral coating was still maintained. Two M20 specimens had several coating cracks near the fracture after testing at 20 ksi (138 MPa) and 25 ksi (172 MPa). One M21 test specimen showed some slight blistering of the coating in the center section after testing at 23 ksi (158 MPa). The M22 coating showed perhaps, the most severe degradation since, for two specimens tested at 20 ksi (138 MPa) and 23 ksi (158 MPa) stress, the coating actually peeled off near the fracture exposing the HAE anodic undercoating.

#### Sheet Flexure Tests of As-Cast Surfaces

Results of the sheet flexure fatigue tests are presented in figures 32 - 44 and are summarized in Table X. Typical failures for the small and large sized specimens and representative fracture surfaces are shown in figures 45 - 48, respectively. Each S-N figure shows all the valid data points achieved for one test condition (test condition as per Table VII). Paired stress - cyclic life curves were drawn through the data points and the fatigue strength estimated for each alloy and test condition. For all conditions of both alloys (AZ91 and ZE41) the complete S-N response curve is defined by two straight lines intersecting at the fatigue limit stress of the alloy for the particular test condition. The slope of the upper straight line portion of these curves for both alloys and all test conditions was  $11.2 \pm 2.2$  ksi/log cyclic life ( $77.4 \pm 15.1$  MPa/log cyclic life). In every case the ZE41 alloy fatigue life was greater than that for AZ91.

The same considerations for data scatter described for the R. R. Moore tests also hold true for the sheet flexure fatigue tests. Additionally, the existence of the as-cast surface increases the potential of scatter associated with the determination of the sheet flexure fatigue strength. This is due to the lack of control on specimen surface finish - the as-cast surface from the manufacturer being the test surface, and also the random occurrence of casting flaws of various severity at or near the surface. Both of these factors were not present with the R. R. Moore machined specimen tests but are representative of the material as it is actually used in the housings. Examples of these flaws are seen in figures 47 and 48. All flaws were in the form of voids or pores at or near the surface.


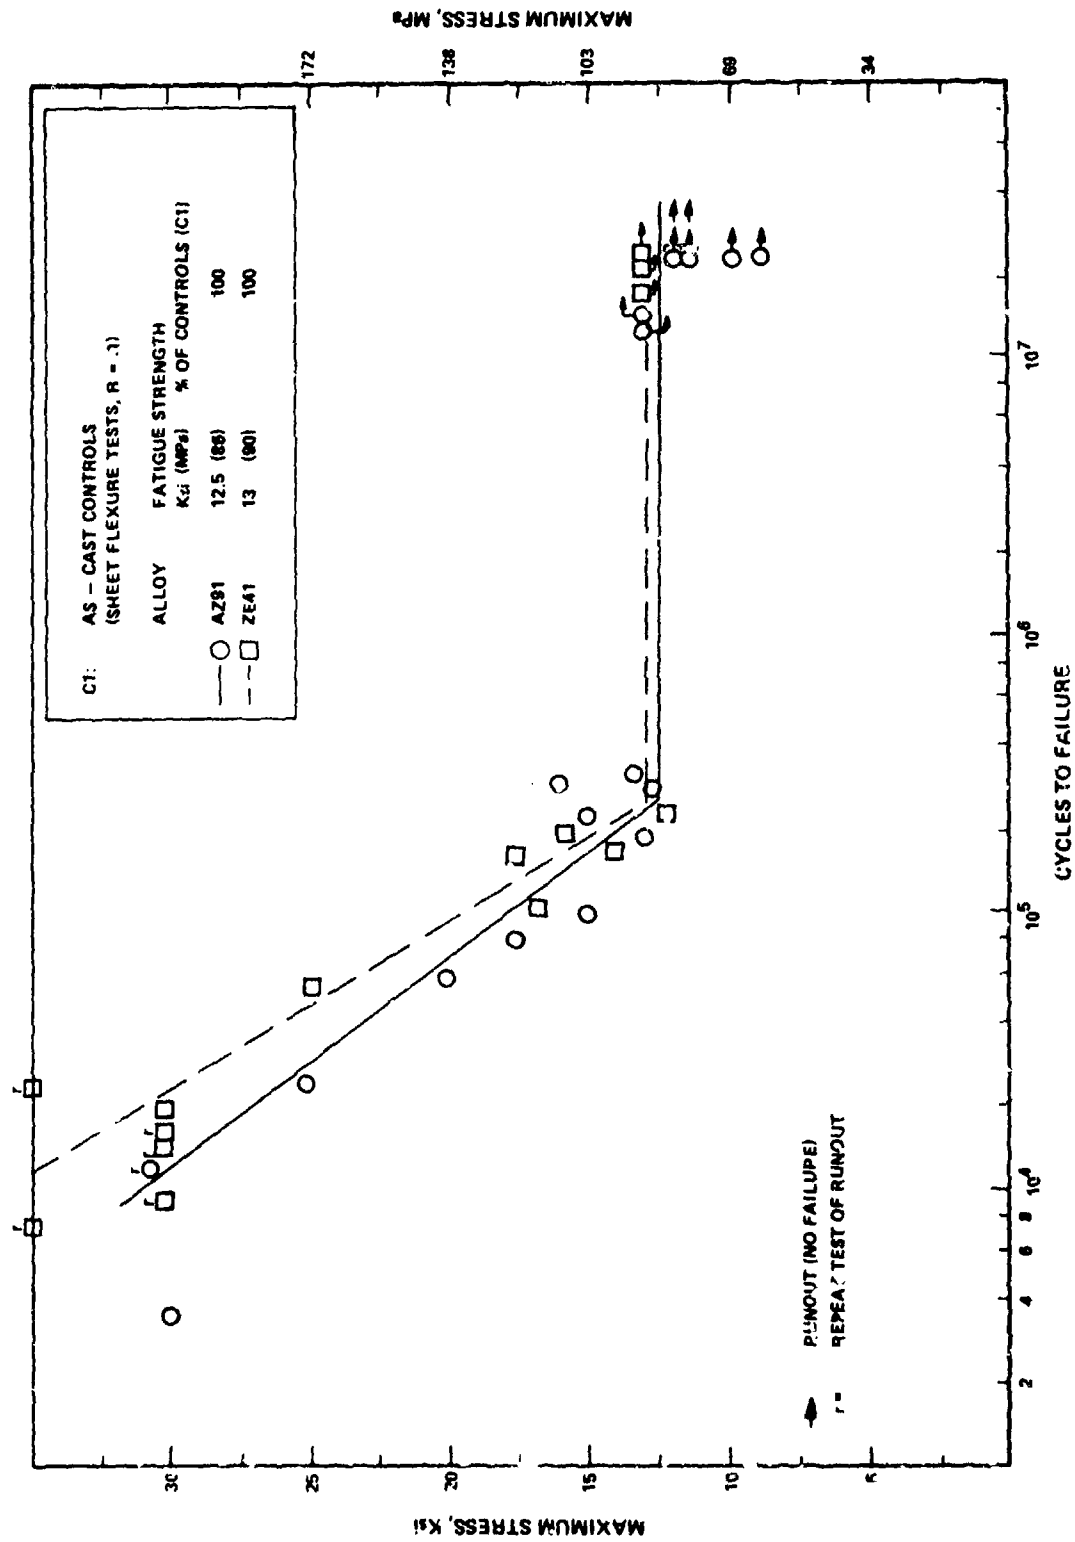


Figure 32 - Sheet Flexure Fatigue Test S-N Curves

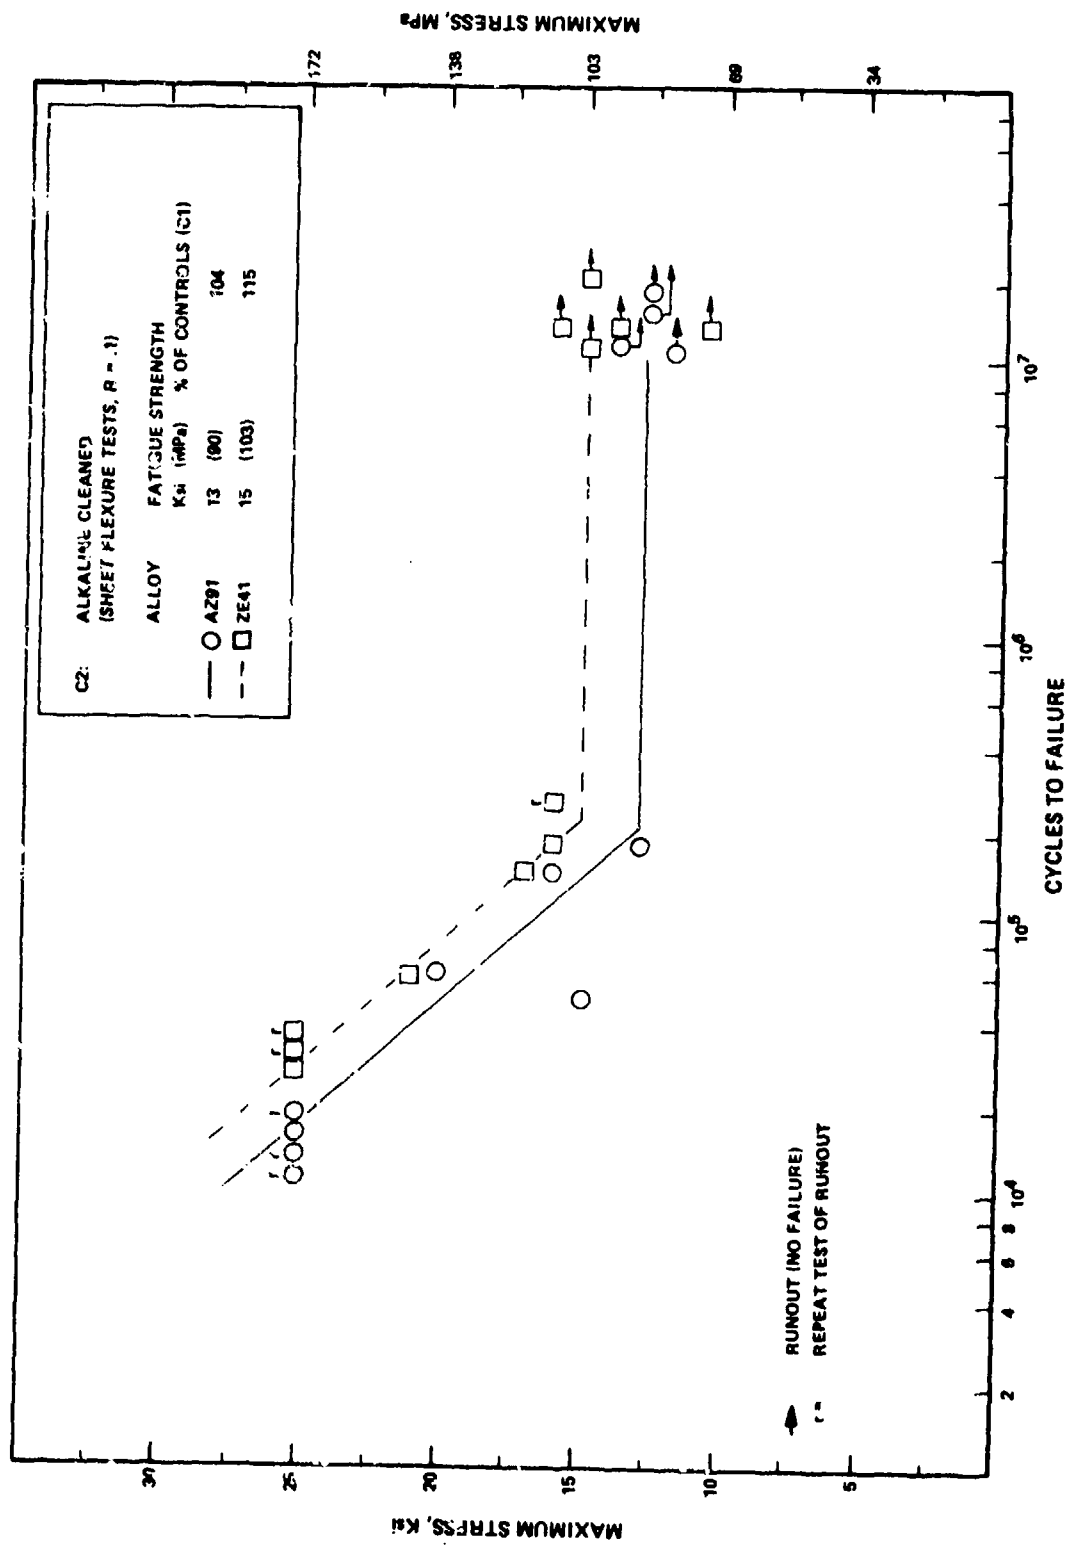

**Figure 33 - Sheet Flexure Fatigue Test S-N Curves**

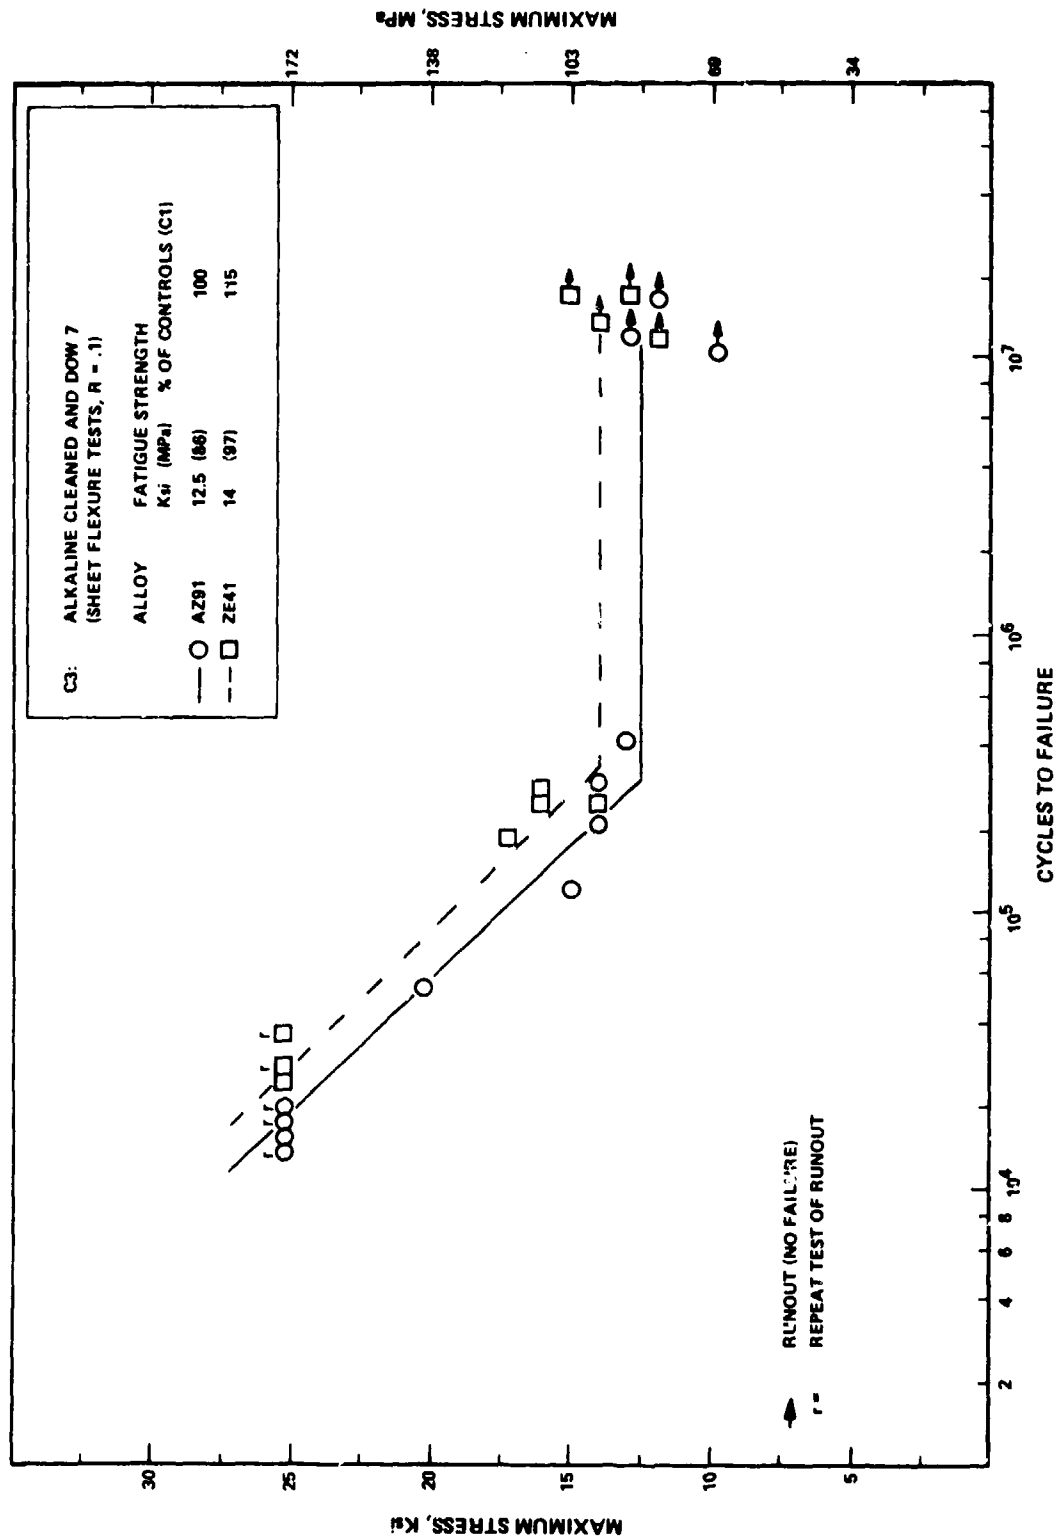


Figure 34 - Sheet Flexure Fatigue Test S-N Curves

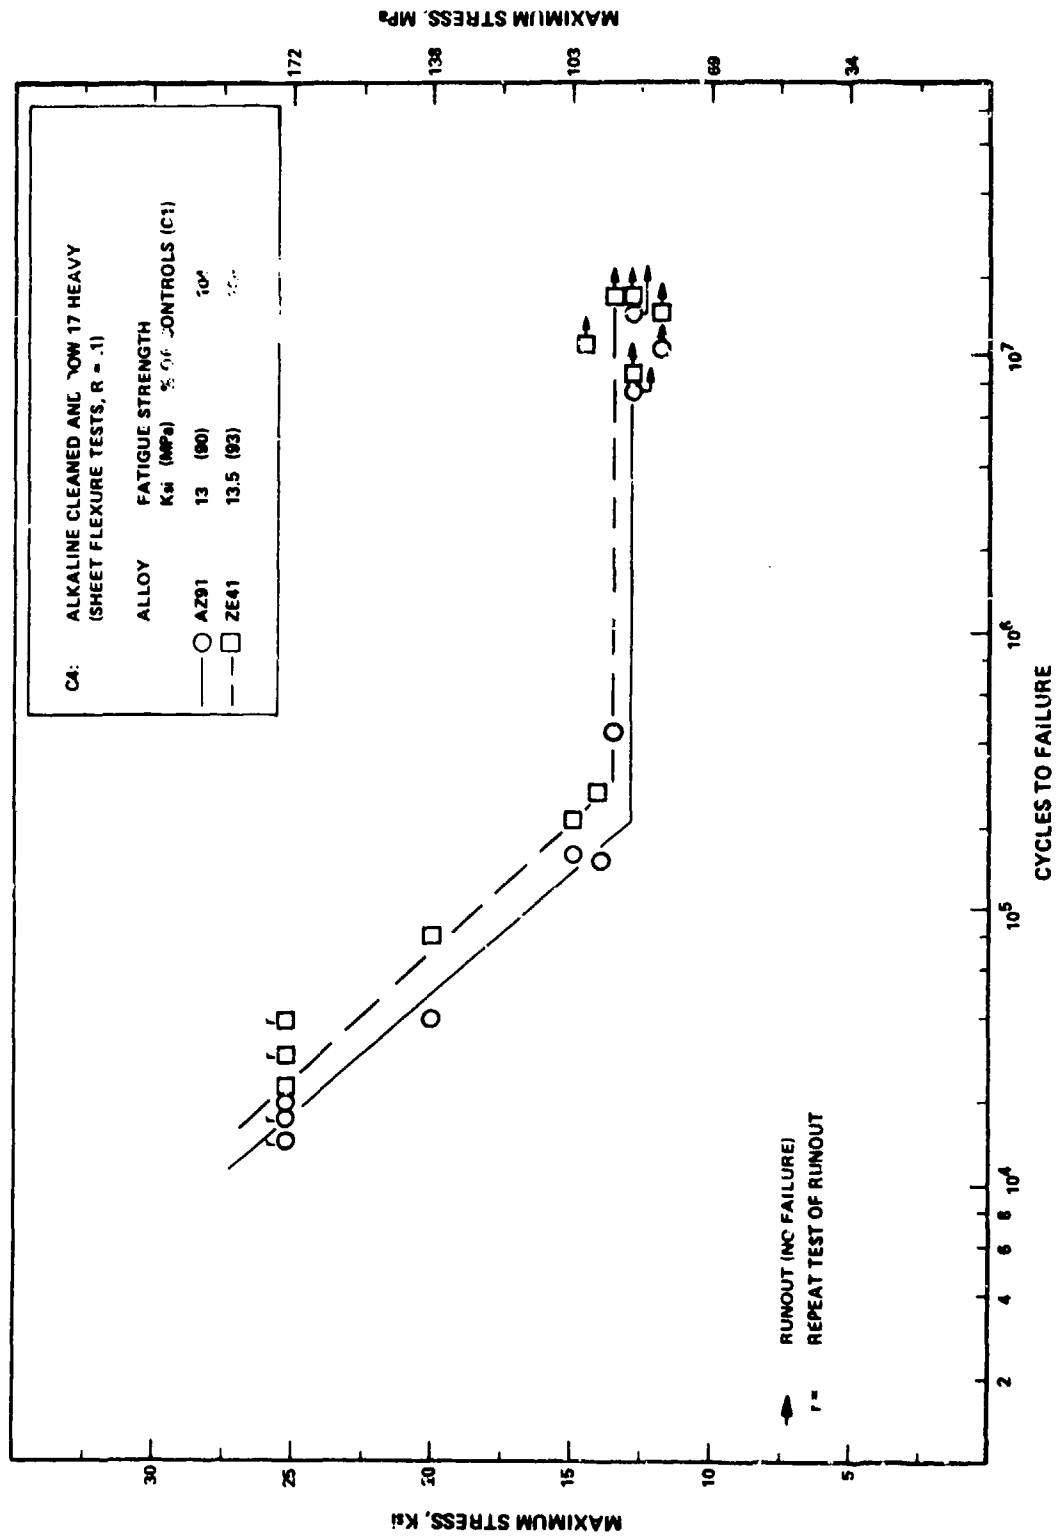


Figure 35 - Sheet Flexure Fatigue Test S-N Curves



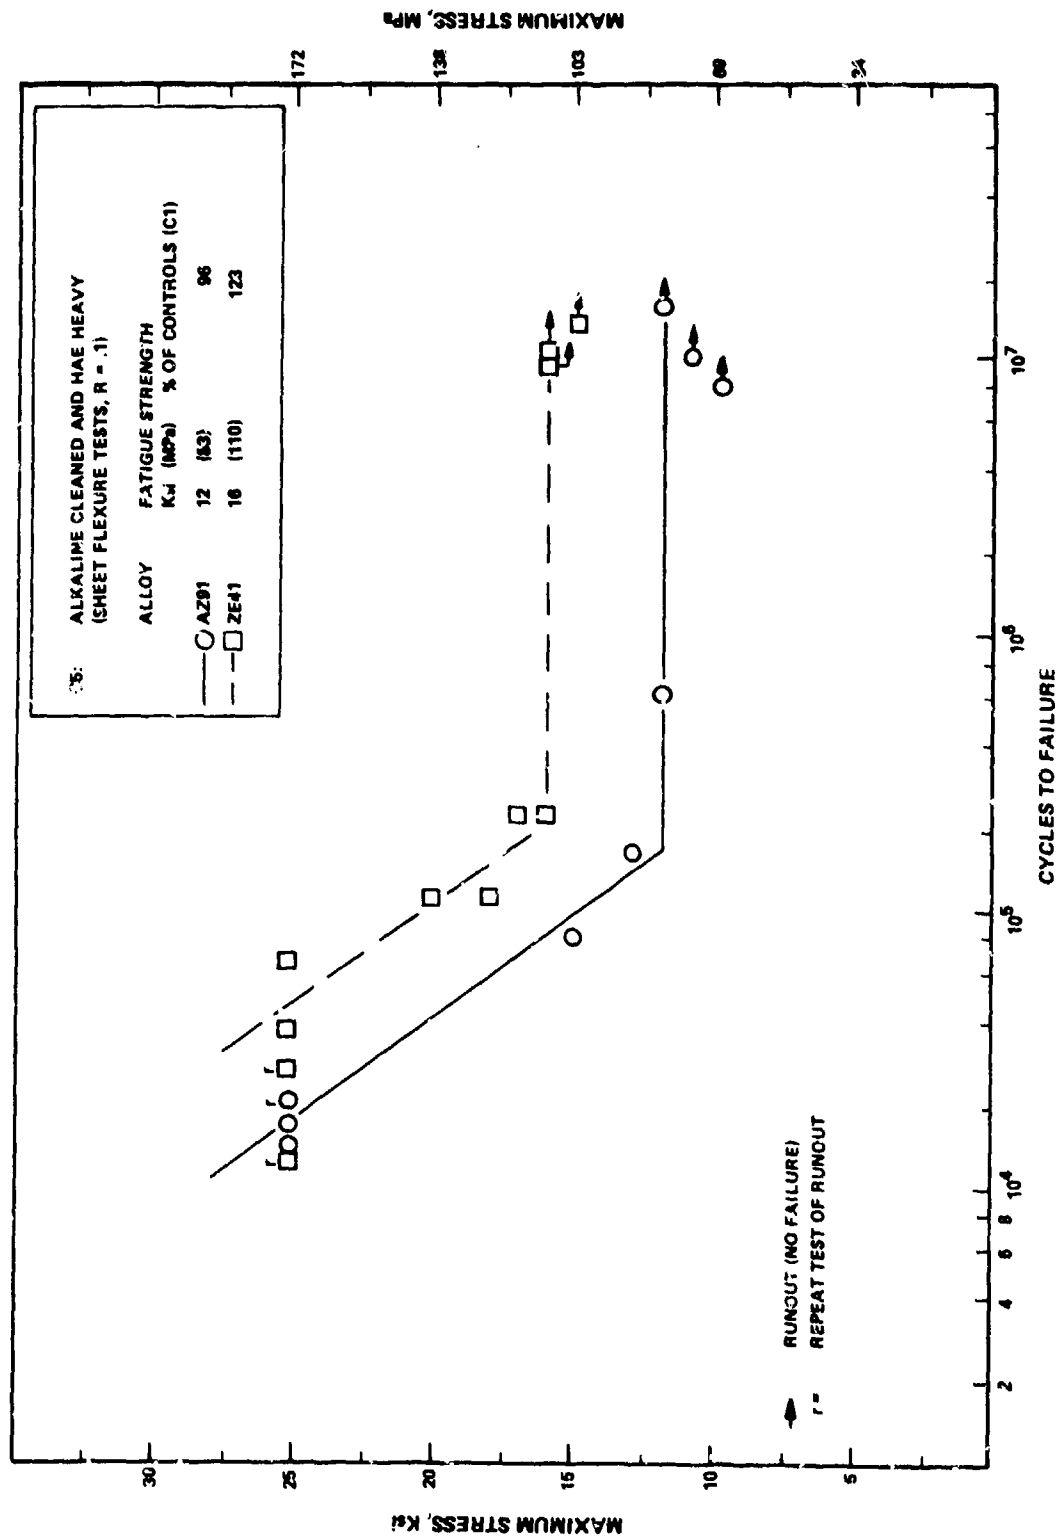



Figure 36 - Sheet Flexure Fatigue Test S-N Curves



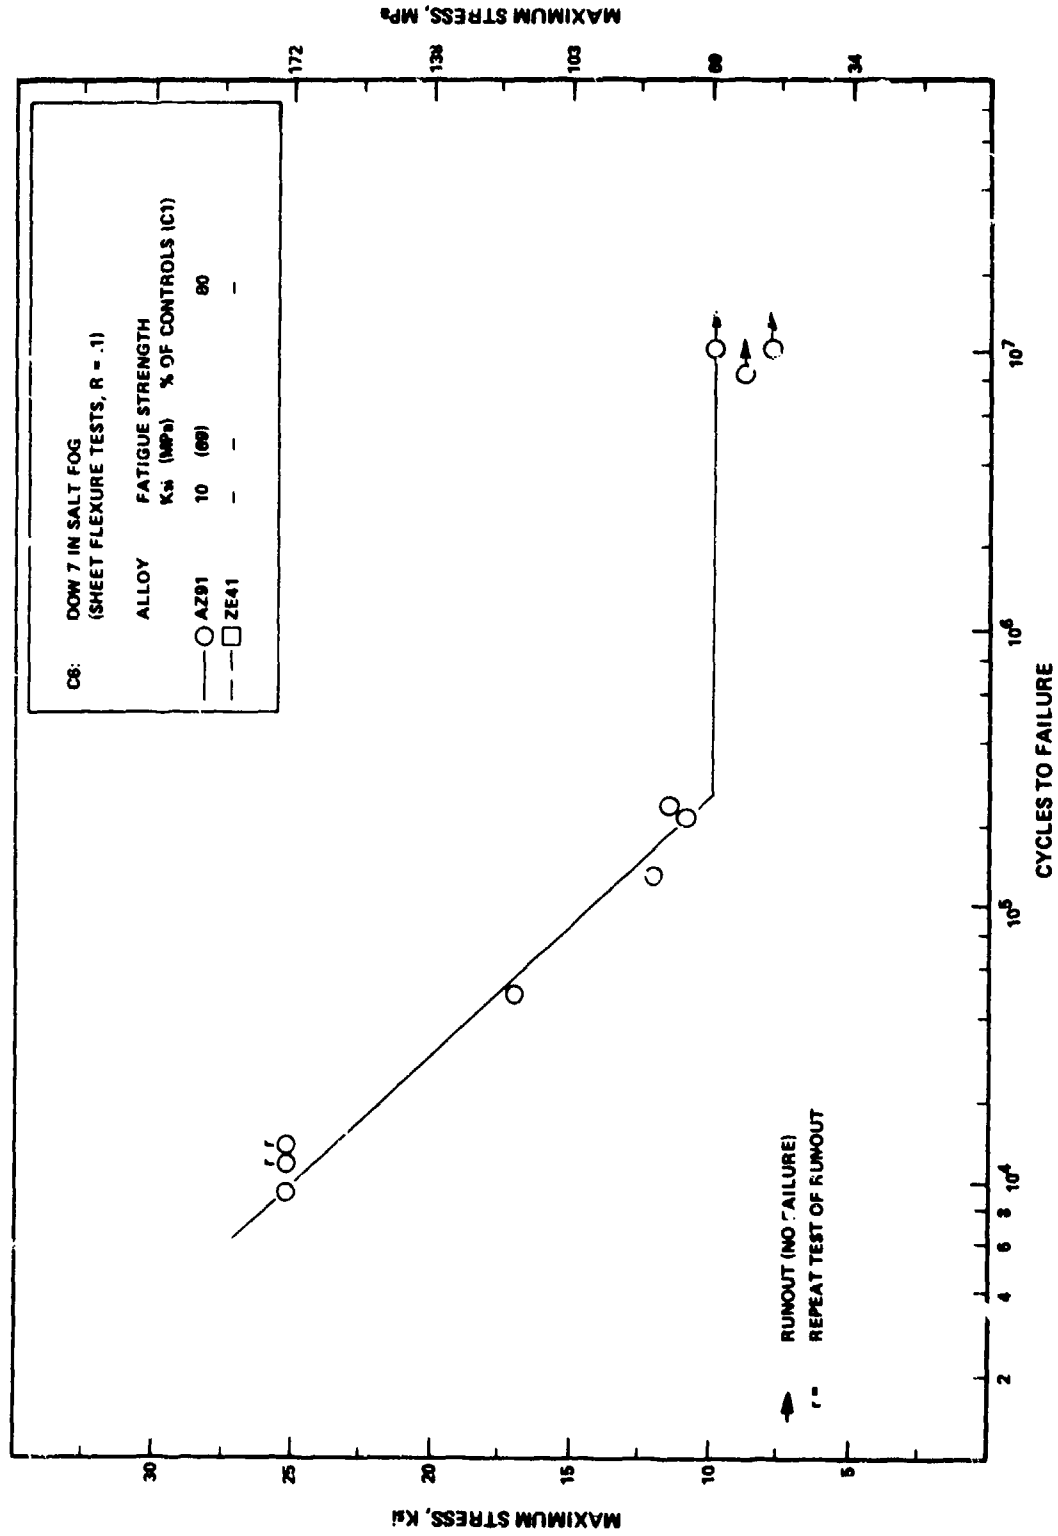

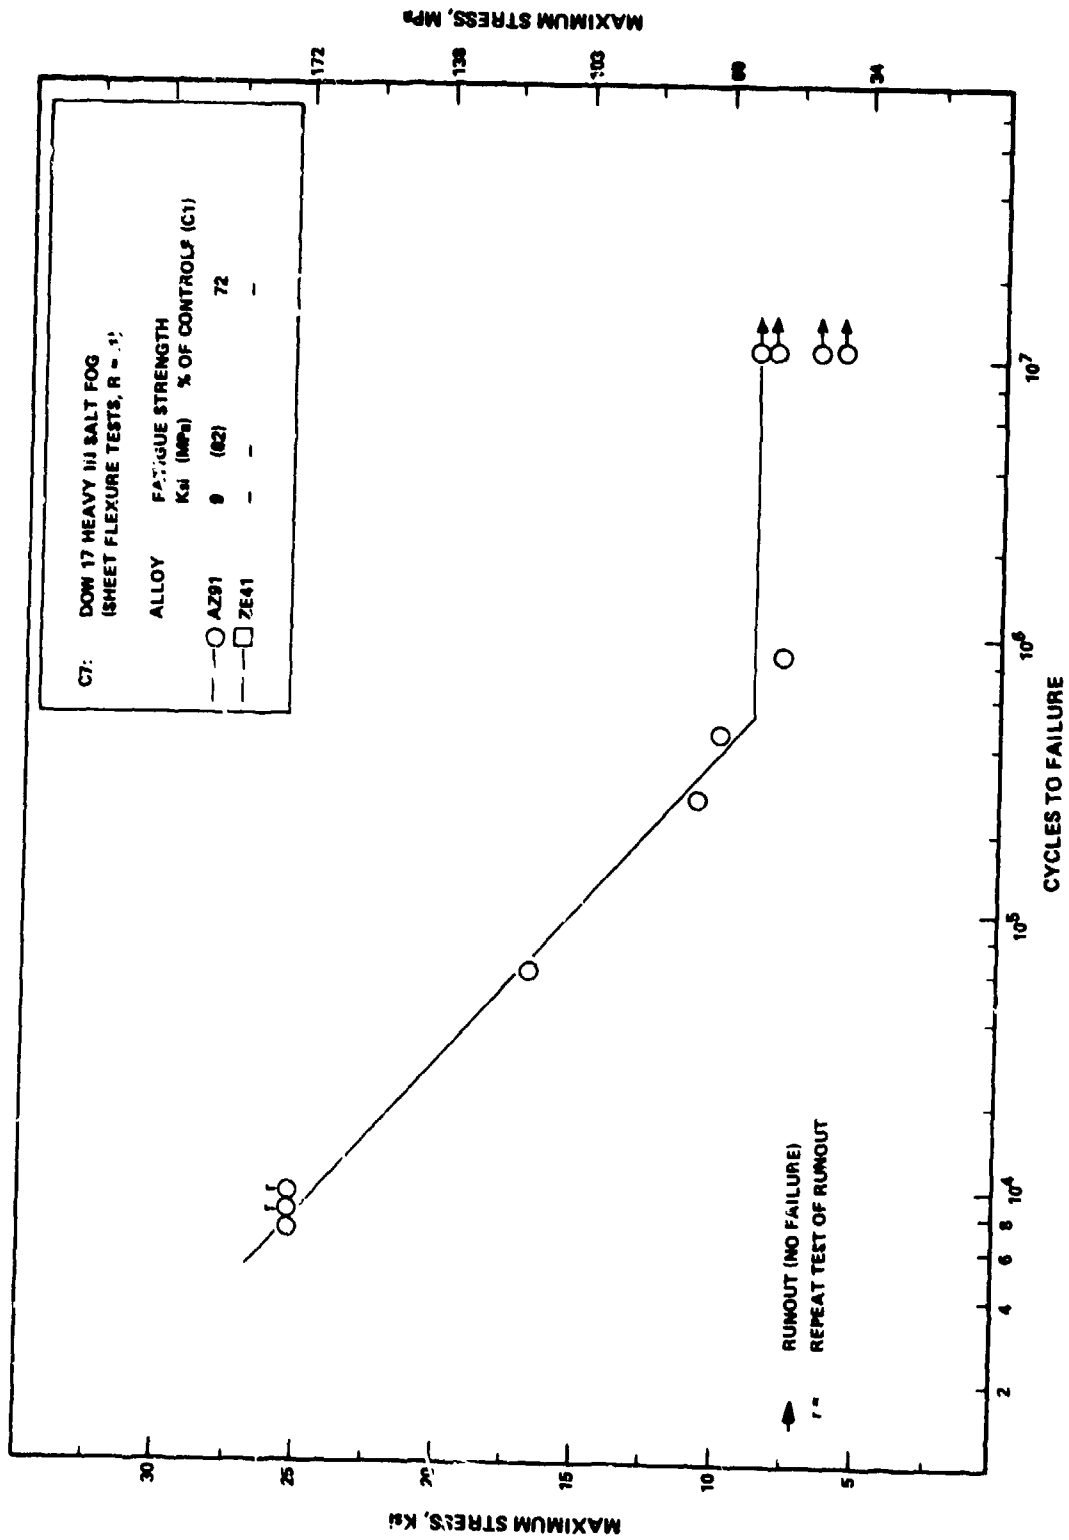

**Figure 38 - Sheet Flexure Fatigue Test S-N Curves**



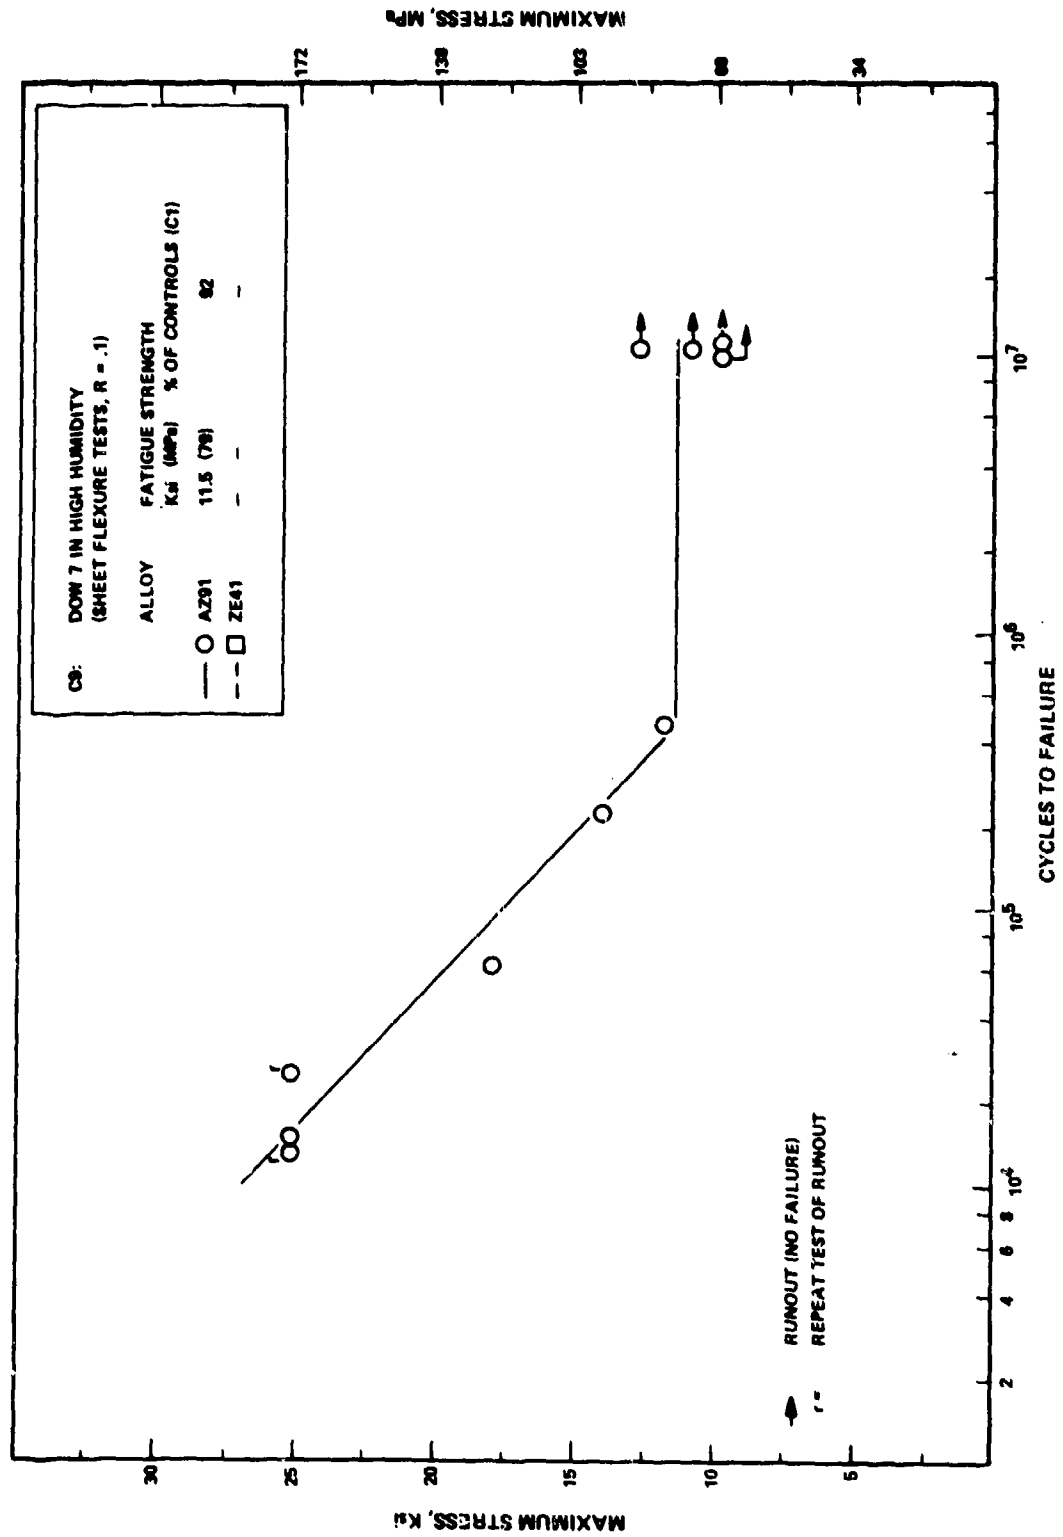


Figure 40 - Sheet Flexure Fatigue Test S-N Curves

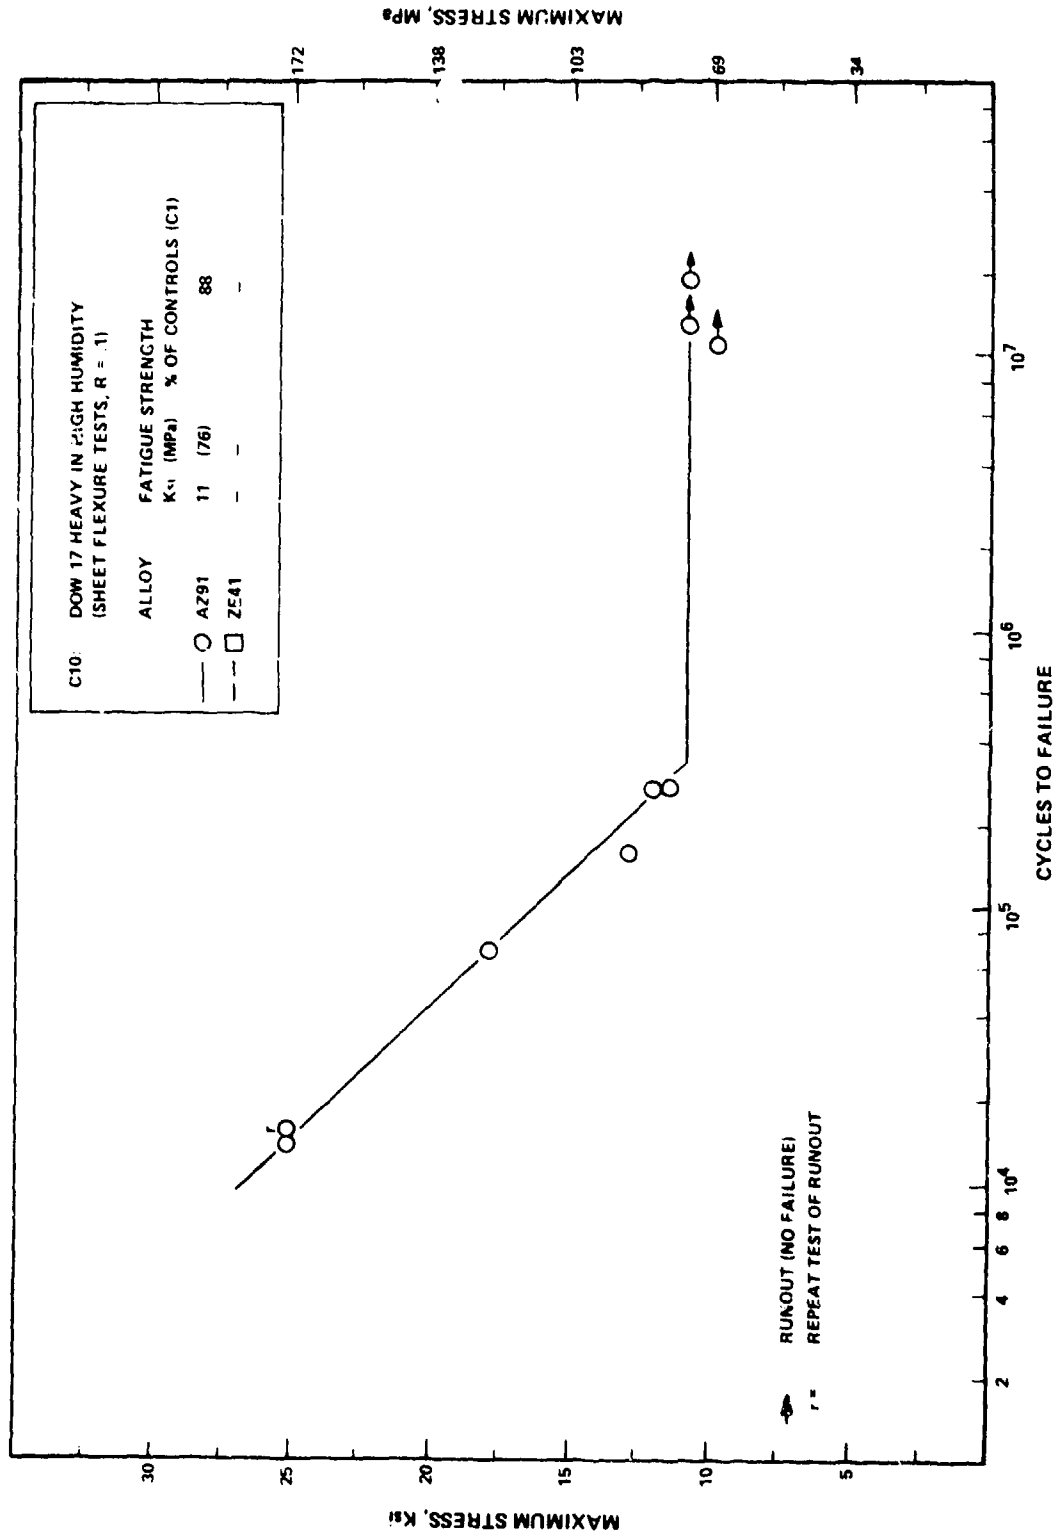


Figure 41 - Sheet Flexure Fatigue Test S-N Curves

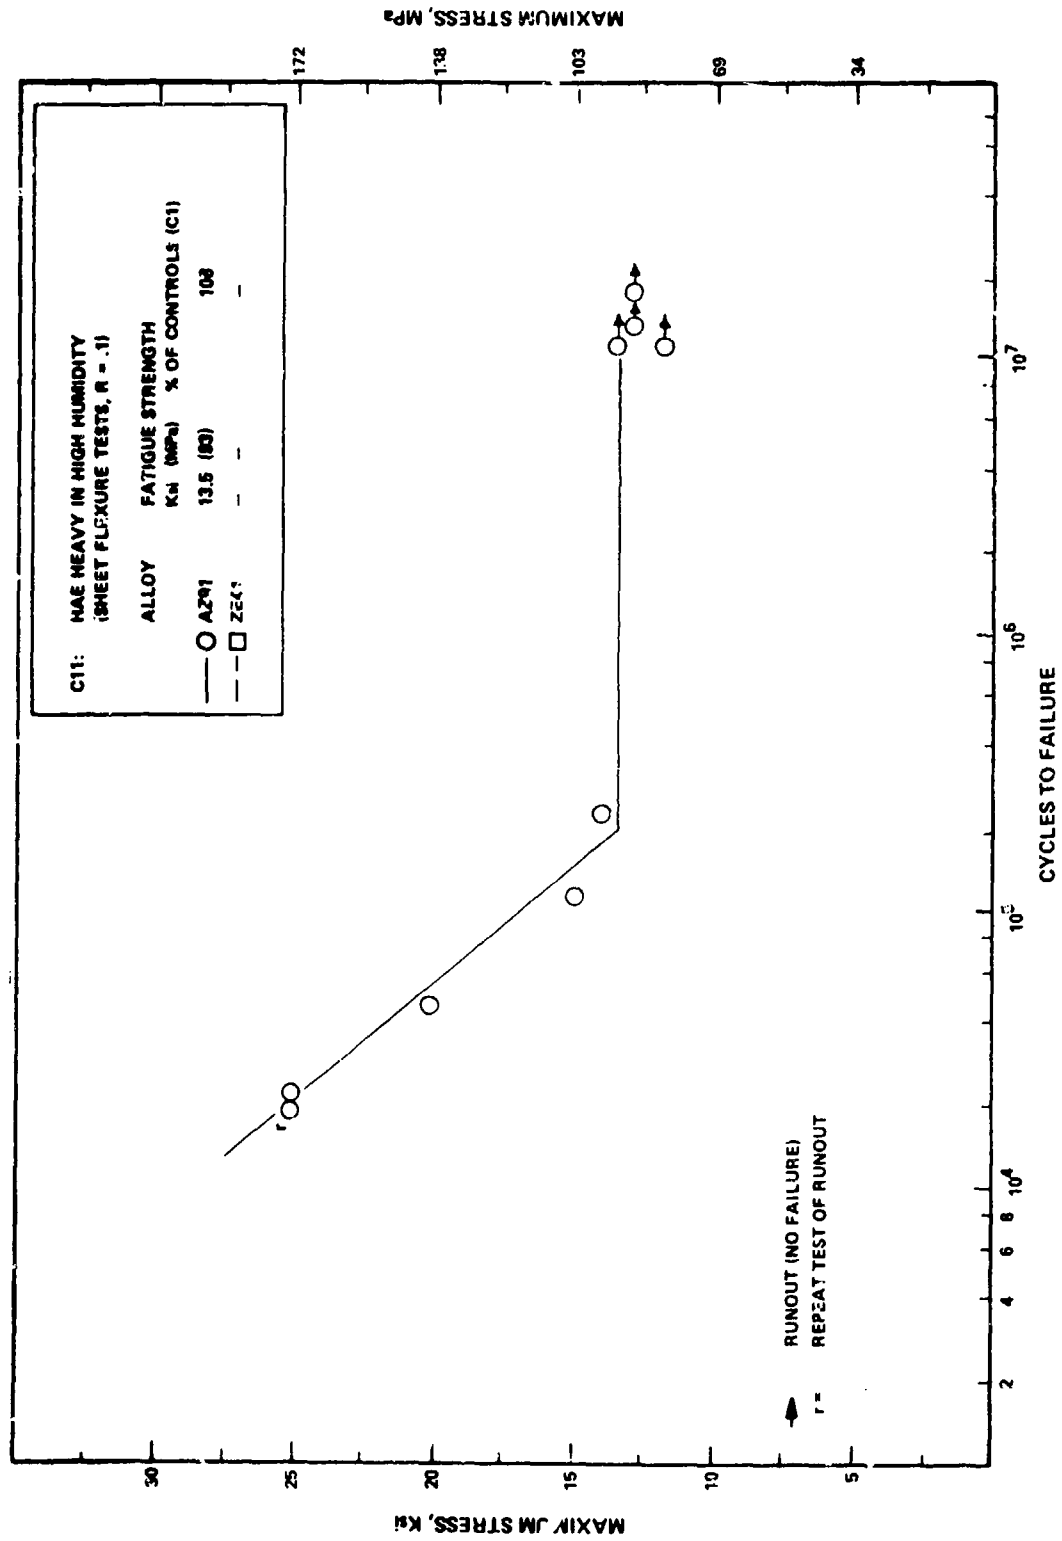



Figure 42 - Sheet Flexure Fatigue Test S-N Curves



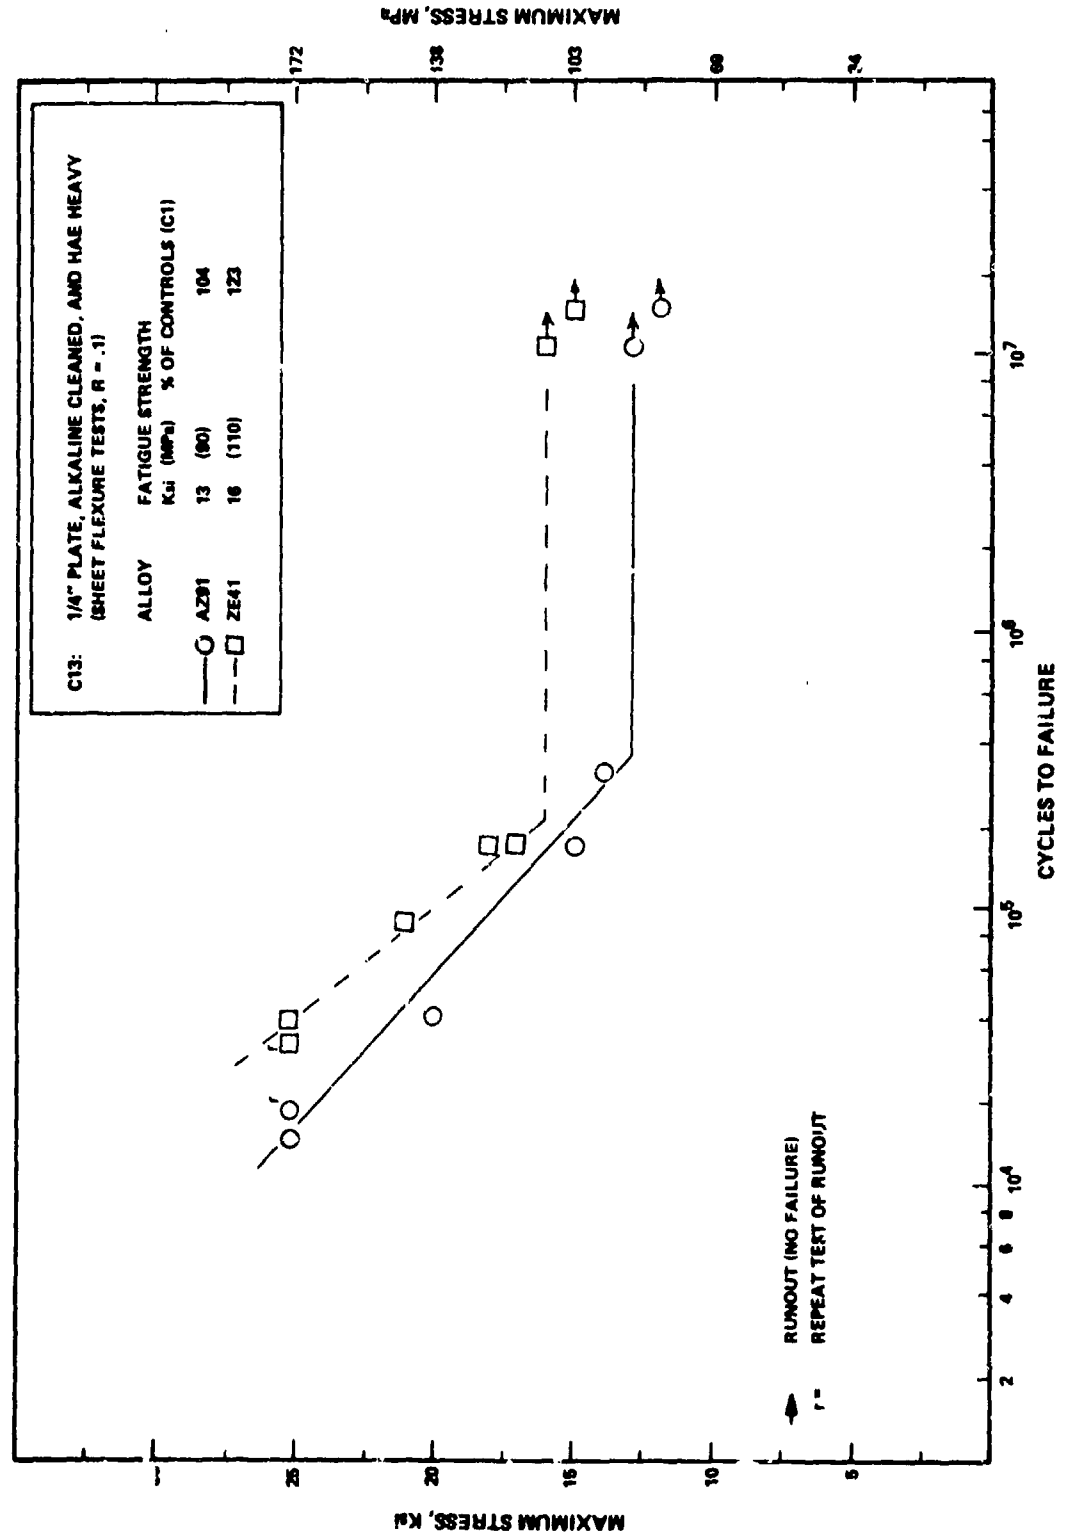


Figure 44 - Sheet Flexure Fatigue Test S-N Curves

Table X  
Summary of Sheet Flexure Fatigue Test Results

Condition, C	1	2	3	4	5	6	7	8	9	10	11	12	13
Fatigue Strength													
AZ91 (ksi)	12.5	13	12.5	13	12	10	9	11.5	11.5	11	13.5	12	13
(MPa)	(86)	(90)	(86)	(90)	(83)	(69)	(62)	(79)	(79)	(76)	(93)	(83)	(90)
ZE41 (ksi)	13	15	14	13.5	16	--	--	--	--	--	--	13	16
(MPa)	(90)	(103)	(97)	(93)	(110)							(90)	(110)
% of Controls (C1)													
AZ91	100	104	100	104	96	80	72	92	92	88	106	96	104
ZE41	100	115	115	104	123	--	--	--	--	--	--	100	123
Condition	1	2	3	4	5	6	7	8	9	10	11	12	13
As-Cast Controls	Alkaline Cleaned	Alk. Cleaned & DOW 7	Alk. Cleaned & HAE Heavy	DOW 7 in Salt Fog	DOW 17 Heavy in Salt Fog	HAE Heavy in Salt Fog	DOW 7 in High Humidity	DOW 17 Heavy in High Humidity	HAE Heavy in High Humidity	1/4" plate, Alk. Cleaned & DOW 17 Heavy	1/4" plate, Alk. Cleaned & HAE Heavy		



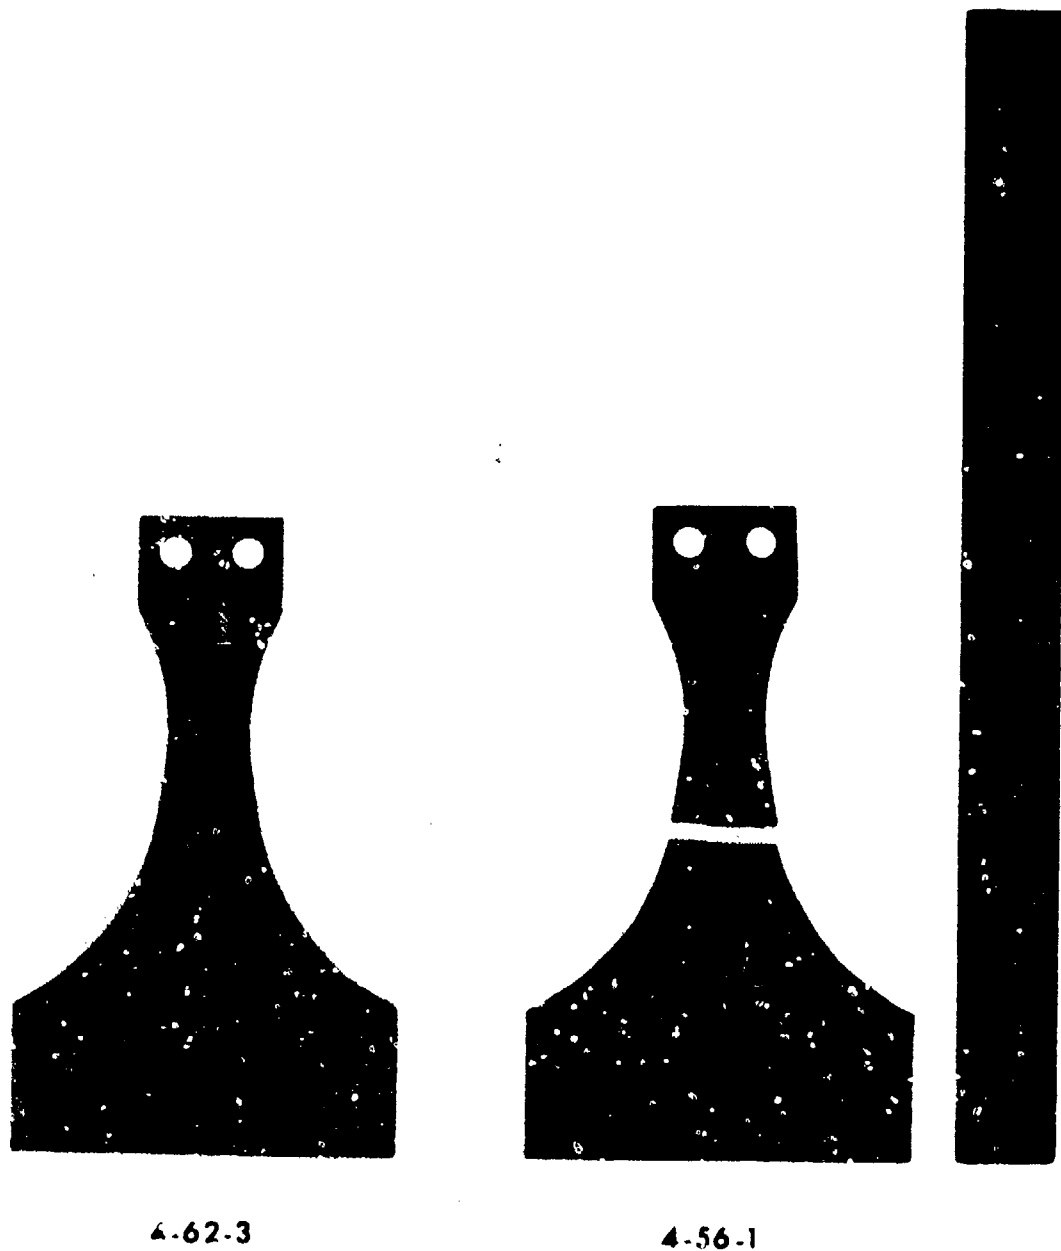



Figure 45 - Typical 1/8-In. (3.2mm) Thick Sheet Flexure Fatigue Test Specimen and Representative Failure. Specimens are ZE41 Alloy, HAF Heavy Anodic Coated (C5).



Figure 46 - Typical 1/4-In. (6.4mm) Thick Sheet Flexure Fatigue Test Specimen and Representative Failure. Specimens are AZ91 Alloy, HAF Heavy Coated (C13).



Figure 47 - Representative Fractures of 1/8-In. (3.2mm) Thick Sheet Flexure Fatigue Test Specimens With and Without Fracture Initiation at Surface Casting Flaws; All Three Specimens Failed After About 200,000 Cycles.

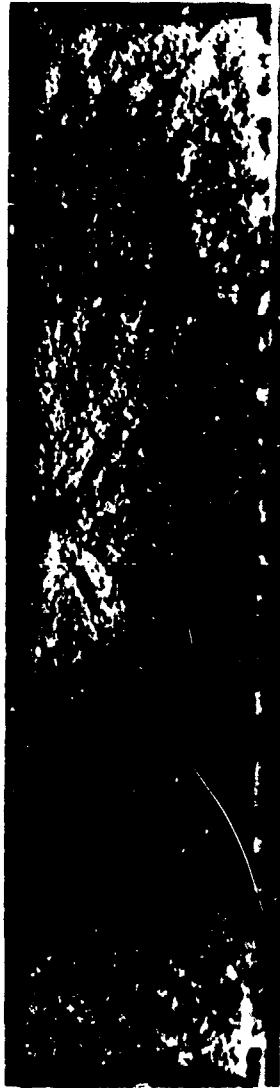

4-35-2 (UNCOATED)



9-19-1 (HAE)

Figure 48 - Representative Fractures of 1/4-In. (6.4mm) Thick Sheet Flexure Fatigue Test Specimens With and Without Fracture Initiation at Surface Casting Flaws.

For the AZ91 alloy, the treated specimens (C2 through C5) showed no discernible effect on fatigue strength compared to the bare control set (C1) ( $\pm 5\%$ ). For the ZE41 alloy, fatigue strength was increased 5 to 25% by the alkaline cleaning and coatings (C2 through C5). The effects of salt fog and high humidity exposure on the fatigue strength of coated AZ91 alloy are shown by the data of tests C6 through C8 and C9 through C11, respectively. Both environments are detrimental - the salt fog exposure significantly so (10 to 30% reduction). The high humidity exposure provided only slight (10%) reduction except with the HAE heavy anodic coating where a 10% improvement actually occurred. Typical surface corrosive damage resulting from these exposures is shown in figures 49 - 52, which also show unexposed specimens for comparison. Figures 53 - 56 present the fracture surfaces of the specimens of figures 49 - 52 showing the surface corrosion and pitting damage - which in some cases caused multiple crack initiation sites.

The large sized, 1/4-in. (6.4 mm) thick, plate specimen data for both AZ91 and ZE41 alloys with heavy HAE and DOW 17 anodic coatings show results consistent with those obtained on the small flexure specimens in regard to fatigue strength and relative worth of the coatings.

## DISCUSSION


### Pretreatments

The significant effects of acid pickling and shot peening on substrate magnesium fatigue are clearly shown by the R.R. Moore specimen results. Table XI shows the major influence of these processes: all pickled (unpeened) conditions showed reduced fatigue strength (all changes are "minus") while the peened conditions generally showed increased fatigue strength (most changes are "plus"), irrespective of the follow-up processing or coatings applied. Thus, the dominant influence of pickling and peening compared to the other treatments and coatings seems obvious.


The very deleterious effect of acid pickling on ferrous substrate materials is described and documented by Harris, reference (8), and is attributed primarily to surface roughening - even when no intercrystalline corrosion attack occurs. Surface roughness, as measured in rms, is increased many fold - but also, the nature of the surface roughening, i.e., sharp notches, is very severe. Similar effects are seen to occur with aluminum alloys. Eggwertz and Jarfall, reference (9), describe considerable reduction in the fatigue strength of 7079 aluminum alloy bar stock due to pickling - with or without a following anodic treatment. Both studies cite the time and temperature of pickling as the controlling factors on the magnitude of the subsequent effect on substrate fatigue. Because of these effects, and their dependence on process details, pickling is also seen as possibly providing a significant influence on the variation observed in the R.R. Moore screening test results.

The general benefits of shot peening on metallic substrate fatigue properties are well documented, reference (3); while the beneficial effects in regard to coated ferrous and titanium substrates are described by Jankowsky, et al.,


NADC-77140-30

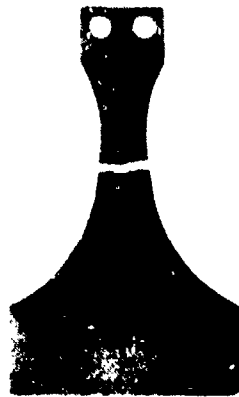


9-17-4

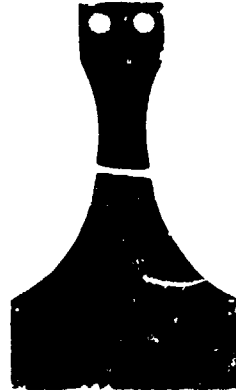


9-16-2

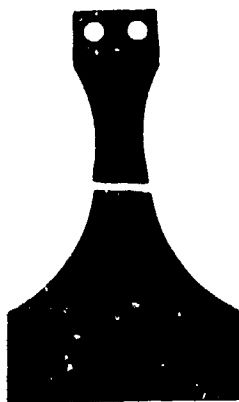

9-25-3

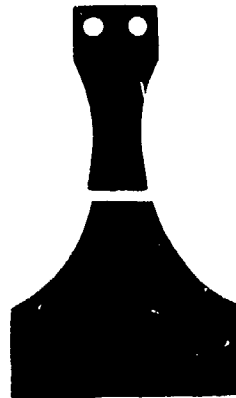

9-19-3

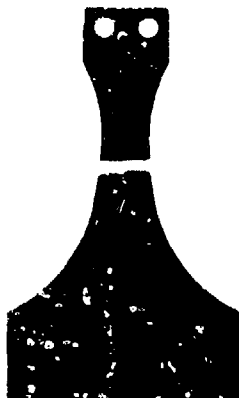


9-6-3




9-1-2


Figure 49 - Exposed (Right) and Unexposed (Left) Specimens With HAE (C11), DOW 7 (C9), and DOW 17 (C10) Coatings (Top to Bottom) Showing Very Little Surface Corrosion After 7 Days in High Humidity Environment.

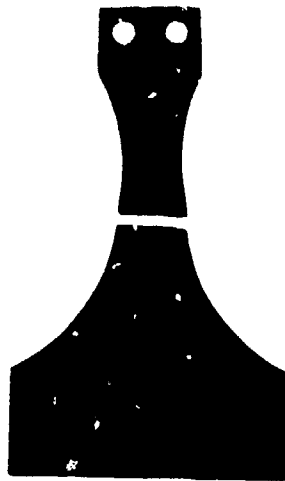

9-25-3 (C3)

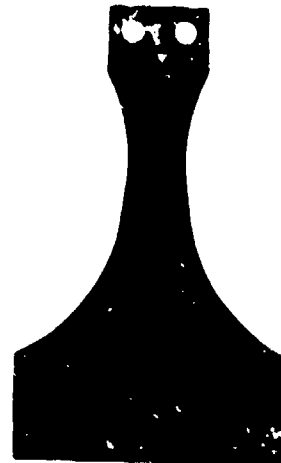

9-23-1

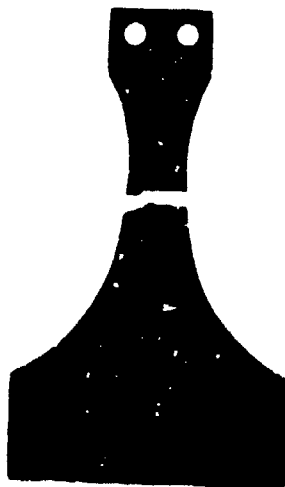


9-16-3




9-9-3

Figure 50 - Exposed and Unexposed (Upper Left Only) Specimens With DOW 7 Coating (C6) Showing Light to Heavy Range of Surface Corrosion Typical After 7 Days in 5% Salt Fog Environment.

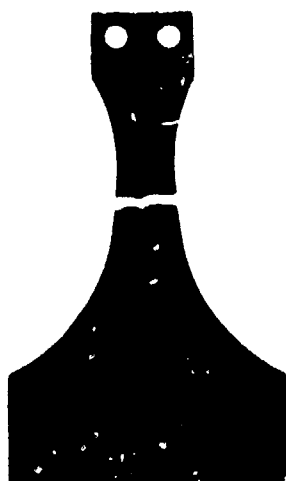

9-6-3 (C4)

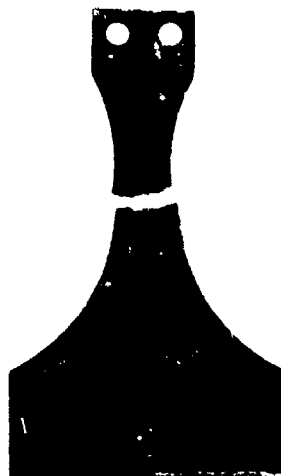

9-19-4




9-17-2




9-10-2

Figure 51 - Exposed and Unexposed (Upper Left Only) Specimens With DOW 17 Heavy Anodic Coating (C7) Showing Light to Heavy Range of Surface Corrosion Typical After 7 Days in 5% Salt Fog Environment.




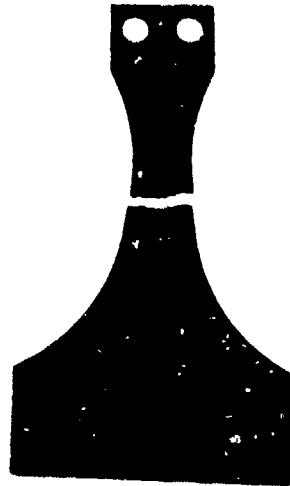

9-12-4 (C5)

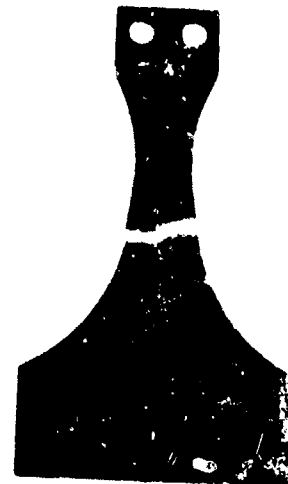

9-20-1

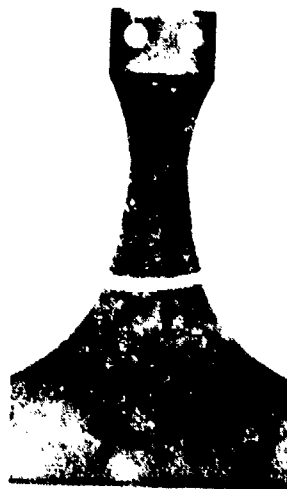

9-13-2



7-14-1

Figure 52 - Exposed and Unexposed (Upper Left Only) Specimens With HAE Heavy Anodic Coating (C8) Showing Light to Moderate Range of Surface Corrosion Typical After 7 Days in 5% Salt Fog Environment.



Figure 53 - Fracture Surfaces of the High Humidity Exposure Specimens of Figure 49, With HAE,  
DOW 17, and DOW 7 Coatings (Top to Bottom).

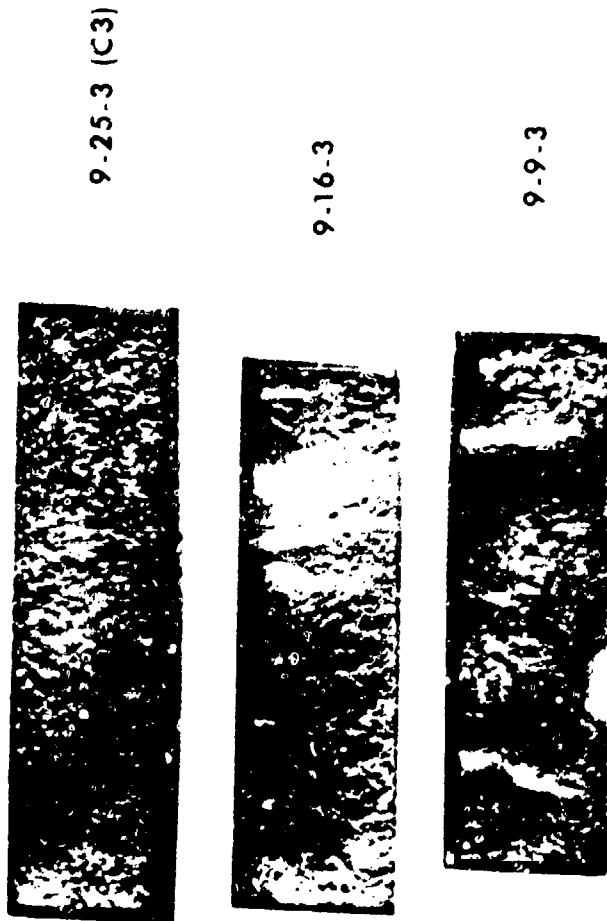


Figure 54 - Fracture Surfaces of the Salt Fog Exposure Specimens of Figure 50, With DOW 7 Coating.

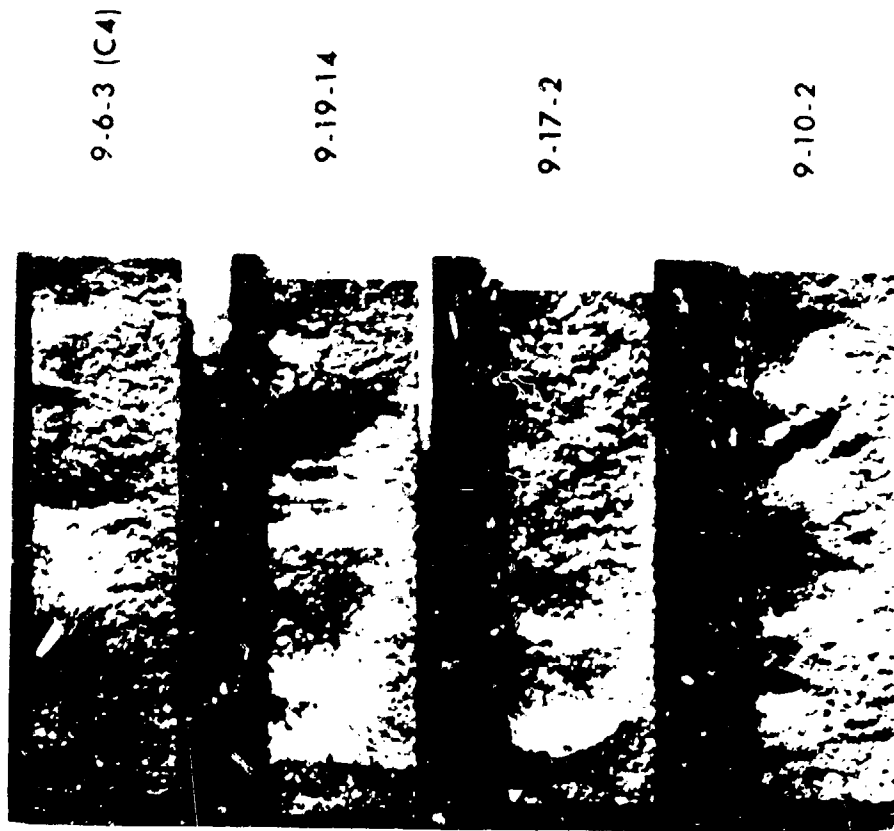


Figure 55 - Fracture Surfaces of the Salt Fog Exposure Specimens of Figure 51, With DOW 17 Coating.

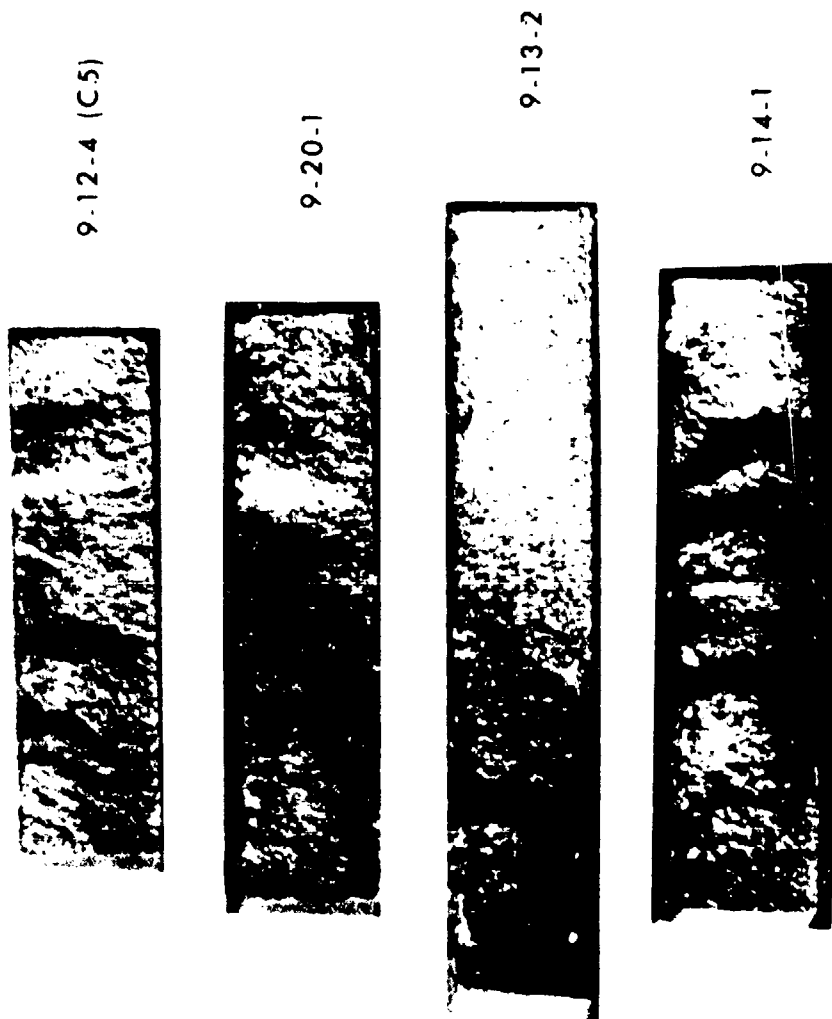


Figure 56 - Fracture Surfaces of the Salt Fog Exposure Specimens of Figure 52, With HAF Coating.

Table XI

Influence of Surface Preparations and Coatings  
on Fatigue Strength of Magnesium Rotating Beam Specimens

Test Specimen Group	% Change from Controls* (M1)		
	AZ-91	ZE-41	EZ-33
As Polished - Control Set	0	0	0
Pickled - only	-20%	-15%	-5%
- Impregnated	-10	-15	-10
- Chromate Coated	-15 to 20	0	-20 to 25
- Anodic Coated - Thin	-10 to 35	-5 to 10	-20 to 35
- Anodic Coated - Thick	-15 to 25	-0 to 10	-20
Peened - only	+25	+25	+35
Peened & Pickled - only	+30	+10	+35
- Impregnated	+20	+20	+10
- Chromate Coated	+10 to 20	+10 to 25	+35
- Anodic Coated - Thin	+20	+0 to 25	+35
- Anodic Coated - Thick	-5 to 10	+15	+25 to 30
- HAE Thick with Topcoats	-10 to +15	---	---
As Polished & HAE Thin or Thick Coated	+15	+10 to 30	-5 to +5

\* % increase (+) or decrease (-) in fatigue strength at  $20 \times 10^6$  cycles

reference (4). The literature on shot peening of magnesium is very limited but beneficial effects are also shown to occur provided the peening is done properly, reference (5). Benefits from glass bead peening of wrought magnesium are described in reference (2).

### Coatings

It is apparent from the R.R. Moore screening test data that the coatings are generally subordinate to peening and pickling in their influence on the magnesium substrate material fatigue properties. The effects of the coatings, therefore, were not as clearly defined - especially when the previously mentioned scatter factors are considered. Thus, in the screening tests, no coating performed significantly or consistently best, although the HAE coating appeared to have generally better performance. In the sheet flexure fatigue tests on as-cast surfaces, however, the HAE coating more clearly demonstrated better performance over the DOW 17 and DOW 7 coatings - including excellent resistance to the corrosive environments. This is shown in table XII.

Surprisingly, the anodic coatings were not necessarily deleterious to the fatigue strength of these magnesium alloys. Because of the potential surface etching effect and residual tensile stresses and porosity in the as-applied coating itself, these coatings have been considered to be deleterious to substrate fatigue properties. In general, hard surface coatings and electrodeposited metals have a deleterious effect on structural materials fatigue properties, references (4) and (8).

Limited previous fatigue studies dealing with anodic coatings on magnesium also indicated a deleterious effect, references (1) and (2), but did not evaluate the effects of pickling or differentiate between the separate effects of the pickling and the anodic coatings. In this present study, pickling is seen to be the major detriment in the standard application of the anodic coatings with a superimposed separate, lesser effect of the anodic coatings apparently depending upon the substrate alloy and other preconditioning treatments (i.e., shot peening). In this regard, it is noteworthy that in the unpeened anodic and chromate coated R.R. Moore tests of ZE41 alloy very little or no degradation was observed in fatigue strength compared to the bare control set and there was actually improved strength compared to the pickled only data. Similar examples can be seen in some cases of the other alloys and with peened surfaces.

The potential for improvement in fatigue properties possible with the anodic coatings is shown directly by the results of test conditions M24 and M25 where no pickling or peening was utilized. In two alloys, ZE41 and AZ91, the coatings provided significant improvement over bare surfaces. Applied to the EZ33 alloy surfaces, the coatings had no deleterious effect. Perhaps part of this beneficial effect can be attributed to the load carrying ability of the coating in this application since the magnesium substrate strength does not represent a significant mismatch with the coating (that is, the strength of the substrate and coating are comparable) and this might also tend to minimize premature crack initiation in, or propagation from, the coating to the substrate. Protection from atmospheric corrosion also presents a real benefit.

Table XII

Influence of Anodic Coatings and Corrosive Exposure  
on the Fatigue Strength of Magnesium  
Sheet Flexure Specimens With As-Cast Surfaces

Test Specimen Group	% Change from Controls* (Cl)	
	AZ-91	ZE-41
As Cast - Controls	0	0
Alkaline Cleaned - only	+5	+15
- DOW 7 Coated	0	+10
- DOW 17 Thick Coated	+5	+5
- HAE Thick Coated	-5	+25
Salt Fog Exposure		
- DOW 7 Coated	-20	--
- DOW 17 Thick Coated	-30	--
- HAE Thick Coated	-10	--
High Humidity Exposure		
- DOW 7 Coated	-10	--
- DOW 17 Thick Coated	-10	--
- HAE Thick Coated	+10	--

\* % change increase (+) or decrease (-) in fatigue strength at  $10 \times 10^6$  cycles



The sheet flexure fatigue tests showed results similar to the R.R. Moore tests with respect to the coating effects - indicating no degradation due to the coatings and possibly some benefit. In this regard, less obvious coating effects would be expected in the sheet flexure tests because the pores and irregularities in the surface of a casting may be the dominating influence.

There is some inconsistency in the coatings data with respect to the relative worth of the various coatings, pre-treatments, coating thickness, etc. Possibly these inconsistencies might reflect variations in the basic coating process details and indicate the importance of these details to the acceptability of the deposited coating. The use of two R.R. Moore test specimen sizes, the subsequent need to process and test in two separate lots, variation in coating thicknesses apparently achieved (table VI), and large variations in surface corrosion damage achieved for each coating during salt fog exposures, all suggest that, even for the same coating, real differences in the processing existed. For aluminum alloys, the importance of the anodic coating process details to subsequent substrate fatigue properties has been reported by Eggwertz and Jarfall, reference (9), and Beitel, reference (10). They have shown that process details such as type of acid bath, bath temperature and voltage, and time of workpiece in the bath are important; and that subsequent substrate fatigue properties are not necessarily degraded - and can be significantly improved.

Thus, while the results of this study do not establish a clearly optimum coating system for these magnesium alloy castings, they do show the minor influence these coatings generally have on the substrate fatigue strength, demonstrate that this influence can be beneficial, and indicate that the influence might be maximized by maximizing the coating process details.

#### Alloys

Of the three alloys, EA33 showed the least effect of acid pickling and greatest beneficial response to shot peening. It showed the most consistent effect of the chromate and anodic coatings, which was deleterious, but not significantly so in the peened conditions and not at all on unpeened and unpickled surfaces. ZE41 alloy was moderately influenced by acid pickling but had good response to peening. The chromate and anodic coatings were not detrimental - but rather provided improved fatigue strength. The AZ91 alloy was the most degraded by pickling - but showed good response to peening. The chromate and anodic coatings data were the most inconsistent and provided generally deleterious influences which, in some cases were significant. Coating degradation of peened surfaces was worse than for the other two alloys but on bare surfaces increased fatigue strength occurred. Thus, the ZE41 alloy appears to have the best response with applied coatings. In both the screening and flexure fatigue tests, coated ZE41 fatigue strength was greater than for the other two alloys.

# ACKNOWLEDGEMENTS

Appreciation is expressed to Mr. W. Worden, Mr. F. Perry, and Mr. J. Stewart who effectively and efficiently handled and tested the very large number of specimens involved with this program. Mr. A. Galiaccio and Mr. M. Pelensky of the Frankford Arsenal provided important technical coordination with the corrosion test phase of the AVSCOM program including the provision of specimen coatings and treatments, specimen environmental exposures, and preliminary magnesium shot peening data. The valuable assistance Mr. J. Rinnovatore of the Frankford Arsenal provided as contract monitor is also recognized.

# REFERENCES

- (1) Bennett, J. A., "The Effect of an Anodic (HAE) Coating on the Fatigue Strength of Magnesium Alloy Specimens" ASTM Proceedings, 1955
- (2) Ketcham, S.J., "How Anodizing Affects Properties of Magnesium" Materials in Design Engineering, Oct 1962
- (3) Campbell, J.E., "Shot Peening for Improved Fatigue Properties and Stress-Corrosion Resistance" Battelle - Columbus, MCIC Report No. 71-02, of Dec 1971
- (4) Jankowsky, E.J., Viglione, J., and Ketcham, S.J., "The Effects of Metallic Coatings on the Fatigue Properties of High Strength Steels" Materials Protection and Performance, Vol II, No. 3, pp 31-36, of Mar 1972
- (5) Found, G.H., "Increasing Endurance of Magnesium Castings by Surface Work" Metals Progress, pp 51-54, of Aug 1951
- (6) Peterson, R.E., Stress Concentration Factors, Wiley, New York, 1974
- (7) Galiaccio, A., "Finishing of Magnesium Alloy Castings for Optimum Corrosion and Fatigue Resistance" Status Report No. 4, of Jan 1977
- (8) Harris, W.J., Metallic Fatigue, Pergamon Press, New York, 1961
- (9) Edgewertz, S. and Jarfall, L., "Review of Some Swedish Works on Aeronautical Fatigue During the Period May 197- April 1973," The Aeronautical Research Institute of Sweden Technical Note No. HE-1510, of June 1973
- (10) Beitel, G.A., "An Ultrasonic Device for the Study of Fatigue Crack Initiation in Anodized Aluminum Alloys" Corrosion Fatigue, pp 512-517, of 1972

# D I S T R I B U T I O N   L I S T

REPORT NO. NADC-77140-30

CUSTOMER PROJ NO. EJ-4-H0042-EJ-F6

	<u>No. of Copies</u>
NAVAIRSYSCOM (AIR-954) . . . . .	8
(2 for retention)	
(1 for AIR-320)	
(1 for AIR-520)	
(1 for AIR-5203)	
(1 for AIR-52022)	
(1 for AIR-530)	
(1 for AIR-411B4)	
COMNAVAIRSYSCOMREPLANT (Code 33) . . . . .	1
COMNAVAIRSYSCOMREPAC (Code 332) . . . . .	1
DDC . . . . .	12